DOE/CS/54209-28 (DE85017588)

ENOTON

7200

Section 1

NASA-CR-176119 DESS-017588-1985002 C021

EVALUATION OF HALF WAVE INDUCTION MOTOR DRIVE FOR USE IN PASSENGER VEHICLES

Final Report

By

R. G. Hoft

A. Kawamura

A. Goodarzi

G. Q. Yang

C. L. Erickson

LIBRARY GOPY

MAY 1 4 1885

LICERARY, NAS A

HAMPTON, VIRGINIA

March 21, 1985

Work Performed Under Contract No. AI01-78CS54209

University of Missouri-Columbia Columbia, Missouri

Technical Information Center
Office of Scientific and Technical Information
United States Department of Energy



DISCLAIMER

This report was prepared as an account of work sponsored by an agency of the United States Government. Neither the United States Government nor any agency thereof, nor any of their employees, makes any warranty, express or implied, or assumes any legal liability or responsibility for the accuracy, completeness, or usefulness of any information, apparatus, product, or process disclosed, or represents that its use would not infringe privately owned rights. Reference herein to any specific commercial product, process, or service by trade name, trademark, manufacturer, or otherwise does not necessarily constitute or imply its endorsement, recommendation, or favoring by the United States Government or any agency thereof. The views and opinions of authors expressed herein do not necessarily state or reflect those of the United States Government or any agency thereof.

This report has been reproduced directly from the best available copy

Available from the National Technical Information Service, U S Department of Commerce, Springfield, Virginia 22161

Price Printed Copy A11
Microfiche A01

Codes are used for pricing all publications. The code is determined by the number of pages in the publication. Information pertaining to the pricing codes can be found in the current issues of the following publications, which are generally available in most libraries. Energy Research Abstracts (ERA), Government Reports Announcements and Index (GRA and I), Scientific and Technical Abstract Reports (STAR), and publication NTIS-PR-360 available from NTIS at the above address

EVALUATION OF HALF WAVE INDUCTION MOTOR DRIVE FOR USE IN PASSENGER VEHICLES

FINAL REPORT

by

R. G. Hoft, A. Kawamura, A. Goodarzi,
G. Q. Yang and C. L. Erickson

March 21, 1985

for

JPL Contract Number 956728

Department of Electrical and Computer Engineering
University of Missouri-Columbia
Columbia, Missouri 65211

N85-34334#

TABLE OF CONTENTS

		Page
1.0	ABSTRACT	2
2.0	EXECUTIVE SUMMARY	3
3.0	TWO-PHASE BIFILAR INDUCTION MOTOR/INVERTER SYSTEM	
	3.1 SPECIFICATIONS	6
	3.2 SYSTEM DESCRIPTION	9
	3.2.1 CIRCUIT CONFIGURATION AND OPERATION	9
	3.2.2 PWM CONTROL OF INVERTER	13
	3.3 MOTOR DESIGN	15
	3.3.1 OPERATING POINTS	15
	3.3.2 NATURE OF INDUCTION MOTOR	15
	3.3.3 MOTOR DESIGN PROCEDURE	16
	3.3.4 COMPUTER-AIDED DESIGN	22
	3.3.5 EFFICIENCY	31
	3.4 INVERTER DESIGN	32
	3.4.1 SWITCHING DEVICE REQUIREMENTS	32
	3.4.2 POWER CIRCUIT	33
	3.4.3 TRANSIENT VOLTAGE	34
	3.4.4 CONTROL CIRCUIT	35
4.0	FINAL DESIGN AND EXPECTED PERFORMANCE OF TWO-	
	PHASE BIFILAR INDUCTION MOTOR/INVERTER SYSTEM	35
	4.1 MACHINE DATA	35
	4.2 INVERTER DATA	36
	4.3 INVERTER/MOTOR PERFORMANCE	36
	4.4 SYSTEM SCHEMATIC DIAGRAM	38
5.0	COMPARISON OF TWO-PHASE BIFILAR AND THREE PHASE	30
3.0	BRIDGE INVERTER/MOTOR SYSTEMS	40
	5.1 ADVANTAGES AND DISADVANTAGES OF TWO-	40
	PHASE SYSTEM	40
	5.2 SIMULATION RESULTS	42
	5.3 PERFORMANCE FUNCTION COMPARISON	49
6.0	CONCLUSIONS	50
•••	APPENDIX A MOTOR SPECIFICATIONS PROVIDED BY JPL	52
	APPENDIX B ALTERNATIVE INVERTER-MOTOR	72
	CONFIGURATIONS	62
	APPENDIX C IDEALIZED COMPARISON OF TWO-PHASE AND	-
	THREE-PHASE INVERTERS	65
	APPENDIX D DETAILED DESIGN OF TWO-PHASE BIFILAR	0.5
	INDUCTION MACHINE	73
	APPENDIX E MOTOR TRANSIENT TEMPERATURE RISE	97
	APPENDIX F DETAILED INVERTER DESIGN	104
	APPENDIX F DETAILED INVERTER DESIGN	130
	APPENDIX G SIMULATION RESULTS	130
	EQUATIONS IN STATIONARY REFERENCE	
		208
	FRAME	400

1.0 ABSTRACT

This report describes research performed at the University of Missouri-Columbia to devise and design a lower cost inverter-induction motor drive for electrical propulsion of passenger vehicles. A two-phase inverter-motor system is recommended. It is predicted to provide comparable vehicle performance, improved reliability and nearly a 10% cost advantage for a high production vehicle because of the reduction in total parts count, decreased total rating of the power semiconductor switches and somewhat simpler control hardware compared to the conventional threephase bridge inverter-motor drive system. The major disadvantages of the two-phase inverter-motor drive are that the two-phase motor is larger and more expensive than a threephase machine, the design of snubbers for the power switches is difficult because motor lead and bifilar winding leakage inductances produce higher transient voltages, and torque pulsations are relatively large because of the necessity to limit the inverter switching frequency to achieve high efficiency.

The conclusions of this research are based on analyses and simulations. An actual model of the two-phase system must be constructed and evaluated to prove the advantages claimed for the proposed system. The most challenging engineering design task will be to design the inverter, motor and snubber circuits to minimize transient voltages with high system efficiency.

2.0 EXECUTIVE SUMMARY

This report describes research performed at the University of Missouri-Columbia to devise a lower cost induction motor drive for use in electrical propulsion of passenger vehicles. The work was done during the period from January through August of 1984 in two phases.

Phase I - Concept and Feasibility Study
(January-May)

Phase II - Detailed Design and Performance Analysis
(June-August)

As a result of Phase I, three preferred candidate systems were identified.

- A. Half Wave Three-Phase Inverter-Motor (three power switches, three pairs of bifilar wound stator windings)
- B. Four Switch Three-Phase Inverter-Motor (four power switches two legs of conventional three-phase inverter, conventional three-phase machine, motor line returned to center-tap of dc source)
- C. Two-Phase Inverter-Motor (four power switches, two pairs of bifilar wound stator windings)

After a detailed analysis of the candidate systems at the beginning of Phase II, the two phase inverter-motor was selected as the lowest cost approach to meet the electrical passenger vehicle system requirements. Detailed analyses and digital computer simulations were carried out to design the inverter circuit and the two-phase induction motor required. The two-phase system has the following advantages over the conventional three-phase inverter-motor drive:

- 1. The number of power semiconductor switching devices is reduced from six to four.
- 2. The current rating of each power switch is 65% of that required for each switch in the equivalent three-phase system.
- 3. The total number of components is estimated to be about 70% of the number required for the three-phase circuit. This also implies higher reliability and lower manufacturing asembly cost.
- 4. The motor transient temperature rise is reduced due to the increased volume of copper.
- 5. Somewhat simpler control hardware is possible because of the common emitter circuit so that isolation is not required in the base drive circuits.
- 6. The total system cost is estimated to be about 90% of that for the three-phase system.

The overall efficiency is almost the same for the two-phase system and the three-phase system - approximately 91% at the 12kw, 80% speed operating condition.

The major disadvantages of the two-phase approach are increased motor size and cost, more difficult snubber design for transient voltage suppression, and greater torque pulsations.

For a high production electric passenger vehicle, the two-phase inverter-motor system developed on this research should provide significant cost advantages for the electric vehicle application when compared to the conventional threephase bridge inverter-induction motor Ιt drive. is important to note that the conclusions of this research are based on analysis and simulations. An actual model of the two-phase system must be constructed and evaluated to prove the advantages claimed for the proposed inverter-motor The most challenging engineering task will be to system. design the inverter, motor and snubber circuits to minimize transient voltages while retaining high system efficiency.

3.0 TWO-PHASE BIFILAR INDUCTION MOTOR/INVERTER SYSTEM

3.1 Specifications

The inverter-motor drive system requirements are defined by the contractual motor specifications in Appendix A. These system requirements are as follows:

Inverter input:

240V battery

Motor output:

- a. Shaft power output
 - 1) 30kW for 1 hour with 20% duty
 cycle at maximum speed
 - 2) 60kW for 3 minutes with 30/% duty cycle at 80% of maximum speed
 - 3) 16kW for 3 minutes with 30% duty cycle at 10% of maximum speed
- b. Maximum motor speed between 8,000 and 16,000 rpm
- c. Two or four pole motor, totally enclosed, convection cooled with 40°C maximum ambient air and 4000 hours operating life at 80% of maximum speed with 12kW output

Fig. 1 is a graphical representation of the motor requirements. It illustrates one method of satisfying the specifications. However, later in this section, an alternate motor design is described which results in a reduction in motor size and weight below that implied by



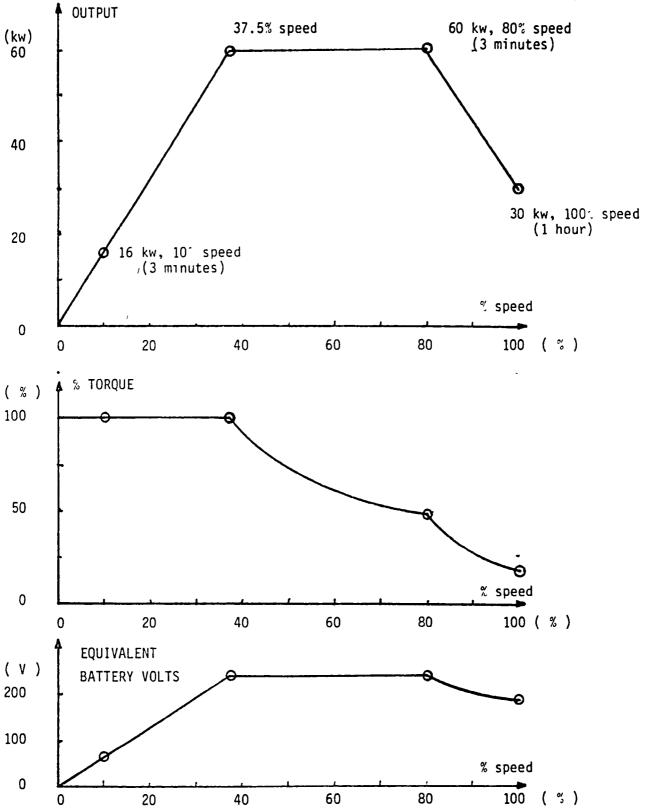


Fig. 1 Graphical Representation of Motor Requirements

Fig. 1. For Fig. 1, it is assumed that a constant volts/Hz is applied to the motor from zero speed to 37.5% speed. this range the air-gap flux is essentially constant, implying a constant torque capability and a linearly increasing output power with speed. At 37.5% speed, the maximum voltage available is required, and so the motor voltage is assumed constant from 37.5% speed to 80% speed. It should be noted that whenever the equivalent battery voltage is less than 240V, it is assumed that PWM control of converter output voltage is used to provide this voltage reduction. Since the output power requirement is only 30kW at 100% speed, it is possible to reduce the motor applied voltage from 80% to 100% speed. The capability implied by Fig. 1 would meet the specification requirements since the three specified operating points lie on the power vs. speed curve, which defines the power capability at each speed.

The inverter-motor system also is to be designed to minimize the function

F = Cost + 10 X Weight - 120 X Efficiency (1) where each of the parameters on the right side of this relationship is for the total inverter and motor system expressed as follows:

Cost = retail cost in dollars

Weight = total weight in kilograms

Efficiency = % efficiency at 80% of maximum motor speed with 12kW output

As a result of this research, a two-phase inverter/
motor drive is proposed. The remainder of this report describes the system design to meet, the specifications. In
addition, the report explains why the system proposed is considered the preferred induction motor approach for this
application.

3.2.1 Circuit Configuration and Operation

During the first phase of the research, several alternative inverter-induction motor combinations were considered. The following preferred candidate systems were selected for more detailed analyses:

- A. Half-wave inverter driven three-phase bifilar wound induction motor (Appendix B, Fig. B-1).
- B. Four switch inverter driven three-phase induction motor (Appendix B, Fig. B-2).
- C. Two-phase inverter driven induction motor with two pairs of bifilar wound stator windings as shown in Fig. 2.

As a result of an evaluation of each of these systems, including simulations to determine the peak current in the power switches at the 60kW - 80% speed operating point, the two-phase approach shown in Fig. 2 was selected. It has two significant advantages compared to the alternative candidate systems: (1) the lowest total power switch rating (the power switch peak current times its peak voltage times the

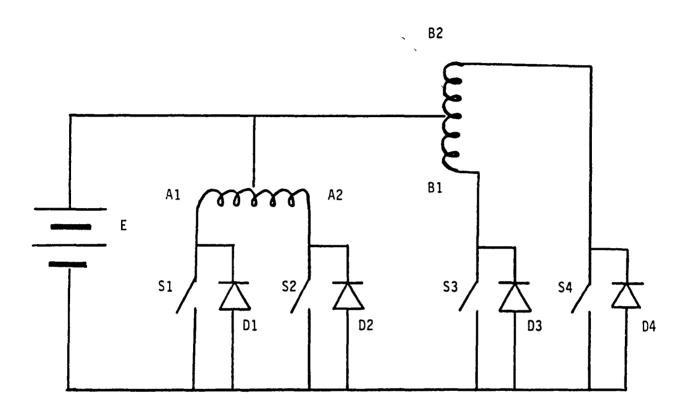


Fig. 2 Two-phase Bifilar Induction Motor/Inverter

number of switches required); (2) it is one of the two alternatives (Fig. B-1-b is the other) which may be arranged to have a common emitter connection with transistor switches or common cathodes if thyristors are used. This second advantage makes it possible to simplify the control hardware since gate or base drive isolation is not required. primary disadvantages of the scheme in Fig. 2 are that the motor size and weight is increased by 10%-20% compared with the three-phase bridge system (Fig. B-3), the power switch snubber design is more difficult since line and bifilar winding leakage inductances produce additional transient voltages, and there are relatively large torque pulsations because of the necessity to limit the inverter switching frequency to achieve high efficiency. Appendix C contains idealized comparative analysis of the two-phase and three-phase inverter arrangements.

The two-phase bifilar induction motor has only two stator phases, each of which includes a pair of tightly magnetically coupled coils. Fig. 2 shows the circuit configuration. Fig. 3 is an alternate circuit. However, Fig. 2 is the preferred approach since it simplifies the control hardware as mentioned previously. With transistor switches, all emitters are common, and all cathodes are common with thyristor switches. Thus, isolation is not required for the base drive or gate drive circuits.

Four switching devices and four free-wheeling diodes are required in the circuit of Fig. 2. The center-taps of

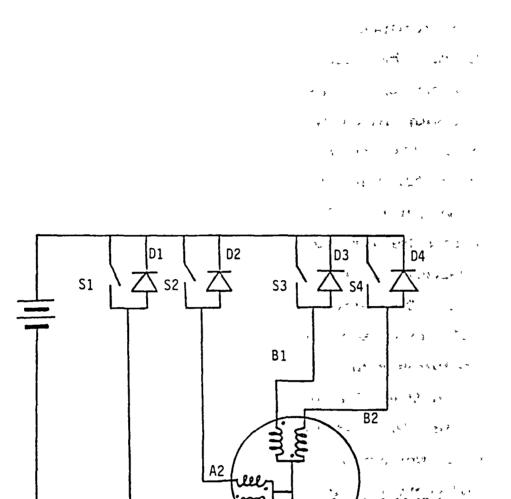


Fig. 3 Alternate configuration for Two-phase Bifilar Induction Motor/Inverter

the stator windings are connected to the positive side of the battery. The operation of the inverter is as follows. Suppose switch Sl is closed, and current is flowing from the battery through stator winding Al. When Sl is opened and S2 closed, the current through stator winding Al transferred to the bifilar winding A2. As a result. free-wheeling diode D2 conducts, and the stored energy in the winding returns to the battery. After this diode current reduces to zero, the current starts to flow through switch S2. The current in stator windings Bl and B2 is controlled in a similar manner. However, the conduction intervals for switches S3 and S4 are displaced 90 electrical degrees from those for S1 and S2. Controlling the two-phase currents in this fashion, a rotating magnetic flux is produced in the machine.

3.2.2 PWM Control of Inverter

PWM control is employed in the inverter system so that the current through the stator windings can be shaped to the optimum waveform. In the light load case, the current is shaped to approach a sinusoidal waveform as shown in Fig. 4-a. The switching pattern is controlled such that the stator current always stays within a given band from the sinusoidal function. With heavy load, a current waveform approaching a square wave is delivered to the motor to provide maximum power with minimum peak motor current as shown in Fig. 4-b.

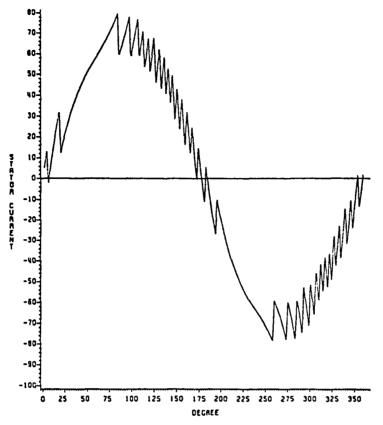


Fig. 4-a Current waveform for light load

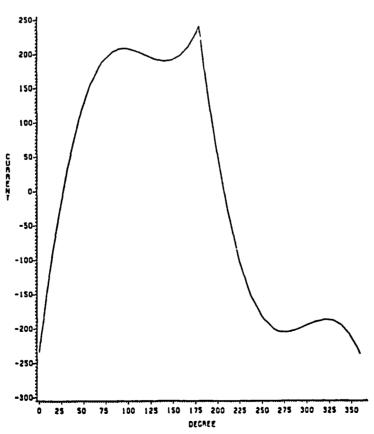


Fig. 4-b Current waveform for heavy load

With a microprocessor controller, it is also possible to control the PWM voltage waveform and the applied frequency to maximize efficiency at the 80% speed, 12 kW operating point. This might be accomplished by storing the required control program in memory, or possibly by an on-line efficiency optimization technique.

3.3 Motor Design

3.3.1 Operating Points

As indicated in section 3.1, three specific operating points are required.

16kW output at 10% speed (3 minutes, 30% duty)
60kW output at 80% speed (3 minutes, 30% duty)

30 kW output at 100% speed (1 hour, 20% duty)

The two-phase bifilar induction motor proposed must satisfy
the operating conditions at each of these points.

3.3.2 Nature of Induction Motor

The polyphase induction motor maximum power output as a function of inverter frequency is given by

$$P_{\text{max}} = C_1 \left(\frac{V}{f}\right)^2 f \tag{2}$$

where

$$C_1 \underline{\Delta} constant = \frac{3P}{8\pi L_{1r}}$$

P $\underline{\underline{\Delta}}$ number of poles

 \mathbf{L}_{1r} Δ rotor leakage inductance

V $\underline{\Delta}$ rms value of stator voltage

f $\underline{\underline{\Delta}}$ source frequency

When an induction motor is connected to an inverter, a similar maximum output is achieved, neglecting the effects of harmonics. Since the output voltage and frequency of the inverter may be adjusted, the maximum output power given by (2) can be changed, depending on the speed control strategy. If V/f is maintained constant over the low frequency range, the maximum power is proportional to the frequency (or rotor speed). After maximum stator voltage V is reached, the maximum power decreases proportional to 1/f since V is constant and f increases. In Fig. 5, generalized curves for the maximum power P_{max} , rated power P_{R} , stator current I_{P} , stator voltage V, and slip frequency f_{S} are plotted as a function of rotor speed.

The rated output power as a function of slip frequency \mathbf{f}_{SR} , which may change at different source frequencies, is

$$P_{R} = C_2 \left(\frac{V}{f}\right)^2 f f_{SR}$$
 (3)

where

$$C_2$$
 = constant = $\frac{3P}{2R_2}$

 $R_2 = \frac{\Delta}{2}$ rotor resistance

 f_{SR} = rated slip frequency at different source frequencies

3.3.3 Motor Design Procedure

For these discussions, the following variables are defined:

Peak outnut power; Corresponding peak stator current; Corresponding peak stator voltage and slip frequency f_{smax}

Rated outnut power; Corresponding rated current; Corresponding rated stator voltage and rated slip frequency f_{SR}

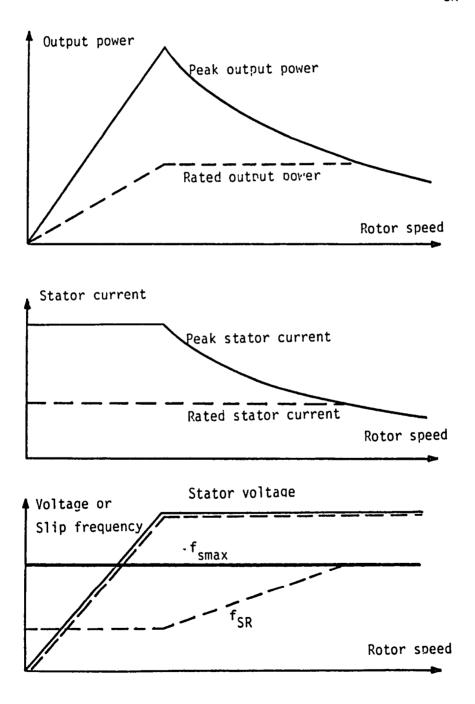


Fig. 5 Generalized motor characteristics

Base frequency f_B $\underline{\underline{\wedge}}$ the design frequency for the motor (the frequency when V reaches a maximum)

Base output P_B $\underline{\underline{\Delta}}$ the rated output at the base frequency

Base current $\mathbf{I}_{\mathbf{B}}$ $\underline{\underline{\Delta}}$ the current which produces rated output at the base frequency

Base voltage $\mathbf{V}_{\mathbf{B}}$ $\underline{\underline{\boldsymbol{\Delta}}}$ the motor voltage at base frequency

Peak output power P $_{p}$ $\stackrel{\Delta}{=}$ the maximum output power at $_{B}$

Peak current I_P $\underline{\underline{\wedge}}$ the current which achieves \underline{P}_P

There is a simple relation between these variables:

$$\frac{P_{p}}{P_{B}} = \frac{I_{p}}{I_{B}} = \frac{f_{smax}}{f_{SR}}$$
 at f_{B} (4)

where \mathbf{f}_{smax} is the maximum slip frequency which produces $\mathbf{P}_{\mathbf{p}}$ at $\mathbf{f}_{\mathbf{R}}$

Fig. 6 shows three possible motor designs. One possible design to satisfy the specifications is shown by the B curves in Fig. 6, where the maximum power output is 16kW at 10% speed and 60kW at 80% speed. However, this is not the optimum motor design, because the peak current is

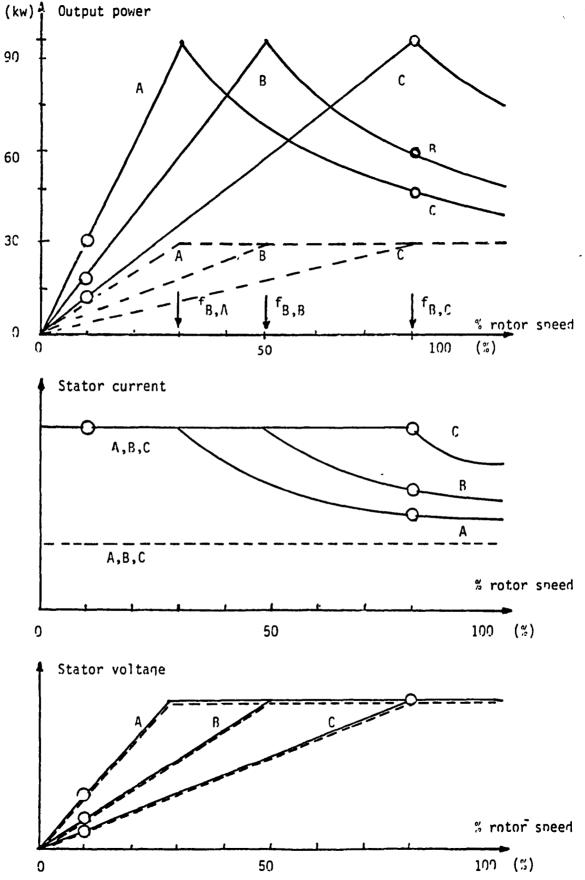
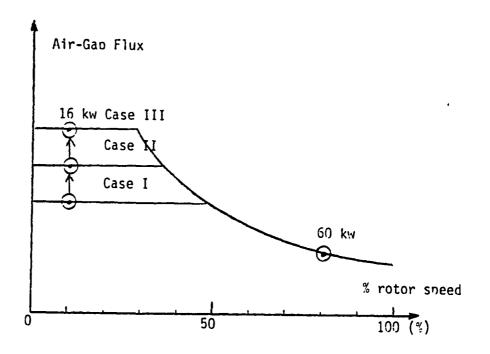


Fig. 6 Three-phase possible machine designs

excessive at low speed and the motor weight is not a minimum. It is very important to have minimum peak current since the power switch device ratings are determined by the maximum current through the devices. The peak current can be reduced for a given output power by lowering the base frequency, but this increases the size of the machine. Therefore, the base frequency should be increased, resulting in a smaller machine. Then, the voltage should be increased at low frequency to saturate or overexcite the machine. This permits higher power output with reduced peak current and minimum motor size and weight. The optimum machine design should have nearly equal peak currents at 10% speed.

Constant V/f operation means nearly constant air-gap flux. Thus, by increasing the V/f ratio, oversaturated air-gap flux can be achieved. Since output power is proportional to the product of air-gap flux and rotor current, larger air-gap flux helps to decrease the rotor current, and as a result, lower stator current can deliver the same output power. This mechanism is shown in Fig. 7. Case I on this figure corresponds to case B on Fig. 6. In the digital simulation program, this saturation effect can be easily checked by sensing the magnetizing current. Thus, by a trial and error method, oversaturation of air-gap flux is simulated, and stator current can be reduced until the allowable saturation flux is reached.

Also, when the motor is operated at the overloaded output, the temperature rise due to the greater loss is a



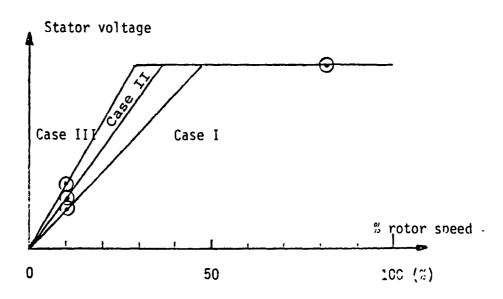


Fig. 7 Mechanism of air-gap flux saturation

very important factor for machine design. In summary, the induction motor design is optimized when the following conditions are satisfied:

- 1. 60kW output is designed to be maximum output power at 80% speed.
- 2. 16kW output at 10% speed is achieved by oversaturation of air-gap flux so that the peak current is almost the same as that for 60kW at 80% speed.
- 30kW output is equal to the rated output at 100% speed.
- 4. The temperature rise at the overload condition is within an allowable range.
- 5. The weight of the motor is minimized.

3.3.4 Computer-Aided Design

The design of the two-phase induction motor involves four steps. A flow chart is given in Fig. 8.

Step 1: Choose the Base Operating Point

Since a machine can be almost uniquely designed at a base operating point (base frequency, base voltage and base output power), the base point should be selected carefully so that the designed machine is the optimum one satisfying all required operating conditions. Usually one must come back to Step 1 after checking the given conditions in Step 3.

Maximum frequency and pole number

For a given power rating, the size and the weight of an ac machine decrease as the rated frequency increases. On

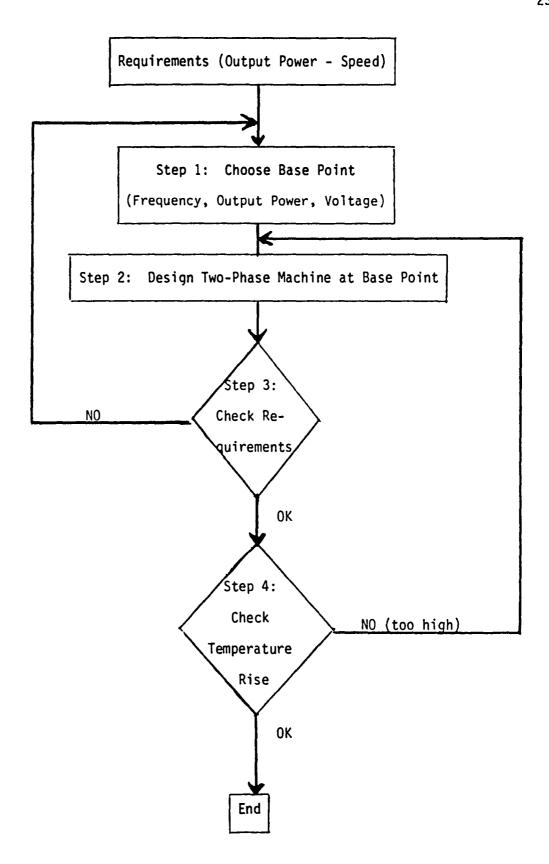


Fig. 8 Design flow chart

the contrary, the iron loss increases at high frequency, and the mechanical bearings become very expensive at high rotor speeds. A rotor maximum speed of 12,000 rpm is chosen because this is believed to provide a reasonable practical trade-off between losses, weight and bearing cost. For a given power rating and maximum speed, as the pole number increases, the maximum ac source frequency increases, which causes greater iron loss and switching loss. Thus, a two-pole machine is chosen, which sets the maximum ac source frequency at 200Hz.

Base voltage, base frequency and base output power The base operating condition to establish the motor design is chosen as the 30kW output, 40% speed point shown in Fig. 9. The base voltage is selected as follows. With the PWM technique, the peak value of the fundamental component of the output voltage can change from zero to a maximum of (4/ π)(V $_{DC}$), where V $_{DC}$ is the battery voltage of 240V. The motor is designed such that the applied voltage as a function of speed changes as shown in Fig. 10. The V/Hz (Volts/ Hertz) is constant from zero to 40% speed. From 40% to 80% speed, the V/Hz is reduced with speed as the voltage is linearly increased to a maximum of 306V peak at 80% speed. Then the voltage is fixed at the maximum value from 80% speed to 100% speed. A base voltage of 241V peak at 40% speed is chosen by an iterative technique. Since, roughly speaking, the induction motor output power is proportional to the square of the applied voltage and inversely proportional to the applied frequency $(P \propto V^2/f)$,

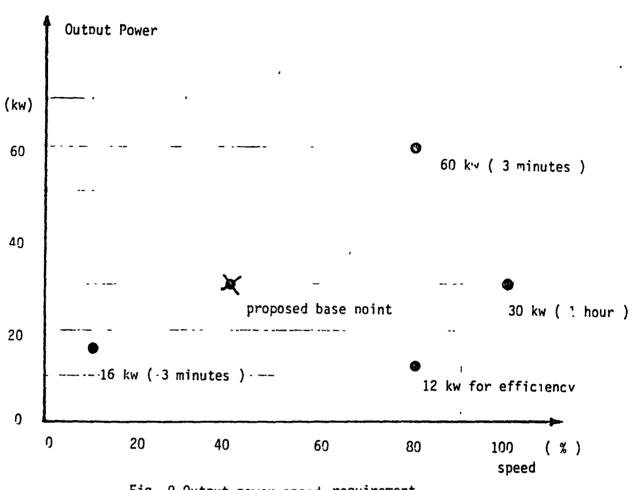


Fig. 9 Output power-speed requirement

Note:

• are specification operating points.

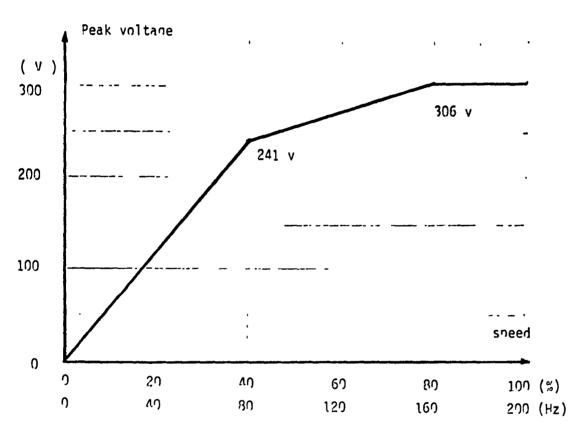


Fig. 10 Motor fundamental peak voltage vs. speed or frequency for proposed base point

the proposed voltage variation in Fig. 10 implies that the rated output power at different speeds is

7.5kW at 10% speed
30kW at 40% speed
38kW at 80% speed
30kW at 100% speed

The 16kW, 10% speed point requires about twice the rated output power that would be delivered with the low speed range constant V/Hz of 241V/80Hz. (This implies approximately 60V at 10% speed, or 20Hz.) Thus, the motor voltage must be increased above 60V at 10% speed to provide 16kW. When the voltage is increased at a given frequency, the air-gap flux increases, which drives the machine further into saturation. This may result in excessive motor current due to the reduction of the magnetizing reactance. the motor voltage required for maximum power at 10% speed must be high enough to drive the machine into saturation without excessive current. However, if the V/Hz is too high at 10% speed, it will be too low at 80% speed because the maximum voltage available with a 240V source will be reached at a lower speed. A low V/Hz at 80% speed will mean that the 60kW output cannot be achieved.

Step 2: Design the Machine at the Base Operating Point

The detailed design of the induction motor, both in mechanical and electrical characteristics, is included in Appendix D. When the base operating point is given, the

machine is essentially uniquely defined. The final design is determined in Appendix D after several iterative trials. The resulting machine parameters are as follows:

External diameter	D _o	11.5 inches
Internal diameter	D	5.75 inches
Rotor length	L	6.3 inches
Weight	W	≃ 190 lb (≃ 86kg)
Stator resistance	R _s	0.0274 Ω
Rotor resistance	R _r	0.0213 Ω
Magnetizing inductance	L _m	13.86mH
Stator leakage inductance	L _{ls}	0.25mH
Rotor leakage inductance	^L lr	0.27mH
	_ ,	-· - · ·

Step 3: Check the Output Power by Simulations,

Considering Saturation Effects

Since the machine is designed for the base operating point, the maximum output power should be checked by digital simulations, including the saturation effect of the air-gap flux. Appendix G describes the detailed simulations.

Fig. 11 shows the simulation results for the output power-speed relations at 10%, 40%, 80% and 100% speed of the finally designed motor, when the stator current is limited to 245A peak. All of the specified operating points are satisfied. At the maximum power output of each curve, the current is almost a square wave since this current waveform results in more power output than with sinusoidal current for the same peak current. At the 16kW, 10% speed point, the greatest saturation of the magnetic core occurs. The

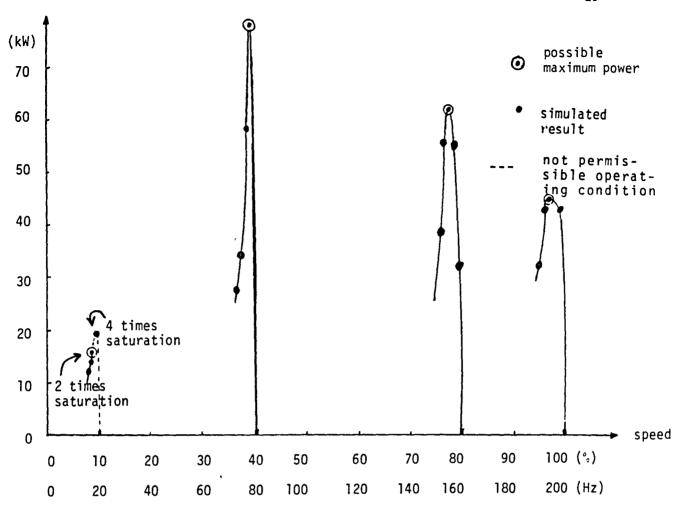


Fig. 11 Output power-speed curves of two-phase motor from simulations.

(Peak current limited to 245 A)

saturation effect of the core is implemented in the simulation study by changing the magnetizing and leakage inductances of the machine. If the magnetizing current exceeds the allowable limit, then the magnetizing and leakage inductances are replaced with adjusted values, which are calculated from the B-H curve. This modification is easily implemented in Step 2. If the magnetizing current still exceeds the allowable limit, which occurs for very low slip frequency, then this is not considered a permissible operating condition.

At the 60kW output, 80% speed operating point, undersaturation of the core occurs because the voltage is not high enough to produce rated flux. In this case, when the magnetizing current in the simulation is below the allowable limit, the magnetizing and leakage inductances are recalculated in Step 2 using the B-H curve.

Step 4: Check the Temperature Rise

Most of the heat generated in the machine comes from the copper loss, which is proportional to stator resistance times the square of the current. According to the simulation results, the rms currents at the given operating points are as follows:

- 1) 16kW at 10% speed (3 mins., 30% duty) I_{1rms} = 200A
- 2) 60kW at 80% speed (3 mins., 30% duty) $I_{1rms} = 175A$
- 3) 30kW at 100% speed (1 hour) I_{1 rms} = 115A

Assuming a conventional rotor fan type construction, the air flow is reduced at lower rotor speeds so that the worst-case cooling condition is the 10% speed point. If the

the highest transient temperature rise occurs for the 16kW, 10% speed operating point. Since this condition continues for three minutes with a 30% duty cycle, the load pattern is assumed to be 16kW for three minutes, followed by no output for seven minutes, repeated several times. The temperature rise is estimated by solving the heat balance differential equations (Appendix E). The estimated temperature rise is 50°C The bifilar windings help to reduce the temperature rise because of the increased volume of copper. The temperature rise is higher if the same heat loss is generated in a smaller volume of copper.

In the calculation of the temperature rise, the most pessimistic conditions are considered. First, static air is assumed for the heat dissipation. Next, the heat transfer to the core and frame is neglected. Thus, the actual temperature rise should be somewhat less than 50°C.

3.3.5 Efficiency

In accordance with the JPL specifications, the most important operating point from the standpoint of efficiency is the 12kW, 80% speed point. The theoretical approach to optimize the efficiency of an induction machine implies that the magnetizing current should be equal to the rotor current.* But, since the V/hz is reduced at the 80% speed

^{*} T. W. Jian, N. L. Schmitz, D. W. Novotny, "Characteristic Induction Motor Slip Values for Variable Voltage Part Load Performance Optimization," IEEE PAS, Jan. 1983, pp. 38-46.

point, the magnetizing current does not reach the optimized value because of the undersaturation of the air-gap flux. Thus, the best that is possible is to make the magnetizing current its maximum value and to control the current to get 12kW output at 80% speed. Simulation results, performed by an iterative method changing the slip frequency and the amplitude of the sinusoidal motor current, give 98.6% efficiency at a slip frequency of 1.16Hz (0.725% slip). The current and output power are shown in Appendix G. The pulsating power is ±65%. These simulations neglect the iron loss, stray loss, and mechanical losses. If these losses are included, the efficiency is expected to be about 95%.

3.4 Inverter Design

3.4.1 Switching Device Requirements

In Step 3 of the design procedure in the previous section, three given output power-speed operating points were checked by simulations. The maximum peak current through the stator winding is 245A when either 16kW at 10% speed or 60kW at 80% speed is required. Since the forward blocking voltage of the device is two times 240V, the total VI rating of the devices for the two-phase inverter will be $(240 \times 2 \times 245) \times 4 = 470kVA$.

From the viewpoint of the power dissipation in the switching devices, 16kW output at 10% speed produces the maximum switching loss. From the simulations, the switching frequency is 3.4kHz at 16kW, 10% speed, and 160Hz at 60kW, 80% speed.

In summary, the switching device requirements are

Peak current = 245 A

RMS current = 200.5A

Maximum switching frequency = 3.4kHz

Peak voltage (not including transients) = 480V

3.4.2 Power Circuit

As a result of a study of the available transistor and thyristor devices to meet the switching requirements for this application, MG300M1FK1 Toshiba power transistors are recommended. These transistors have 1000V blocking capability, 300A dc rating and 1.6kW maximum power dissipation capability. Thus, this Toshiba transistor provides a nominal dc voltage safety factor of 1000/480 = 2.08 and an rms current safety factor of $300 \times \sqrt{2} = 2.12$. (Note: This does not include the transient voltages across the transistors.)

The two-phase inverter requires four power switch modules, each of which includes a Darlington power transistor, a freewheeling diode, a snubber circuit and a base drive. However, only one heat sink is required since the MG300M1FK1 transistor is an isolated package. Also, no base drive isolation is necessary for the circuit of Fig. 2 with common emitters.

The two-phase and three-phase inverter circuits both can deliver power to the motor load or take power from the source. This is accomplished by the proper control of the inverter switching instants relative to the ac voltage generated by the load machine, which produces a negative

slip. Appendix G.5 gives simulation results for regenerative operation.

The detailed inverter design is described in Appendix F.

3.4.3 Transient Voltage

The two-phase system does present a more difficult snubber design problem because of the leakage inductances that will be present in the bifilar windings and because of the inductances in the motor leads from the inverter to the motor. It will be necessary to use special techniques to minimize the motor lead inductance, such as using parallel closely spaced flat conductors between the inverter and the motor or packaging the inverter essentially on the motor housing.

The amplitude of the voltage spike primarily depends on the equivalent leakage inductance of the bifilar winding and the lead inductance between the inverter and motor. The energy stored in these inductances must be dissipated in the snubbers. Based on estimated practical values of total leakage and lead inductance, the voltage spike phenomena can be simulated by the digital computer, as shown in Appendix F. However, a precise design of the snubbers required can be accomplished only through experiment with an actual model of the inverter.

As shown in Appendix F, the peak transistor voltage is about 900V with 4 μH total lead and leakage inductance. However, if the inductance is reduced to $l\mu H$, the peak transistor voltage is approximately 600V. This would reduce the

transistor voltage safety factor from 2.08 (as given in the previous section) to about 1.6, which is still a quite reasonable voltage safety factor.

3.4.4 Control Circuit

A microprocessor controller will be used, which consists of an MPU, ROM, RAM, timer, I/O port and current sensors which can provide a variety of speed and torque controls. In either case using PWM, the speed or torque controller generates the frequency and amplitude commands for the stator current. This current is regulated so as to stay within a hysteresis band of the reference command by PWM control of the inverter. Also, the switching frequency is monitored and limited to less than 3.4kHz. The maximum fundamental inverter frequency command is 200Hz.

The use of the microprocessor permits the implementation of very sophisticated controls to provide optimal efficiency at any operating point and protection of the drive system.

4.0 FINAL DESIGN AND EXPECTED PERFORMANCE OF A TWO-PHASE INVERTER/BIFILAR INDUCTION MOTOR SYSTEM

4.1 Machine Data

External diameter $D_0 = 11.5$ inches

Internal diameter D = 5.75 inches

Rotor length L = 6.3 inches

Weight $W \simeq 190 \text{ lb } (\simeq 86 \text{kg})$

Output rating 30kW

Number of phases 2

Base frequency 80Hz

Maximum speed	12,000 RPM
Base voltage (rms)	170V
Base current (rms)	110A
Stator resistance	$R_S = 0.0274 \Omega$
Rotor resistance	$R_r = 0.0213 \Omega$
Magnetizing inductance	$L_{\rm m} = 13.86$ mH
Stator leakage inductance	$L_{1s} = 0.25$ mH
Rotor leakage inductance	$L_{lr} = 0.27mH$
Inverter Data	
Power switching devices	(4) Toshiba
	MG300M 1FK1
	Transistors
Input voltage	240V
Output voltage	240V (peak or rms)
Output current	245A peak; 200A rms
kVA rating	96kVA
kW rating	60kW
Maximum output frequency	200Hz

Estimated efficiency

4.2

at 12kW, 80% speed operating

Maximum switching frequency

point 95.4%

4.3 <u>Inverter/Motor Performance</u>

The digital computer simulations described in Appendix G provide the following performance data at the specified operating points:

3.4kHz

16.4kW output at 10% speed

Slip frequency = 1.7Hz (slip = 8.50%)

Switching frequency = $3.4 \, \text{kHz}$

Stator peak current= 245A*

Stator rms current = 200A

Pulsating torque = +20%

60.5kW output at 80% speed

Slip frequency = 3.2Hz (slip = 2%)

Switching frequency = 160Hz

Stator peak current = 245A**

Stator rms current = 175A

Pulsating torque = +30%

13.1kW output at 80% speed

Slip frequency = 1.16 Hz (slip = 0.725%)

Switching frequency = 1.6 kHz

Stator peak current = 103A***

Stator rms current = 53.2A

Pulsating torque = +65%

^{*}The current is a PWM controlled wave form with a square wave envelope 205+40A.

^{**}The inverter voltage is a square wave producing an unmodulated current waveform.

^{***}The current is a PWM controlled sinusoidal waveform with an envelope of \pm 38A.

Motor efficiency (only with copper loss) = 98.6%

Motor efficiency (with 3.4% iron and stray

mechanical loss) = 95.2%

Inverter efficiency (with snubber, on-state and
 switching loss) = 95.4%


Total efficiency = 91%

4.4 System Schematic Diagram

The complete schematic diagram of the inverter/motor drive system is shown in Fig. 12.

As mentioned previously, transient voltages are produced by lead inductances and leakage inductances due to imperfect coupling between the bifilar motor windings. With the input capacitor connected across the inverter dc bus very close to the inverter transistors and motor windings, the dc lead inductance is minimized. Snubber circuits are included to suppress voltage transients due to the imperfect coupling between bifilar windings and the inductance of the leads between the inverter transistors and motor windings. This also implies that the inverter transistors must be mounted very close to the motor.

The design of the snubbers is discussed in Appendix F. However, the precise snubber configuration can be determined only through experimentation with an actual model of the inverter. A final optimum arrangement may include varistors and additional capacitors.

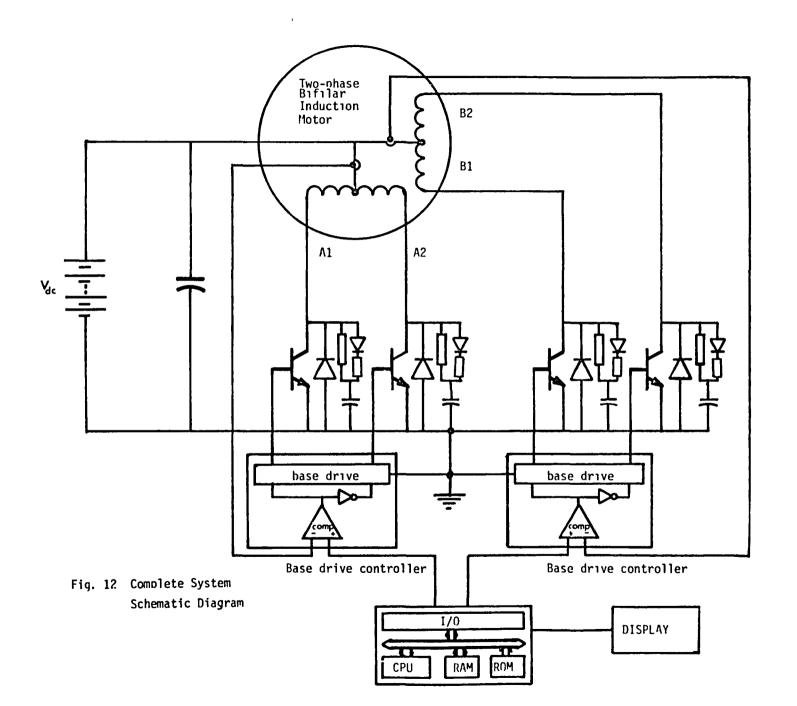

The base drive circuits are critical for reliable power transistor operation with minimum switching loss. Current sensors are required to detect each motor winding current for the PWM controlled current operations as well as for overcurrent protection. Sophisticated control strategies can be implemented in the microprocessor software.

5.0 COMPARISON OF TWO-PHASE BIFILAR AND THREE-PHASE BRIDGE INVERTER MOTOR SYSTEMS

5.1 Advantages and Disadvantages of Two-Phase System Advantages

- A. The number of power switching devices is reduced from six to four.
- B. The current rating of each power switch is 65% of the value required for the three-phase bridge inverter (Fig. B-3). This has been verified by simulation as shown in Table II of the next section.
- C. The total number of components is estimated to be about 70% of the number required for the three-phase system. Since four transistor switches are used instead of six as in the thre-phase bridge inverter, this would imply about two-thirds as many components. However, some circuits are not repeated for each switch and the snubbers are more complex for the two-phase inverter. The component count reduction also implies higher reliability and lower manufacturing assembly cost.

- D. The motor transient temperature rise is reduced due to the increased volume of copper.
- E. The control hardware is somewhat simpler due to the common emitter arrangements so that isolation is not required in the base drive circuits.
- F. The total component cost for the two-phase system is estimated to be about 90% of that for the three-phase system. This cost reduction cannot be proven until prototype equipments are manufac-The cost will be reduced because of the reduced total number of components, the elimination of the need for base drive circuit isolation, and the reduced peak current in the transistor switches. However, the cost will greater because of the higher peak transistor voltages required, the need for very effective snubbers to minimize transient voltages, the requirement for a somewhat larger motor than for three-phase, and the necessity to minimize motor bifilar winding leakage inductances and lead inductances in the inverter current switching It is presently estimated that these paths. tradeoffs will result in reducing the two-phase system cost to about 90% of that for a threephase inverter/motor drive.

Disadvantages

A. The size, weight and cost of the two-phase motor is greater than for the three-phase machine. It

is estimated that an equivalent three-phase motor would have 85% of the weight and 90% of the cost of the two-phase bifilar machine.

- B. The design of the snubbers for the power switches is more difficult since motor lead inductances and bifilar winding leakage inductances produce additional transient voltages.
- C. The torque pulsations are relatively large because of the necessity to limit the inverter switching frequency to achieve high efficiency.

5.2 Simulation Results

Digital simulations to compare the two-phase and three-phase systems are presented in Appendix G. Table I lists the parameters used for the simulations. The results of these simulations are summarized in Tables I and II.

Fig. 13-a shows the stator voltage and current per phase, and Fig. 13-b shows the instantaneous output power for the two-phase machine. Fig. 13-c and Fig. 13-d show the corresponding variables for the three-phase machine.

The output power or torque pulsations are greatest for the two-phase system at the 60kW operating point since a square wave voltage is supplied from the two-phase inverter. However, at the 12kW operating point, with sinusoidal current control, the torque pulsations of the two-phase system are nearly as large because the inverter switching frequency must be limited to achieve high efficiency.

Table I Machine Parameters

Bifilar Two-Phase Induction Motor	Three-Phase Induction Motor
(at 160Hz)	(at 320Hz)
0 0 0074	
R _s =0.0274	R _s =0.00578
R _r '=0.0213	R _r '=0.0038
L _{ls} =2.94x10 ⁻⁴ H	L _{ls} =5.95x10 ⁻⁵ H
L _{lr} =3.23x10 ⁻⁴ H	L _{lr} =7.0x10 ⁻⁵ H
L _m =26.8x10 ⁻³ H	L _m =3.32×10 ⁻³ H
Weight=86kg	Weight=73kg

Note: A four pole three-phase motor was used for this comparison because more commercial data was available to us on this type of machine. However, we believe a two pole three-phase machine is somewhat preferable.

Table II Comparison of Two-Phase and Three-Phase Inverter-Motor System

Case I: 80% speed, 60kW output (for peak current comparison)

Two-Phase Induction Motor

Peak current I_p=245A

rms current I_{rms}=175.8A

slip = 2.0%

 $P_{out} = 60.5kW$

frequency = 160.0Hz

Three-Phase Induction Motor

Peak current I_p=375A

rms current I_{rms}=243A

slip = 1.25%

 $P_{out} = 60.2kW$

frequency = 329.8Hz

Case II: 80% speed, 12kW output (for efficiency comparison)

Two-Phase Induction Motor

Peak current $I_p = 103A$

rms current I_{rms}= 53.2A

slip = 0.725%

 $P_{out} = 13.1kW$

frequency = 160Hz

efficiency (only copper loss)=98.6%

Three-Phase Induction Motor

Peak current I_n=105A

rms current I_{rms}=66A

slip = 0.8%

P_{out} = 12.5kW

frequency = 329.8Hz

efficiency (only copper loss)=98.9%

VOLTAGE & CURRENT (80% S,60KW,MOTOR OPERATION)

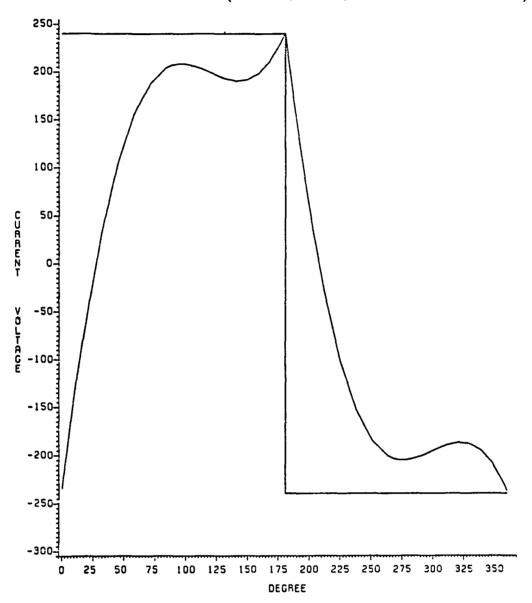


Fig. 13-a Two-phase

OUTPUT POWER (80% S, COKW, MOTOR OPERATION)

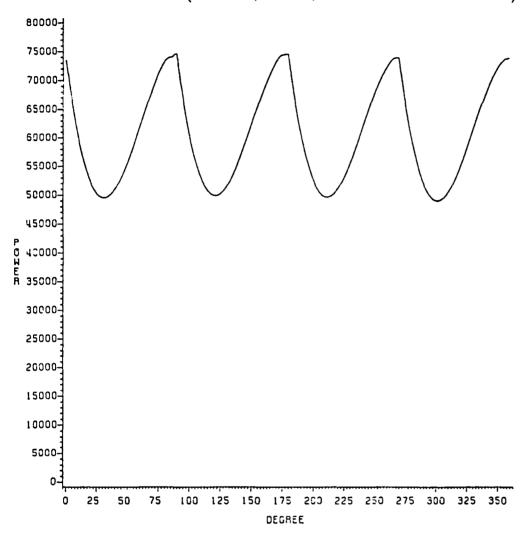


Fig. 13-b Two-phase

VOLTAGE & CURRENT (80% SPEED, MOTOR OPERATION)

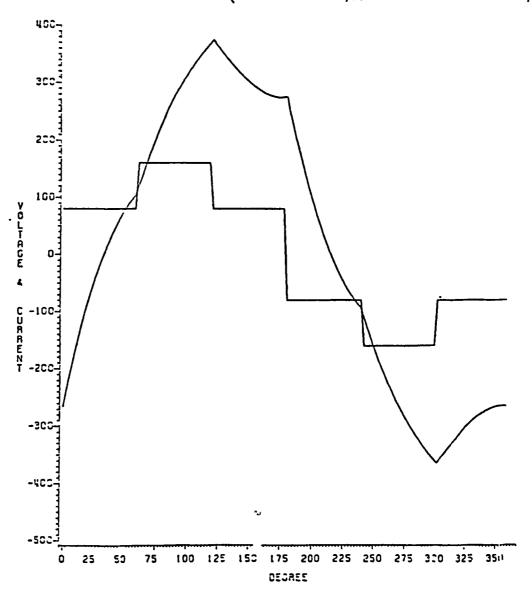


Fig. 13-c Three-phase

OUTPUT POWER (80% SPEED MOTOR OPERATION)

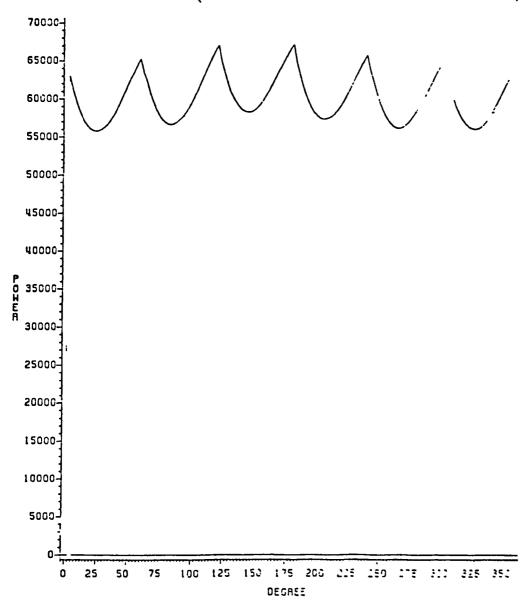


Fig. 13-d Three-phase

\$1200

5.3 Performance Function Comparison Machine: The following data are used 1) Cost of two-phase machine \$360* Cost of three-phase machine \$325* 2) Weight of two-phase machine 86kg Weight of three-phase machine 73kg 3) Efficiency at 12kW, 80% speed Two-phase machine 95 % Three-phase machine 95% Performance function F (F=C + 10W - 120E) 4) Two-phase machine -10.1K Three-phase machine -10.3K Inverter: The following data are used 1) Estimated manufacturing cost of two-phase inverter \$1000 Estimated manufacturing cost of threephase inverter \$1200 2) The weight and efficiency of the two-phase and three-phase inverters are estimated to be essentially the same. 3) Performance function (neglecting the weight and efficiency terms) Two-phase inverter \$1000

Three-phase inverter

^{*}These are best judgment estimates assuming at least 10,000 units/year.

Inverter-Motor System: (Including only the parameters in the Performance Function which are different.)

Two-phase system \$360+\$1000+\$10X86=\$2220
Three-phase system \$325+\$1200+\$10X73=\$2255

Thus, the two-phase system has only a very slight advantage over the three-phase system based on the Performance Function.

6.0 CONCLUSIONS

The proposed two-phase inverter-motor drive has the following advantages over the traditional three-phase bridge inverter-motor system:

- The number of power semiconductor switching devices is reduced from six to four.
- 2. The current rating of each power switch is 65% of that required for each switch in the equivalent three-phase system.
- 3. The total number of components is estimated to be about 70% of the number required for the three-phase system. This also implies higher reliability and lower manufacturing assembly cost.
- 4. The motor transient temperature rise is reduced due to the increased volume of copper.
- 5. Somewhat simpler control hardware is possible because of the common emitter circuit so that isolation is not required in the base drive circuits.

6. The total component cost is estimated to be about 90% of that for the three-phase system.

The overall efficiency of the two systems is about the same and the Performance Function in the JPL Specifications is also nearly equal for the two-phase and three-phase systems.

The major disadvantages of the two-phase system are:

- 1. The weight and cost of the two-phase machine are greater. It is estimated that the three-phase machine would have 85% of the weight and 90% of the cost of the two-phase bifilar machine.
- 2. The snubber requirements for the inverter power transistors are much more severe for the two-phase inverter since motor lead inductances and bifilar winding leakage inductance produce additional transient voltages.
- 3. The torque pulsations are relatively large because of the necessity to limit the inverter switching frequency to achieve high efficiency.

For a high production electric passenger vehicle, the two-phase inverter-motor system developed on this research should provide significant cost advantages for the electric vehicle application when compared to the conventional three-phase bridge inverter-induction motor drive. It is important to note that the conclusions of this research are based on analysis and simulations. An actual model of the two-phase system must be constructed and evaluated to prove the advantages claimed for the proposed inverter-motor system. The most challenging engineering task will be to design the inverter, motor and snubber circuits to minimize transient voltages while retaining high system efficiency.

APPENDIX A

MOTOR SPECIFICATIONS PROVIDED BY JPL

EXHIBIT I

Induction Motor Specification

The following is a specification for an ac induction motor to be used in conjunction with a Pulse Width Modulated (PWM) Inverter and a 240 volt battery for propulsion of electric vehicles using a fixed ratio gear reduction.

I. BACKGROUND

Numerous traction drives have been developed using inverter driven induction motors. In all cases the inverter converts dc battery power into three-phase power of controlled frequency and voltage. While control algorithms vary, with all schemes, the electrical frequency is maintained close to the mechanical frequency and the voltage to frequency ratio is maintained below a critical maximum (lest magnetic saturation occur).

Compared with dc systems, such ac drives are advantageous in that inherent four quadrant performance is achieved, motor cost is greatly reduced, motor weight and losses are approximately halved while motor maintenance is virtually eliminated. Until recently, however, these advantages were offset by cost, weight, and inefficiency problems of the inverter.

II. SYSTEM DESIGN PHILOSOPHY

With traction drives, where PWM inverters provide the ac power, the usual constraints of voltage and frequency are nonexistent. Accordingly, the requirement for producing torque under high slip conditions is deleted, and thus the

need for compromise between "starting characteristics" versus "running efficiency" is eliminated. Accordingly, traction type machines are designed for maximum efficiency with minimal rotor resistance.

For each torque-speed point of operation, a range of excitation voltage-slip frequency values may be however, only one value of voltage and slip frequency produces optimal efficiency. With modern inverter technology it is possible to control both voltage and frequency such that optimal system efficiencies prevail over the entire torque speed plane. From experience it has been found that the optimal solution corresponds to maintenance of a constant slip frequency with the excitation voltage per Hertz varying roughly as the square root of the torque. Since selection of the inverter control parameters flexible, it follows that the appropriate optimization sequence is:

- 1. Design optimized motor.
- 2. Characterize this motor.
- Design appropriate inverter control algorithm.
 The above philosophy is embodied in the attached specification.

With traction systems, cost, weight, and efficiency parameters are of key importance. In order to meaningfully optimize these parameters, relationships must be established between these parameters. From JPL studies it has been found that for passenger vehicles the "cost of weight" is

approximately \$10/kg and the value of efficiency is approximately \$120/%. Accordingly, for both the motor and the inverter, the total cost, C¹, to be minimized is:

$$c^1 = c + 10W - 120E \tag{1}$$

where C is the retail dollar cost

W is the weight in kg

E is the efficiency in %

Since efficiency is primarily important in terms of range and since maximum range is under freeway conditions, E is defined under the speed and power conditions associated with freeway driving (55 mph, 12 kW shaft output).

A totally enclosed convective cooled design is recommended since:

- Expected heat loss is low as motor efficiency will be in the range of 92% to 95%.
- 2. Duration of operation is limited by the battery storage capability. (With 150 km of driving, heat produced by motor will be less than 1.2 kWh.)
- With open design, dirt particles may cause stator winding damage.

III. DISCUSSION OF SPECIFICATIONS

Voltage

The nominal battery voltage is 240 V dc. This corresponds to a maximum inverter output voltage of 165 V

rms (sine modulation) and 185 V rms (six-step mode). The inverter will control to lower voltages in accordance with the control algorithm.

2. Power Output

Since the bidder shall determine actual speeds and torques, specifications are presented in terms of shaft output power and fraction of maximum speed. (The gear reduction ratio and inverter control constants will be determined after establishing the motor.)

2a. Power at Maximum Speed

This specification establishes one hour thermal and torque breakdown capability of handling the rated power at full speed. Since efficiency and breakdown torque both improve with decreasing speed, it follows that this power level can be maintained for all speeds above base speed.

2b. Power at 10% Maximum Speed

This specification establishes the torque breakdown capability below base speed and corresponds to vehicle acceleration.

2c. Power at 80% Maximum Speed

This specification establishes the torque breakdown capability at 0.8 N_{max} (55 mph) and corresponds to vehicle acceleration at this speed.

3. Maximum Speed

As maximum speed is increased, cost and weight decrease. Accordingly, moderately high speeds are desirable - consistent with mechanical and windage limits. With previous efforts, maximum speeds between 9,000 and 20,000 rpm have been used. The actual maximum speed selected will be on the basis of Equation 1.

4. Number of Poles

As the number of poles is increased, the conductor losses generally drop while the magnetic losses increase. (The inverter switching losses are proportional to frequency and, therefore, proportional to pole number; this impact is, however, small and will be neglected.) The optimum pole number will be determined on the basis of Equation 1.

5. Weighting Function (See Equation 1)

This function relates cost and efficiency to the retail price of the motor. The motor is to be designed such that the value of this function is minimized. The efficiency is defined at $0.8\ N_{max}$ and $12\ kW$ shaft output. Excitation for this point of operation will be the optimal efficiency voltage (probably less than $185\ V\ rms$). The corresponding slip frequency will be noted.

6. Efficiency and Power Factor

Efficiency and power factor are defined under "optimal conditions" where the excitation voltage is such that the

resulting slip frequency matches that associated with optimal efficiency at 0.8 $N_{\rm max}$, 12 kW. Since excitation voltage is limited to 185 V rms, slip frequencies higher than optimal will prevail for some combinations of high torque and high speed. Efficiency and power factor are to be specified for at least five torque and five rpm values.

IV. EXPECTED RANGES OF PARAMETER VALUES

Based on JPL studies, the following ranges of parameters are expected for an optimized machine:

1.	Weight	65 to 95 kg
2.	Frame Size	10" to 12"
3.	Pole Number	2 or 4
4.	Maximum Speed (N _{max})	8,000 to 16,000 rpm
5.	Base Speed	0.35 to 0.45 N_{max}
6.	Optimal Slip Frequency	1 to2 Hz
7.	Efficiency at 0.8 N _{max} ,	
	12 kW	92% to 95%
8.	Power Factor for 7.	85% to 90%

•

Induction Motor Specification

- Input line voltage, maximum rms: 185 V
 (will be varied as required for speed and torque control)
- 2. Power output:
 - 1 hr. (20% duty) at maximum speed (N_{max}) 30 kW

3 min. (30% duty) at 0.8 N_{max}

60 kW

3 min. (30% duty) at 0.1 N_{max}

16 kW

- 3. Speed, N_{max} , between 8,000-16,000 rpm (to be selected by contractor)
- 4. Number of poles: two or four (to be selected by contractor)
- 5. Weighting function F to be minimum:

F = cost + 10(weight) - 120(efficiency)

where

cost is retail cost in \$
weight is in kg

efficiency is in % measured at 0.8 N_{max} , 12 kW shaft power with optimal voltage excitation

- 6. Construction: totally enclosed.
- 7. Cooling: convection air, maximum ambient 40 C.
- 8. Life: 4000 hours at full load.

In presenting the quotation the bidder shall:

Describe the selected design.

Specify the size and weight.

Specify the torque breakdown profile over the whole range of speed (either graphically or in tabular form).

Specify efficiency and power factor versus speed and torque for optimal excitation.

T. W. Macie

9/23/83

APPENDIX B

ALTERNATIVE INVERTER/INDUCTION MOTOR CONFIGURATIONS

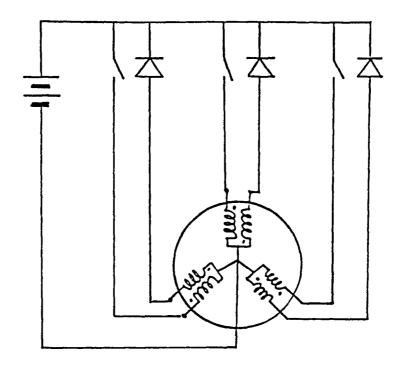


Fig. B-1-a Half-wave inverter driven three-phase bifilar induction motor

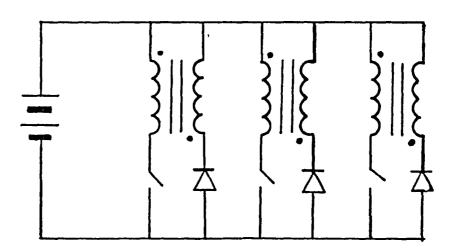


Fig. B-1-b Alternative arrangement for half-wave inverter driven three-phase motor

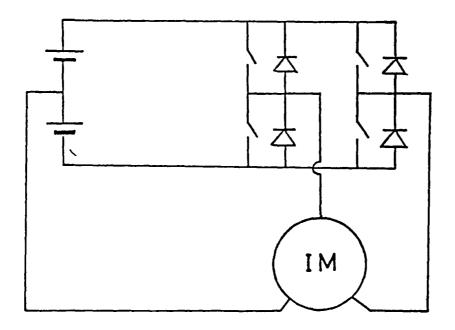


Fig. B-2 Four-switch inverter driven three-phase induction motor

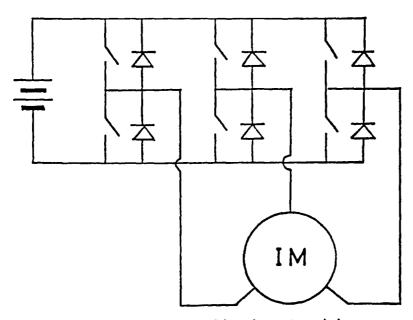


Fig. B-3 Three-phase bridge inverter driven induction motor

APPENDIX C

IDEALIZED COMPARISONS OF TWO-PHASE
AND THREE-PHASE INVERTERS

The two-phase inverter circuit shown in Fig. 2 and the three-phase arrangement in Fig. B-3 are used for these comparisons.

Assuming Equal DC Power to a Resistive Load

Two-phase

For this situation, both the load current and load voltage are assumed to be square waves as shown in Fig. Cl. This would be the case if the motor center-tapped windings in Fig. 2 were the primary windings of two ideal transformers with a purely resistive load on each secondary.

Let

 $v_{2\varphi} \triangleq \text{rms volts/phase on each half of center-tapped}$ winding

$$= v_{DC}$$

and

 $I_{2\varphi} \ \ \underline{\triangle} \ \text{rms current/phase through the resistive load}$ Assuming that the ideal transformers each have unity turns ratio from half of the primary winding to the secondary,

$$I_{2\phi} = I_{DC}/2$$

The current I_{DC} is the dc source current. Since the two pairs of switches in Fig. 2 are operated with 90° phase displacement, the total dc source current is always equal to twice the current in one phase. Basically, I_{DC} divides equally at all instants, with $I_{DC}/2$ flowing through one half of each transformer primary.

Thus

 $V_{\mathbf{T},\mathbf{P}} \stackrel{\Delta}{=} s$ witch peak voltage

$$= 2V_{DC}$$

and

 $I_{T,P} \triangleq$ switch peak current

$$= I_{DC}/2$$

and let

$$TR_{2\phi} \stackrel{\triangle}{=} total switch rating V_{T,P}I_{T,P}$$
 for two-phase
= (4) $(2V_{DC})$ $(I_{DC}/2)$
= $4V_{DC}$ I_{DC}

Three-phase

In this case, the circuit of Fig. B-3 is considered, except with the motor winding replaced with a wye connected balanced set of load resistors. With a current IDC flowing from the dc source in Fig. B-3 the line-to-neutral load voltage and current are as shown in Fig. C-1. In this case

$$V_{T,P} = V_{DC}$$

$$I_{T,P} = I_{DC}$$

and let

 $^{TR}_{3\phi} \stackrel{\Delta}{=} \text{total switch rating } V_{T,P} I_{T,P} \text{ for three-phase}$ $= (6) (V_{DC}) (I_{DC})$ $= 6V_{DC} I_{DC}$

Therefore, the total switch rating for two-phase is 2/3 of that for three-phase.

Note: This can be checked in another very simple manner as follows. If the power delivered to the resistive loads is the same for the two-phase and the three-phase circuits, then the power taken from the dc supply must be the same in each case.

$$P_{DC} = V_{DC} I_{DC}$$

Also

$$I_{T,P,2\phi} = I_{DC}/2$$

and

$$I_{T,P,3\phi} = I_{DC}$$

Therefore

$$TR_{2\phi} = (4) (2V_{DC}) (I_{DC_{i}/2}) = 4V_{DC} I_{DC}$$

$$TR_{3\phi} = (6) (v_{DC}) (I_{DC}) = 6v_{DC} I_{DC}$$

and

$$TR_{2\phi} = 2/3 TR_{3\phi}$$

Assuming Equal Fundamental Power to a Resistive Load Two-phase

Let

 $V_{1,2\phi} \triangleq amplitude of fundamental voltage/phase$

$$= \frac{1}{\pi} \int_{0}^{2\pi} v_{2\phi} \sin \omega t \, d (\omega t)$$

$$= \frac{2V_{DC}}{\pi} \int_{0}^{\pi} \sin \omega t \, d (\omega t)$$

$$= \frac{4V_{DC}}{\pi}$$

and similarly for the current

$$I_{1,2\phi} = \frac{4I_{T,P,2\phi}}{\pi}$$

Then

$$P_{1,2\phi} \stackrel{\Delta}{=} \text{total fundamental power}$$
 to load
$$= (2) \left(\frac{4V_{DC}}{\pi\sqrt{2}}\right) \left(\frac{4I_{T,P,2\phi}}{\pi\sqrt{2}}\right)$$
$$= \frac{16}{\pi^2} V_{DC} I_{T,P,2\phi}$$

Three-phase

Let

$$\begin{split} v_{1,3\varphi} &\triangleq \text{amplitude of fundamental voltage/phase} \\ &= \frac{1}{\pi} \int_{0}^{2\pi} v_{3\varphi} \sin \omega t \ d \ (\omega t) \\ &= \frac{2v_{DC}}{\pi} \left[\int_{0}^{\pi/3} \frac{1}{3} \sin \omega t \ d \ (\omega t) + \int_{\pi/3}^{2\pi/3} \frac{2}{3} \sin \omega t \ d \ (\omega t) \right. \\ &+ \int_{2\pi/3}^{\pi} \frac{1}{3} \sin \omega t \ d \ (\omega t) \right] \\ &= \frac{2v_{DC}}{\pi} \end{split}$$

and for the current

$$I_{1,3\phi} \triangleq \frac{1}{\pi} \int_{0}^{2\pi} i_{3\phi} \sin \omega t \, d (\omega t)$$

$$= \frac{2I_{\text{PT},3\phi}}{\pi} \left[\int_{0}^{\pi/3} \frac{1}{2} \sin \omega t \, d (\omega t) + \int_{\pi/3}^{2\pi/3} \sin \omega t \, d (\omega t) \right]$$

$$= \frac{3I_{\text{T},P,3\phi}}{\pi}$$

Then

P<sub>1,3\$\phi\$ \(\triangle \text{ total fundamental load power}\)
$$= (3) \left(\frac{2V_{DC}}{\pi\sqrt{2}}\right) \left(\frac{3I_{T,P,3$\phi}}{\pi\sqrt{2}}\right)$$

$$= \frac{9V_{DC}I_{T,P,3$\phi}}{2}$$</sub>

For equal load power

$$P_{1,2\phi} = P_{1,3\phi}$$

$$\frac{16}{\pi^2} V_{DC} I_{T,P,2\phi} = \frac{9V_{DC} I_{T,P,3\phi}}{\pi^2}$$

or

$$I_{T,P,2\phi} = \frac{9}{16} I_{T,P,3\phi}$$

Finally, the total switch ratings $\text{TR}_{2\varphi}$ and $\text{TR}_{3\varphi}$ are

$$TR_{2\phi} = (4) (2V_{DC}) (I_{T,P,2\phi})$$

$$TR_{3\phi} = (6) (V_{DC}) (I_{T,P,3\phi})$$

Then

$$TR_{2\phi} = (4) (2V_{DC}) (\frac{9}{16} I_{T,P,3\phi})$$

$$= \frac{9}{2} V_{DC} I_{T,P,3\phi}$$

and

$$TR_{3\phi} = 6V_{DC} I_{T,P,3\phi}$$

Thus

$$TR_{2\phi} = \frac{3}{4} TR_{3\phi}$$

Two-phase load voltage and current

Three-phase line-to-neutral load voltage and current

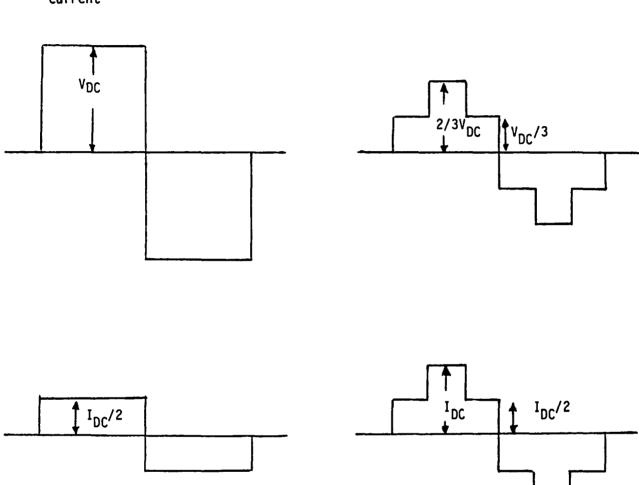


Fig. C-1 Load voltages and currents for Fig. 2 and Fig. B-3 respectively with motors replaced by resistive load

Note: Two ideal transformers are used in Fig. 2, with unity turns ratio from each half of their primaries to their secondaries connected to resistive loads. A wye-connected set of balanced load resistors replaces the motor in Fig. B-3.

APPENDIX D

DETAILED DESIGN OF TWO-PHASE BIFILAR INDUCTION MACHINE

MAIN DATA OF UMC TWO-PHASE BIFILAR INDUCTION MOTOR

1. Output	-
-----------	---

- 2. Number of phases
- 3. Frequency
- 4. Equivalent voltage of battery
- 5. Phase current
- 6. Efficiency
- 7. Power factor
- 8. Number of poles (p Δ pole pairs)
- 9. External diameter of stator
- 10. Internal diameter of stator
- 11. Length of stack
- 12. Length of air gap
- 13. Number of slots of stator
- 14. Number of slots of rotor
- 15. Turns per coil
- 16. Number of coils
- 17. Series turns per phase
- 18. Number of branches
- 19. Resistance of stator
- 20. Resistance of rotor
- 21. Leakage inductance of stator
- 22. Leakage inductance of rotor
- 23. Magnetizing inductance

$$P_m = 30 \text{ kW}$$

m = 2

f = 80 Hz

$$I_{ph} = 110.2 A$$

$$\eta = 0.91$$

$$\cos \phi = 0.88$$

$$2p = 2$$

$$D_0 = 29.21 \text{ cm } (11.5 \text{ in})$$

$$D = 14.6 \text{ cm} (5.75 \text{ in})$$

$$L = 16 cm (6.3 in)$$

$$l_a = 0.03$$
 cm (0.0118 in)

$$Z_1 = 24$$

$$Z_2 = 20$$

$$z_{S1} = 11$$

$$n_c = 12$$

$$T_{ph} = 33$$

$$a_p = 2$$

$$R_s = 0.0274\Omega$$

$$R_{r}^{1} = 0.0213\Omega$$

$$L_{1s} = 2.5 \times 10^{-4} H$$

$$L_{1r} = 2.7 \times 10^{-4} H$$

$$L_{\rm m} = 13.86 \times 10^{-3} \, H$$

UMC TWO-PHASE BIFILAR MOTOR

1. Given data

$$P_m = 30 \text{ kW}$$

m = 2 (number of phases)

f = 80 Hz (basic frequency)

P = 1 (pair of poles)

 $V_n = 189 \text{ V (equivalent base battery voltage)}$

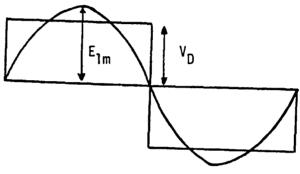


Fig. D-1

$$E_{1m} = \frac{4}{\pi} V_D = \frac{4}{\pi} \times 189 V = 241 V$$

$$E_{1(rms)} = \frac{4}{\sqrt{2} \pi} \times 189 \text{ V} = 170 \text{ V}$$

2. External diameter of stator D_0 choose $D_0 = 29.21$ cm = 11.5 in

3. Internal diameter of stator D

let
$$D = 14.6 \text{ cm} = 5.75 \text{ in}$$

4. Specific magnetic loading $\overline{B} = \frac{2P\phi_m}{\pi DL}$

assumed
$$\overline{B} = 0.45 \text{ wb/m}^2$$

$$\overline{B} = 0.3 - 0.6 \text{ wb/m}^2$$
 for common motor

- 5. Slots of stator $Z_1 = 24$
- 6. Slots of rotor Z_2

$$Z_2 = Z_1 + 4P = 20$$

7. Assumed Efficiency n = 0.91Power factor $\cos \phi = 0.88$

8. The kVA rating S

$$S = \frac{P_m}{\cos \phi} = \frac{30}{0.91 \times 0.88} = 37.46 \text{ kVA}$$

9. The motor constant G

$$G = \frac{S}{D^2Ln} = 11 \text{ kw } \overline{B} \text{ X ac X } 10^{-3} = 11 \text{ X } 0.9029 \text{ X } 0.45 \text{ X } 30,000 \text{ X } 10^{-3} = 134$$

where L is length of stack

kw is winding factor

ac is specific electric loading

n is synchronous speed (rps)

$$kw = kp \times kd$$
 $kp = 1$ (single layer winding)

$$kd = \frac{\sin (\pi/2m)}{n'\sin (\pi/2mn')} = \frac{\sin (\pi/2x2)}{6 \times \sin (\pi/2x2x6)} = 0.9029$$

$$n = \frac{Z_1}{2pm} = \frac{24}{2x^2} = 6$$
 (number of slots per phase per pole)

$$n = \frac{f}{h} = \frac{80}{1} = 80 \text{ rps}$$

ac =
$$2m T_{ph} I_{ph} / D = 5000 45,000 Amp-cond/m$$

Let ac = $30,000$

10.
$$D^2L = \frac{S}{Gn} = \frac{37.46}{134 \times 80} = 3.4944 \times 10^{-3} \text{ m}^3$$

$$L = \frac{D^2L}{D^2} = \frac{3.4944 \times 10^{-3}}{0.146^2} = 0.164 \text{ m}$$

Let
$$L = 0.16 \text{ m} = 16 \text{ cm} = 6.3 \text{ in}$$

11. The flux per pole ϕ_m

$$\phi_{\text{m}} = \overline{B} \times \frac{\pi D}{2P} \times L = 0.45 \times \frac{\pi \times 0.146}{2} \times 0.16 = 0.0165 \text{ wb}$$

12. The turns per phase (in series) $T_{\rm ph}$

$$T_{ph} = \frac{E_1}{4.44 \text{ kw f}_{m}} = \frac{170}{4.44 \times 0.9029 \times 80 \times 0.0165} = 32.1$$

choose
$$T_{ph} = 33$$

13. The real flux per pole $\boldsymbol{\varphi}_{m}$

$$\phi_{\rm m} = \frac{E_1}{4.44 \text{ kw f T}_{\rm ph}} = \frac{170}{4.44 \times 0.9029 \times 80 \times 33} = 0.016 \text{ wb}$$

14. The number of coils n

$$n_c = \frac{Z_1}{2} = \frac{24}{2} = 12$$
 (single layer)

The number of branches $a_{\rm p}$

$$a_p = 2$$

15. The coils per phase in series $n_{\rm ph}$

$$n_{ph} = \frac{n_c}{ap \times m} = \frac{12}{2 \times 2} = 3$$

16. The turns of coil Z_{s1}

$$Z_{s1} = \frac{T_{ph}}{n_{ph}} = \frac{33}{3} = 11$$

17.
$$\overline{B} = \frac{\Phi_{\text{m}}}{\frac{\pi DL}{2P}} = \frac{0.016}{\frac{\times 0.146 \times 0.16}{2}} = 0.436 \text{ wb/m}^2$$

18. Phase current I_{ph}

$$I_{ph} = \frac{S \times 10^3}{M \times E_1} = \frac{37.46 \times 10^3}{2 \times 170} = 110.2 \text{ A}$$

ac = 2m
$$T_{ph} \times I_{ph}/\pi D$$
 = 2 x 2 x 33 x 110.2/ π x 0.146 = 31714 Amp-cond/m

- 19. The density of current of stator winding δ_1 choose δ_1 = 5 A/mm²
- 20. The section of coil S_c

$$S_c = \frac{I_{ph}}{a_{p,1}} = \frac{110.2}{2 \times 5} = 11.02 \text{ mm}^2$$

choose 3 x #13 wire and 2 x #15 wire

#13 wire
$$d = 1.83 \text{ mm}$$
 $A_d = 2.63 \text{ mm}^2$

insulated
$$d' = 1.83 + 0.18 = 2.01 \text{ mm}$$

#15 wire
$$d = 1.45 \text{ mm}$$
 $A_d = 1.65 \text{ mm}^2$

$$d' = 1.63 \text{ mm}$$

$$S_c = 3 \times 2.63 + 2 \times 1.65 = 11.19 \text{ mm}^2$$

21. The number of wires in parallel n_p $n_p = 3 + 2 = 5$

22. The total number of wires in a slot n_s

$$n_s = 2 \times n_D \times Z_{s1} = 2 \times 5 \times 11 = 110$$

The first number 2 on the right side represents the bifilar winding.

23. The real density of current δ_1

$$\delta_1 = \frac{I_{ph}}{a_p s_c} = \frac{110.2}{2 \times 11.19} = 4.92 \text{ A/mm}^2$$

24. Length of mean conductor

$$L_{mc} = L + 1.1Y + 3 \text{ (cm)}$$

= 16 + 1.1Y + 3 = 16 + 1.1 X 22.93 + 3 = 44.2 cm

where Y =
$$\frac{\pi D}{2P}$$
 = $\frac{\pi \times 14.6}{2}$ = 22.93 cm

We use concentric coils: 1-8

1-10 coil spans

1-12

25. Length per phase L_{ph}

$$L_{ph} = T_{ph} \times 2 \times L_{mc} = 33 \times 2 \times 0.442 = 29.17 \text{ m}$$

26. Resistance per phase R_s (75°C)

$$R_s = P_{75} \times L_{ph}/S_c \times a_p = 0.021 \times 29.17/11.19 \times 2 = 0.0274\Omega$$

27. Reduced rotor current I2

$$I_2' \simeq I_{ph} \cos \phi = 110.2 \times 0.88 = 97 \text{ A}$$

28. The tooth pitch of rotor τ_{s2}

$$\tau_{s2} = \frac{\pi D_2}{Z_2} = \frac{\pi \times 14.54}{20} = 2.284 \text{ cm}$$

where diameter of rotor $D_2 = D - 2 \times 1_g = 14.6 - 2 \times 0.03 = 14.54$ cm $1_g = 0.3$ mm (length of air gap)

29. Number of slots per pole S2 (rotor)

$$S_2 = \frac{Z_2}{2p} = \frac{20}{2} = 10$$

30. The current of the bar $I_{\mbox{\scriptsize b}}$

$$I_b = \frac{2m k_w T_{ph}}{Z_2}$$
 $I_2' = \frac{2 \times 2 \times 0.9029 \times 33}{20} \times 97 = 578 A$

31. The current of the end ring I_c

$$I_c = \frac{I_b S_2}{\pi} = 578 \times 10/\pi = 1840 A$$

32. Casting aluminum alloy for rotor cage

PA1
$$(75^{\circ}C) = 0.04\Omega \text{ mm}^2/\text{m}$$

(The value can be in negotiation with manufacturer)

33. Let
$$\delta_{2b} = 3.2 \text{ A/mm}^2$$

34. The section of each bar a_2

$$a_2 = \frac{I_b}{\delta_{2b}} = \frac{578}{3.2} = 180.6 \text{ mm}^2$$

35. The resistance per bar λ_b

$$\lambda_b = P_{A1} \times L/a_2 = 0.04 \times 0.16/180.6 = 3.54 \times 10^{-5} \Omega$$

36. The section of end ring a_{2c}

Let
$$\delta_{2c} = 2.8 \text{ A/mm}^2$$

$$a_{2c} = \frac{I_c}{\delta_{2c}} = \frac{1840}{2.8} = 657 \text{ mm}^2$$

37. The resistance of ring r_c

$$r_c = \rho_{A1} \times \pi \times D_r/a_{2c} = 0.04 \times \pi \times 0.126/657 = 2.41 \times 10^{-5} \Omega$$

where $D_r = 0.126 \text{ m}$ (the mean diameter of ring)

38. The reduced resistance of rotor r_2^1

$$r'_{2} = \frac{Z_{2}(r_{b} + 2r_{c}S_{2}^{2}/\pi^{2}Z_{2})I_{b}^{2}}{m I'_{2}^{2}} = \frac{20 (3.54 + 2 \times 2.41 \times 10^{2}/\pi^{2} \times 20) \times 578^{2} \times 10^{-5}}{2 \times 97^{2}}$$
$$= 0.02124\Omega \approx 0.0213\Omega$$

39. Carter's factor k

$$k_{c1} = \frac{{\tau_{c1} \cdot k_{c2}}}{{\tau_{c1} - b_o + 2 \cdot l_g \times l_n \cdot [1 + \frac{b_o}{2 \times l_g}]}}$$

$$= \frac{19.1}{19.1 - 3.5 + 2 \times 0.3 \times l_n \cdot [1 + \frac{3.5}{2 \times 0.3}]} = 1.14$$

where
$$\tau_{S1} = \frac{\pi D}{Z_1} = \frac{\pi \times 146}{24} = 19.1 \text{ mm}$$

(tooth pitch of the stator)


 $b_0 = 3.5 \text{ mm}$ (width of slot opening - refer to Fig. 1)

$$k_{c2} = \frac{\tau_{S2}}{\tau_{S2} - b_{o2} 2 l_{g} \times l_{n} [1 + \frac{b_{o2}}{2 l_{g}}]}$$

$$= \frac{2.284 \times 10}{22.84 - 1.5 + 2 \times 0.3 \times l_{n} [1 + \frac{1.5}{2 \times 0.3}]} = 1.034$$

$$k_c = k_{c1} \cdot k_{c2} = 1.14 \times 1.034 = 1.18$$

Effective length of air gap 1

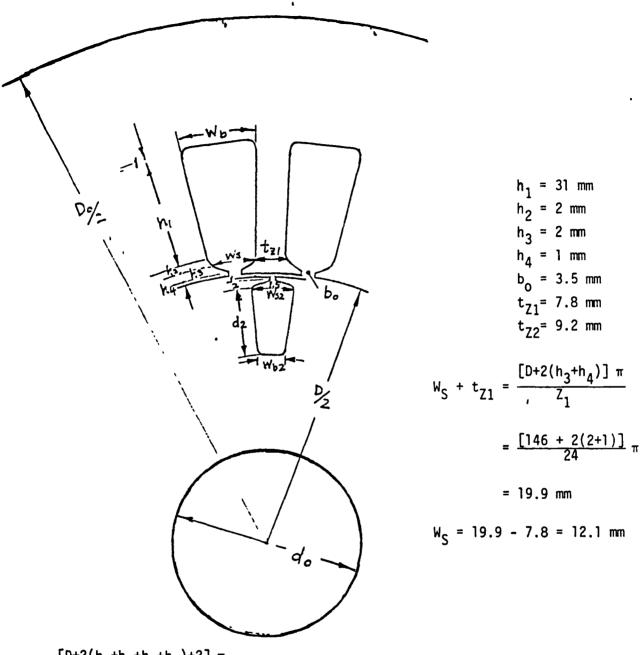

$$W_{b} = \frac{\left[D+2\left(h_{1}+h_{2}+h_{3}+h_{4}\right)+2\right]\pi}{Z_{1}} - t_{Z1} = \frac{\left(146+2\times36+2\right)\pi}{24} - 7.8 = 21 \text{ mm}$$

$$W_{S2} = \frac{\left[D-21g-2\times3\right]\pi}{Z_{2}} - t_{Z2} = \frac{\left(146-2\times0.3-6\right)\pi}{20} - 9.2 = 12.7 \text{ mm}$$

$$d_{2} = 17 \text{ mm}$$

$$W_{b2} = \frac{\left(D-21g-2\times3-2\times d_{2}\right)\pi}{Z_{2}} - t_{Z2} = \frac{\left(146-2\times0.3-6-2\times17\right)\pi}{20} - 9.2 = 7.356 \text{ mm}$$

Fig. D-2

$$l_g' = k_c l_g = 1.18 \times 0.3 = 0.354 \text{ mm}$$

40. The area of air gap
$$A_g$$

$$A_g = \frac{\pi D}{2p} L = \frac{2 \times 0.146}{2} \times 0.16 = 0.0367 \text{ m}^2$$

41. Modified density of flux of air gap B_q

$$B_g = 1.36 \times {}^{\phi}_{m}/A_g = 1.36 \times 0.016/0/0367 = 0.593 \text{ wb/m}^2$$

where 1.36 is for considering saturation in both teeth of stator and rotor

42. Area of teeth per pole of stator A_{21}

$$A_{Z1} = t_{Z1} \times L \times 0.92 \times S_1 = 0.78 \times 16 \times 0.92 \times 12$$

= 138 cm² = 0.0138 m²
where $S_1 = \frac{Z_1}{Z_0} = \frac{24}{2} = 12$

43. Modified density of flux in teeth B_{Z1}

$$B_{Z1} = 1.36 \times \phi_m/A_{Z1} = 1.36 \times 0.016/0.0138 = 1.577 \text{ wb/m}^2$$

44. Length of tooth 1_{Z1}

1
Z1 = k_{1} + k_{2} = 31 + 2 = 33 mm = 0.033 m

45. Height of core h_{c1} (stator)

$$h_{c1} = \frac{D_0 - [D + 2(h_1 + h_2 + h_3 + h_4)]}{2}$$

$$= 29.21 - \frac{[14.6 + 2(3.1 + 0.2 + 0.2 + 0.1)]}{2} = 3.705 \text{ cm}$$

$$= 0.03705 \text{ m}$$

46. Area of core A_{c1} (stator)

$$A_{c1} = h_{c1} \times L \times 0.92 = 0.03705 \times 0.16 \times 0.92 = 0.005454m^2$$

47. Maximum density of flux through the core B_{cl}

$$B_{c1} = \frac{\phi_m}{2A_{c1}} = \frac{0.016}{2 \times 0.005454} = 1.4668 \text{ wb/m}^2$$

48. Length of core per half pole l_{cl}

$$l_{c1} = \frac{(D_0 - h_{c1})\pi}{4p} = \frac{(29.21 - 3.705)\pi}{4} = 20.03 \text{ cm}$$

49. Effective length of core l_{cl}

$$1_{c1}' = \zeta 1_{c1} = 0.38 \times 20.03 = 7.6 \text{ cm} = 0.076 \text{ m}$$

- 50. ζ = 0.38 considering the densities of flux along the length of core are not equal
- 51. The fill coefficient of $slotk_f$

$$k_f = \frac{n_s d^{1/2}}{\frac{W_s + W_b}{2} \times (h_1 + h_2)} = \frac{2 \times 11 \times (3 \times 2.01^2 + 2 \times 1.63^2)}{\frac{12.1 + 21}{2} \times (31 + 2)} = 0.702$$

 $k_f = 0.702 < 0.75$ (This means that bifilar winding can be inserted in slots without difficulty.)

52. Area of rotor teeth per pole A_{Z2}

$$A_{Z2} = t_{Z2} \times L \times 0.92 \times S_2 = 0.92 \times 16 \times 0.92 \times 10 = 135.4 \text{ cm} = 0.01354 \text{ m}^2$$

53. Modified density of flux in rotor teeth B_{72}

$$B_{Z2} = \frac{1.36 \, \phi_{m}}{A_{Z2}} = \frac{1.36 \, \times \, 0.016}{0.01354} = 1.607 \, \text{wb/m}^2$$

54. Length of rotor tooth 1_{72}

$$l_{Z2} \simeq d_2 = 17 \text{ mm} = 0.017 \text{ m}$$

55. The height of rotor core h_{c2}

$$h_{c2} = \frac{D - 2 \cdot 1_g - 2 \cdot d_2 - 2 \times 2 - d_0}{2} + \frac{1}{6} \times d_0$$

$$= \frac{146 - 2 \times 0.3 - 2 \times 17 - 4 - 45}{2} + \frac{1}{6} \times 45$$

$$= 38.7 \text{ mm}$$

where $d_0 = 45 \text{ mm}$ (d_0 is diameter of the shaft)

56. The maximum density of flux through the rotor core B_{c2}

$$B_{c2} = \frac{\phi_m}{2A_{c2}} = \frac{0.016}{2 \times 0.0057} = 1.404 \text{ wb/m}^2$$

57. Area of rotor core A_{C2}

$$A_{c2} = h_{c2} \times L \times 0.92 = 0.387 \times 0.16 \times 0.92 = 0.0057 m^2$$

According to the B-H curve on Fig.D-3(Sec. 4-264, Fig. 4-31, Standard Hand-book for Electrical Engineers, Tenth Ed., Donald G. Fink and John M. Carroll, McGraw-Hill), we get

$$B_{Z1} = 1.577 \text{ wb/m}^2 = 15770 \text{ gauss}$$

$$H_{71} = 32 \text{ oe} = 32 \times 79.577 = 2546 \text{ A/m}$$

$$B_{c1} = 1.4668 \text{ wb/m}^2 = 14668 \text{ gauss}$$

$$H_{c1} = 17 \text{ oe} = 17 \text{ x } 79.577 = 1352 \text{ A/m}$$

$$B_{72} = 1.607 \text{ wb/m}^2 = 16070 \text{ gauss}$$

$$H_{72}$$
 = 40 oe = 40 x 79.577 = 3183 A/m

$$B_{c2} = 1.404 \text{ wb/m}^2 = 14040 \text{ gauss}$$

$$H_{c2} = 13 \text{ oe} = 13 \times 79.577 = 1034 \text{ A/m}$$

MAGNETIC MATERIALS

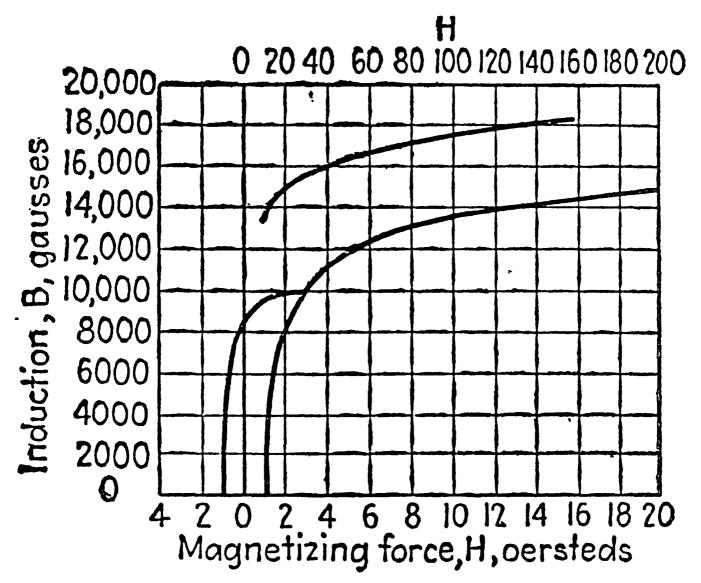


Fig. D₃ Normal-induction curve and hysteresis loop of electrical sheet, No. 22 gage.

58. Magnetizing force AT

$$AT = AT_g + AT_{Z1} + AT_{c1} + AT_{Z2} + AT_{c2}$$

59. Magnetizing force of air gap $\mathsf{AT}_{\mathbf{g}}$

$$AT_g = 8 \times 10^5 \times 1_g' \times B_g = 8 \times 10^5 \times 0.000354 \times 0.593 = 168 A$$

60. Magnetizing force of stator tooth AT_{Z1}

$$AT_{Z1} = H_{Z1} \times 1_{Z1} = 2546 \times 0.033 = 84 A$$

61. Magnetizing force of stator core AT_{c1}

$$AT_{c1} = H_{c1} \times 1_{c1} = 1352 \times 0.076 = 102.7 A$$

62. Magnetizing force of rotor tooth AT_{22}

$$AT_{72} = H_{72} \times 1_{72} = 3183 \times 0.017 = 54 A$$

63. Magnetizing force of rotor core AT_{c2}

$$AT_{c2} = H_{c2}1_{c2}^{\prime} = 1034 \times 0.0152 = 16 A$$

where
$$1'_{c2} = \zeta 1_{c2} = 0.38 \times 4 = 1.52 \text{ cm} = 0.0152 \text{ m}$$

$$1_{c2} = \frac{D - 2 1_g - 2 d_2 - 2 h'_{c2}}{4p} \approx 4 \text{ cm}$$

$$AT = 168 + 84 + 102.7 + 54 + 16 = 424.7 A$$

64. Magnetizing current Inr

$$I_{or} = p \times 2AT/1.17 \times kw \times T_{ph} = 2 \times 424.7/1.17 \times 0.9029 \times 33 = 24.4 A$$

65. Magnetizing reactance X_m

$$X_{\rm m} \simeq \frac{E_1}{I_{\rm or}} = \frac{17.0}{24.4} = 6.967\Omega$$

66. Magnetizing inductance L_m

$$L_{\rm m} = \frac{\chi_{\rm m}}{2\pi f} = \frac{6.967}{2 \times \pi \times 80} = 13.86 \times 10^{-3} \text{ H}$$

67. The specific slot permeance of stator λ_{s1}

$$\lambda_{s1} = \frac{h_2}{W_2 - W_s} \ln \left(\frac{W_2}{W_s}\right) + \frac{h_3}{W_s - b_0} \ln \left(\frac{W_s}{b_0}\right) + \frac{h_4}{b_0} + \frac{h_1 + 1}{W_b} \left[\frac{\beta^2 - \frac{\beta^4}{4} - \ln\beta - \frac{3}{4}}{(1 - \beta)(1 - \beta^2)^2}\right]$$

$$= \frac{2}{12.62 - 12.1} \ln \left(\frac{12.62}{12.1}\right) + \frac{2}{12.1 - 3.5} \ln \left(\frac{12.1}{3.5}\right) + \frac{1}{3.5} + \frac{1}{3.5}$$

$$32 \left[\frac{0.6^2 - \frac{0.6^4}{4} - \ln 0.6 - \frac{3}{4}}{12.1}\right] = 0.162 + 0.288 + 0.286 + 0.822 = 1.55$$

$$\frac{32}{21} \left[\frac{0.6^2 - \frac{0.6^4}{4} - \ln 0.6 - \frac{3}{4}}{(1 - 0.6)(1 - 0.6^2)^2} \right] = 0.162 + 0.288 + 0.286 + 0.822 = 1.558$$

where
$$W_2 = \frac{[146 + 2 (h_4 + h_3 + h_2)] \pi}{24} - 7.8 = 12.62 \text{ mm}$$

$$W_{s} = 12.1 \text{ mm}$$

$$h_2 = 2 \text{ mm}$$

$$h_3 = 2 \text{ mm}$$

$$h_A = 1 \text{ mm}$$

$$b_0 = 3.5 \text{ mm}$$

$$\beta = \frac{W_2}{W_b} = \frac{12.62}{21} = 0.6$$
 (refer to Fig. 1)

8. The specific slot permeance of rotor
$$\lambda_{s2}$$

$$\lambda_{s2} = \frac{h_3'}{W_{s2}-1.5} \ln \left(\frac{W_{s2}}{1.5}\right) + \frac{1}{1.5} + \frac{d_2}{W_{b2}} \left[\frac{\beta^2 - \frac{\beta^4}{4} - \ln \beta - \frac{3}{4}}{(1-\beta)(1-\beta^2)^2} \right] = \frac{2}{12.7-1.5} \times \frac{1}{1.5} + \frac{1}{1.5} + \frac{17}{7.356} \left[\frac{1.726^2 - \frac{1.726^4}{4} - \ln 1.726 - \frac{3}{4}}{(1-1.726)(1-1.726^2)^2} \right] = 1.49$$

where
$$W_{s2} = 12.7 \text{ mm}$$
 $W_{b2} = 7.356 \text{ mm}$
 $d_2 = 17 \text{ mm}$
 $\beta = \frac{W_{s2}}{W_{b2}} = 1.726$

69. The reduced value λ'_{s2}

$$\lambda'_{s2} = \frac{kw^2Z_1}{Z_2}\lambda_{s2} = \frac{0.9029^2 \times 24}{20} \times 1.49 = 1.46$$

70. The slot leakage reactance of stator $\boldsymbol{\chi}_{s1}$

$$\chi_{s1} = \frac{8f_{m} L T_{ph}^{2}}{10^{7} Z_{1}} \lambda_{s1} = \frac{8 \times 80 \times 2 \times 6.3 \times 33^{2}}{10^{7} \times 24} \times 1.558 = 0.057 \Omega$$

where L is in inches

71. The slot leakage reactance of rotor χ_{s2}

$$x_{s2} = \frac{8 \text{fm L T}_{ph}^{2}}{10^{7} Z_{1}} \lambda'_{s2} = \frac{8 \times 80 \times 2 \times 6.3 \times 33^{2}}{10^{7} \times 24} \times 1.46 = 0.535 \Omega$$

72. The end leakage reactance χ_e

$$x_e = \frac{4 \text{fm D T}_{ph}^2}{10^7 (2p)^2} = \frac{4 \times 80 \times 2 \times 5.75 \times 33^2}{10^7 (2)^2} = 0.1 \Omega$$

where D = 14.6 cm = 5.75 in

73. Differential leakage reactance (sum of the zigzag and belt leakage reactance)

$$\chi_{d} = \frac{5}{6} \chi_{m} \left(\frac{6K_{c1} - 1 + 5\sigma^{2}}{5S_{1}^{2}} + \frac{\sigma k_{c2} - 1}{5S_{2}^{2}} \right) = \frac{5}{6} \times 6.967 \times \left(\frac{6 \times 1.14 - 1 + 5(0.5)^{2}}{5 \times 12^{2}} \right)$$

$$+ \frac{0.5 \times 1.034 - 1}{5 \times 10^{2}} = 0.0516$$

- σ = 0.5 is the angle of rotor slot skew, as a fraction of one stator slot pitch
- 74. The leakage reactance of stator χ_1

$$x_1 = x_{s1} + \frac{z_2}{z_1 + z_2}$$
 ($x_e + x_d$) = 0.057 + $\frac{20}{24 + 20}$ (0.1 +0.0516) = 0.126 Ω

75. The reduced leakage reactance of rotor χ'_2

$$\chi_2' = \chi_{s2} + \frac{Z_1}{Z_1 + Z_2} (\chi_e + \chi_d) = 0.0535 + \frac{24}{24 + 20} (0.1 + 0.0516) = 0.136 \Omega$$

76.
$$L_{1s} = \frac{\chi_1}{2\pi f} = \frac{0.126}{2 \times \pi \times 80} = 2.5 \times 10^{-4} H$$

$$L_{1r} = \frac{\chi_2}{2\pi f} = \frac{0.136}{2 \times \pi \times 80} = 2.7 \times 10^{-4} \text{ H}$$

Modified Parameters of the Motor Operating at

$$f = 20 \text{ Hz}$$
 $V_D = 60 \text{ V}$

Modified Parameters of the Motor Operating at

$$f = 160 \text{ Hz}$$
 $V_D = 240 \text{ V}$

(1)
$$E_{1(rms)} = \frac{4}{\sqrt{2} \times \pi} V_D = \frac{4}{\sqrt{2} \times \pi} X 60 = 54 V$$

$$E_{1(rms)} = \frac{4}{\sqrt{2} \times \pi} \times 240 = 216 \text{ V}$$

(13)
$$\phi_{\text{m}} = \frac{E_{1}}{4.44 \text{ kw f T}_{\text{ph}}} = \frac{54}{4.44 \times 0.9029 \times 20 \times 33}$$

$$= 0.0204$$

$$\phi_{\rm m} = \frac{216}{4.44 \times 0.9029 \times 160 \times 33} = 0.0102$$

Neglect the change of resistance, as the operation frequency is changed.

(26)
$$R_c = 0.0274 \Omega$$

$$R_s = 0.0274 \Omega$$

(38)
$$R_r^1 = 0.0213 \Omega$$

$$R_{r}^{1} = 0.0213 \Omega$$

(41)
$$B_g = 1.36 \phi_m/A_g = \frac{1.36 \times 0.0204}{0.0367}$$

$$B_g = \frac{1.36 \times 0.0102}{0.0367} = 0.378$$

$$= 0.756$$

(43)
$$B_{Z1} = 1.36 \phi_m/A_{Z1} = \frac{1.36 \times 0.0204}{0.0138}$$

= 2.01

$$B_{Z1} = \frac{1.36 \times 0.0102}{0.0138} = 1.005$$

(47)
$$B_{c1} = \phi_{m}/2A_{c1} = \frac{0.0204}{2 \times 0.005454} = 1.87$$

$$B_{c1} = \frac{0.0102}{2 \times 0.005454} = 0.935$$

(53)
$$B_{Z2} = \frac{1.36\phi_{m}}{A_{Z2}} = \frac{1.36 \times 0.0204}{0.01354} = 2.049$$

$$B_{Z2} = \frac{1.36 \times 0.0102}{0.01354} = 1.0245$$

(56)
$$B_{c2} = \frac{\phi_m}{2 \times A_{c2}} = \frac{0.0204}{2 \times 0.0057} = 1.79$$

$$B_{c2} = \frac{0.0102}{2 \times 0.0057} = 0.895$$

(57)
$$B_{Z1} = 2.01$$
 $B_{Z1}' = 0.9 \times B_{Z1}' = 1.809$

$$B_{71} = 1.005$$

(When teeth are over saturated, part of flux passes through slots.)

$$H_{Z1} = 130 \times 79.577 = 10345$$

$$H_{Z1} = 3 \times 79.577 = 239$$

$$B_{c1} = 1.87$$

$$B_{c1} = 0.935$$

$$B_{c1} = 0.9 \times 1.87 = 1.683$$

(Part of flux spreads to housing.)

$$H_{c1} = 55 \times 79.577 = 4376$$

$$H_{c1} = 2.6 \times 79.577 = 207$$

$$B_{72} = 2.049$$

$$B_{72} = 1.0245$$

$$B_{Z2}^{1} = 0.9 \times 13_{Z2} = 1.84$$

$$H_{72} = 160 \times 79.577 = 12732$$

$$H_{22} = 3.2 \times 79.577 = 255$$

$$B_{c2} = 1.79$$

$$B_{c2} = 0.895$$

$$B_{c2}^{1} = 0.9 \times 1.79 = 1.61$$

$$H_{c2} = 40 \times 79.577 = 3183$$

$$H_{c2} = 2.5 \times 79.577 = 199$$

$$\langle (59) | AT_g = 8 \times 10^5 \times 1_g \times B_g = 8 \times 10^5 \times 0.000354 \times 0.756$$

= 214

$$AT_g = 8 \times 10^5 \times 0.000354 \times 0.378$$

= 107

(60)
$$AT_{Z1} = H_{Z1}1_{Z1} = 10345 \times 0.033 = 341$$

$$AT_{Z1} = 239 \times 0.033 = 8$$

(61)
$$AT_{c1} = H_{c1}I_{c1}^{\dagger} = 4376 \times 0.076 = 332$$

$$AT_{c1} = 207 \times 0.076 = 16$$

(62)
$$AT_{Z2} = H_{Z2}1_{Z2} = 12732 \times 0.017 = 216$$

$$AT_{22} = 255 \times 0.017 = 5$$

(63)
$$AT_{c2} = H_{c2}1_{c2}^{\dagger} = 3183 \times 0.0152 = 48$$

$$AT_{c2} = 199 \times 0.0152 = 3$$

$$AT = AT_g + AT_{z1} + AT_{c1} + AT_{z2} + AT_{c2}$$

= 214 + 341 + 332 + 216 + 48 = 1151

$$AT = 107 + 8 + 16 + 5 + 3 = 139$$

(64)
$$I_{or} = \frac{P \times 2 \times AT}{1.17 \times kw \times T_{ph}} = \frac{2 \times 1151}{1.17 \times 0.9029 \times 33}$$

= 66

$$I_{or} = \frac{2 \times 139}{1.17 \times 0.9029 \times 33} = 8$$

(65)
$$\chi_{\rm m} = \frac{E_1}{I_{\rm or}} = \frac{54}{66} = 0.818$$

$$\chi_{\rm m} = \frac{216}{8} = 27$$

(66)
$$L_{\rm m} = \frac{\chi_{\rm m}}{2\pi f} = \frac{0.818}{2 \times \pi \times 20} = 6.51 \times 10^{-3}$$

$$L_{\rm m} = \frac{27}{2 \times 160} = 26.8 \times 10^{-3}$$

The overload current is around two times larger than rating, so slot leakage inductance still can be considered as a constant.

(70)
$$X_{s1} = \frac{8 \text{fm L T}_{ph}^2}{10^7 Z_1} \lambda_{s1}$$

$$x_{s1} = \frac{8 \times 160 \times 2 \times 6.3 \times 33^2}{10^7 \times 24} \times 1.558$$

$$= \frac{8 \times 20 \times 2 \times 6.3 \times 33^{2}}{10^{7} \times 24} \times 1.558 = 0.01425$$

(71)
$$X_{s2} = \frac{8 \text{ fm L } T_{ph}^2}{10^7 \text{ x } Z_1} = \lambda_{s2}^{1}$$

$$x_{s2} = \frac{8 \times 160 \times 2 \times 6.3 \times 33^2}{10^7 \times 24} \times 1.46$$

$$= \frac{8 \times 20 \times 2 \times 6.3 \times 33^{2}}{10^{7} \times 24} \times 1.46 = 0.1336$$

(72)
$$X_e = \frac{4 \text{fm D T}_{ph}^2}{10^7 (2p)^2} = \frac{4 \times 20 \times 2 \times 5.75 \times 33^2}{10^7 (2)^2}$$

= 0.025

$$X_e = \frac{4 \times 160 \times 2 \times 5.75 \times 33^2}{10^7 (2)^2}$$

= 0.2

(73)
$$X_d = \frac{5}{6} X_m \left(\frac{6k_{c1} - 1 - 5\sigma^2}{5S_1^2} + \frac{\sigma k_{c2} - 1}{5S_2^2} \right)$$

= $\frac{5}{6} \times 0.818 \times \left(\frac{6x1.14 - 1 - 5x0.5^2}{5 \times 12^2} + \frac{0.5x1.034 - 1}{5 \times 10^2} \right)$

$$X_d = \frac{5}{6} \times 27 \times (\frac{6 \times 1.14 - 1 + 5 \times 0.5^2}{5 \times 12^2} + \frac{0.5 \times 1.034 - 1}{5 \times 10^2})$$

= 0.00605

(74)
$$X_1 = X_{s1} + \frac{Z_2}{Z_1 + Z_2} (X_e + X_d) = 0.01425$$

 $+ \frac{20}{20 + 24} (0.025 + 0.00605) = 0.02835$

$$x_1 = 0.114 + \frac{20}{20+24} (0.2 + 0.2)$$

= 0.296

(75)
$$X_2' = X_{s2} + \frac{Z_1}{Z_1 + Z_2} (X_e + X_d)$$

= 0.01336 + $\frac{24}{24 + 20}$ (0.025 + 0.00605)
= 0.0303 Ω

$$X_2' = 0.107 + \frac{24}{24+20} (0.2 + 0.2)$$

= 0.325

(76)
$$L_{1s} = \frac{\chi_1}{2\pi f} = \frac{0.02835}{2 \times \pi \times 20} = 2.256 \times 10^{-4}$$

$$L_{1s} = \frac{0.296}{2 \times \pi \times 160} = 2.94 \times 10^{-4}$$

$$L_{1r} = \frac{\chi_2^1}{2\pi f} = \frac{0.0303}{2 \times \pi \times 20} = 2.41 \times 10^{-4}$$

$$L_{1r} = \frac{0.325}{2 \times \pi \times 160} = 3.23 \times 10^{-4}$$

$$R_s = 0.0274 \Omega$$

$$R_s = 0.0274 \Omega$$

$$R_{m}^{1} = 0.0213 \Omega$$

$$R_{r}^{1} = 0.0213 \Omega$$

$$L_{\rm m} = 6.51 \times 10^{-3}$$

$$L_{\rm m} = 26.8 \times 10^{-3}$$

APPENDIX E

MOTOR TRANSIENT TEMPERATURE RISE

Peak Momentary Motor Temperature Rise

The specifications require three motor operating points.

- 1. 100 per cent speed, 30 kW output for 1 hour
- 2. 10 per cent speed, 16 kW output for 3 min.
- 3. 80 per cent speed, 60 kW output for 3 min.

The first one is obviously no problem.

$$I_{ph} = \frac{170}{216} \times 110.2 = 86.7 A$$

$$\delta_1 = \frac{86.7}{2 \times 11.19} = 3.87 \text{ A/mm}^2 \text{ (See Appendix D)}$$

The copper losses are small due to the low current, and the motor operates under saturation, so the core losses are also small. Although the mechanical losses are greatest at top speed, high speed creates very good heat dissipation conditions. One hour operation is expected to produce nearly steady state temperature rise.

The second one is worse than the third case for temperature rise because at this operating point there are maximum losses and worst case heat dissipation conditions.

The heat balance differential (1) can be applied to evaluate the transient temperature rise.

$$\frac{d\theta}{dt} + \theta \frac{S\lambda}{GC_p} = \frac{P}{GC_p}$$
 (1)

where θ is temperature rise, °C

S is cooling surface of the hot body, m^2

G is weight of the hot body, kg

 ${\bf C_p}$ is specific heat of the hot body, J/kg-°C

 $\bar{\lambda}$ is specific heat dissipation or emissivity,

J per second per m² of surface per °C difference between surface and ambient cooling medium

P is heat developed, J per second or W

During a short time we neglect the exchange between stator and rotor (the heat-resistance of air gap is very large), and even neglect the heat dissipation. This means that all the heat developed causes temperature rise, and of course, this is the most serious situation.

Then (1) becomes

$$\frac{d\theta}{dt} = \frac{P}{GC_p}$$

$$\theta = \int \frac{P}{GC_p} dt$$
 (2)

If we assume P and $\mathbf{C}_{\mathbf{p}}$ are constant, then

$$\theta = \frac{P}{GC_p} t \tag{3}$$

where t = 3 minutes = 180 s $G = m \times 2 \times L_{ph} \times S_c \times a_p \times 10^{-3} \times g_c$ = 2 x 2 x 29.17 x 11.19 x 2 x 10⁻³ x 8.9 = 23.24 $g_c = 8.9 \text{ kg/dm}^2$ (specific gravity of copper)

The total weight G of the two-phase bifilar winding is greater because each single winding conducts for only a half cycle. Thus, the bifilar windings have an advantage for short time transient temperature rise - not significant for steady state.

The specific heat $C_{\mathbf{p}}$ of copper is

$$C_p = 0.092 \text{ Btu/1bF}$$

= 0.092 x $\frac{1055}{0.454 \times \frac{5}{9}} = 384.8 \text{ J/kg}^{\circ}\text{ C}$

P is stator winding losses

$$P = m \times r_s \times I_{rms}^2 = 2 \times 0.0274 \times 200.4^2$$

= 2201
(As shown in Appendix G, I_{rms} is 200.4 A)

From (3), we get

$$\theta = \frac{P}{GC_p} t = \frac{2201}{23.24 \times 384.8} \times 180$$

$$= 44.3 \text{ °C}$$

We suggest the insulation class F. Specifications for the F class insulation are as follows:*

The hot-spot temperature is 155°C.

The maximum permitting temperature rise for totally enclosed fan-cooled motors is 105° C, based on ambient temperature of 40° C, 3330 ft. altitude, and determined by the resistance method.

If we directly apply (1) for 30% duty

$$\frac{d\theta}{dt} + \frac{s\lambda}{GC_p} \theta = \frac{P}{GC_p}$$
then
$$\theta = \frac{P/GC_p}{S\lambda/GC_p} - \frac{P/GC_p}{S\lambda/GC_p} e^{-\frac{S\lambda}{GC_p}t}$$

$$= \frac{P}{S\lambda} - \frac{P}{S\lambda} e^{-\frac{S\lambda}{GC_p}t}$$
(4)

where $\lambda = 1/c = 1/0.04 = 25 \text{ J/sec m}^2 \cdot \text{C}$

(assume no cooling air)

$$S = Z_1 \times L_{mc} \times L_{sp} = 24 \times 0.442 \times 0.091$$

= 1.05 m²

 $L_{\rm sp}$ is the perimeter of stator slot

^{*} Standard Handbook for Electrical Engineers, 11th Edition, McGraw-Hill, pp. 20-45.

$$L_{sp} = 2(h_1+h_2) + W_b + W_s$$

= 2 (31 + 2) + 21 + 12.1 = 99.1 mm
= 0.0991 m

For Z_1 , L_{mc} , h_1 , h_2 , W_b , and W_s refer to the design sheet of the motor in Appendix D.

From (4)

$$\theta = \frac{2201}{1.05 \times 25} - \frac{2201}{1.05 \times 25} e^{-\frac{1.05 \times 25}{23.24 \times 384.8}} t$$

$$= 83.85 - 83.85 e^{-0.00294t}$$

$$30\% duty 3 minutes operation 7 minutes off$$

For the first operation

$$t = 3 \times 60 = 180 \text{ sec}$$

 $\theta_1 = 83.85 - 83.85 \text{ e}^{-0.00294 \times 180}$
 $= 34.5 ^{\circ}\text{C}$

During the 7 minute off interval

$$\theta'_1 = \theta_1 e^{-0.00294 \times t}$$

= 34.5 e $\theta^{-0.00294 \times 420} = 10 \circ C$

The second duty cycle

$$\theta_2 = \theta_1 + 10 = 44.5$$
°C
 $\theta_2' = 44.5$ e $\theta_2' = 44.5$ e $\theta_2' = 44.5$ e $\theta_2' = 13$ °C

The third duty cycle

$$\theta_3 = \theta_1 + 13 = 47.5^{\circ}\text{C}$$

 $\theta_3' = 47.5 \times e^{-0.00294 \times 420} = 13.8^{\circ}\text{C}$

The fourth duty cycle

$$\theta_4 = \theta_1 + 13.8 = 48.3$$
°C
 $\theta_4' = 48.3 e^{-0.00294 \times 420} = 14.05$ °C

The fifth duty cycle

$$\theta_5 = \theta_1 + 14.05 = 48.55$$
°C
 $\theta_5' = 48.55 e^{-0.00294 \times 420} = 14.12$ °C

The sixth duty cycle

$$\theta_6 = \theta_1 + 14.12 = 48.62$$
°C
 $\theta_6' = 48.62$ e -0.00294 x 420 = 14.14°C

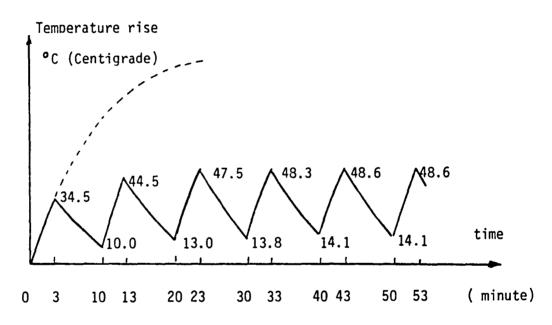


Fig. E-1 Transient Temperature Rise

APPENDIX F

DETAILED INVERTER DESIGN

F.1 INTRODUCTION

The complete system schematic diagram is shown in Fig. F-1. This is identical to Fig. 12 of section 4.4 in this report, but it is included again here for convenience. This appendix describes the detailed design of the two-phase inverter-bifilar induction motor system.

F.2 POWER CIRCUIT DESIGN

Fig. F-2 is the power circuit (same as Fig. 2). The most important aspect of the design of the power circuit is the determination of the rating requirements for the power switch devices. Analysis and simulation of the two-phase bifilar induction machine define the ideal switch voltage and current ratings to supply the power required at the specification operating points.

The power switch ratings (section 3.4.1), assuming ideal circuit conditions, are

Peak Voltage $V_p = 480V$

Peak Current $I_p = 245A$


RMS Current $I_{RMS} = 200A$

Maximum

Switching $f_{S,MAX} = 3.4$ kHz at 245A peak

Frequency

However, it is necessary to analyze the specific circuit configuration to determine the precise transient and steady state voltage and current requirements of the switching devices. One of the primary disadvantages of the circuit in Fig. F-2 is the existence of greater transient voltages. These are the result of leakage inductance due to imperfect coupling between the bifilar windings and motor lead inductance which is now in the commutation path where current switching occurs. The lead inductance does not produce voltage transients in the three-phase bridge system.

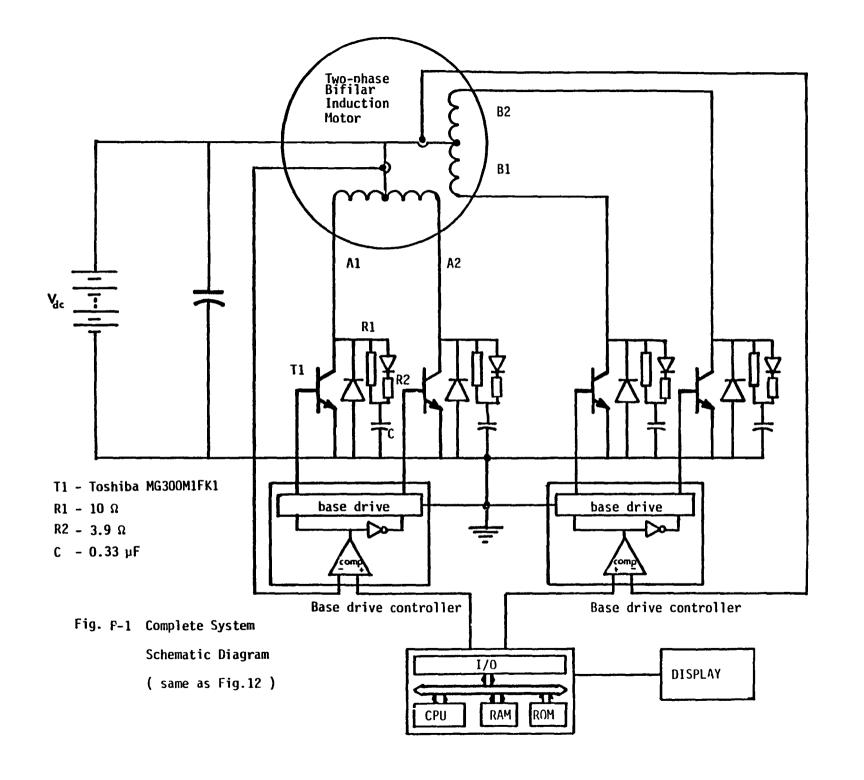

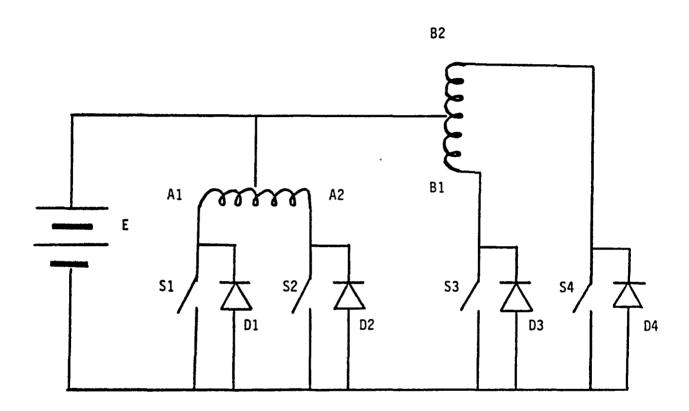


Fig. F-2 Two-phase Bifilar Induction Motor/Inverter

•

F.3 TRANSIENT VOLTAGE SPIKE ANALYSIS

Consider Fig. F-2 at the moment when switch S1 is opened to transfer its current to the S2-D2 branch. If the A1 and A2 bifilar windings are perfectly coupled, and if there is no lead inductance in the circuit including the dc source, motor leads and switch-diode branches, then the current commutation can occur instantly with no voltage transient. Unfortunately, the bifilar winding coupling is not perfect and lead inductances do exist. Therefore, voltage transients are generated proportional to the rate of change of current and the equivalent leakage inductances of the bifilar windings and the battery, motor and switch-diode wiring inductances. Thus, it is essential to minimize these inductances and determine accurate estimates of their maximum values. Snubber Design

Fig. F-3 shows a simplified model of a single snubber circuit including a lumped inductance to represent bifilar winding leakage inductances and lead inductances.

The order of magnitude of the spike voltage is determined from assuming that all of the initial energy stored in the inductance is transferred to the capacitor, that is.

$$\frac{1}{2} L I_p^2 = \frac{1}{2} C V_p^2 \tag{1}$$

where

 $\mathbf{I}_{\mathbf{p}} \ \underline{\Delta}$ peak current at instant switch opens

 $V_{\mathbf{p}} \ \underline{\Delta}$ peak voltage on capacitor

L Δ equivalent total leakage and lead inductance

C $\underline{\Delta}$ snubber capacitance

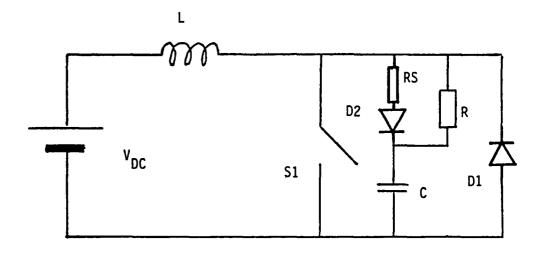


Fig. F-3 Simplified Switching Circuit

Thus

$$V_{p} = \int_{C}^{L} I_{p}$$
 (2)

First, it is necessary to determine the maximum value of L. This inductance is primarily the leakage inductance due to imperfect coupling in the bifilar windings. Normally, the lead inductances are small, particularly if the inverter is mounted close to the motor and if a high quality capacitor is connected directly from the motor winding center-tap to the negative dc bus, which minimizes the effect of battery lead inductance and the inductance in the winding center-tap lead.

The normal total leakage reactance for a 10-100hp induction motor is 0.23 per unit (pu). Of this total, the stator leakage is about 0.1 pu. This stator leakage can be reduced to about 0.05 pu for high torque motors. Finally, the equivalent leakage inductance between two tightly coupled windings in one motor phase should be less than .005 pu. This results in an estimated maximum value of L equal to 15 μ H. However, it is estimated that the leakage inductance between two bifilar motor windings could be reduced an order of magnitude below 15 μ H with special motor winding techniques. For the following calculations an L of 4μ H is used. With I_D = 245A, from (2)

$$V_{p} = \sqrt{\frac{4\mu H}{C}} \quad 245 = \frac{0.49}{\sqrt{C}} \tag{3}$$

If C is chosen equal to 0.33µF,

$$V_{p} = \frac{0.49}{0.33\mu F} = 853V \tag{4}$$

This is a reasonable limit for V_p .

The snubber R is necessary to limit the peak snubber capacitor discharge current at the moment of turning on the power switch. If R is chosen equal to 10 ohms, then

$$I_{p}(0) = \frac{2V_{DC}}{R} = 48A$$
 (5)

This is a reasonable $I_p(0)$ to allow for the device rating. Voltage Spike Simulation

The snubber design carried out in the previous section is based on an approximate transient voltage estimation. The precise switching behavior can be determined by digital simulation including all non-linear effects, or by hardware experiments. Since no hardware construction was done, digital simulations were performed using SPICE to provide more accurate results than could be obtained from approximate analysis.

The switching transient is short relative to changes which occur in the rotor circuit of the induction motor. Thus, the steady state equivalent circuit model is used for the motor load, i.e., r_2/s where r_2 is rotor resistance and s is the slip. The equivalent stator circuit is derived using the three winding transformer input-output relations. Fig. F-4 shows the flux linkages of the transformer, which is equivalent to the bifilar wound induction motor with the assumptions that the switching transient is very fast and that all windings have equal turns. The #1 and #2 windings are the stator bifilar windings, and the #3 winding is the rotor winding. v_1 , v_2 , v_3 and i_1 , i_2 , i_3 are the terminal voltages and currents for each winding. ϕ_1 , ϕ_2 and ϕ_3 are defined as the total flux of #1, #2 and #3 windings, respectively. ϕ_{k1} , ϕ_{k2} , ϕ_{k3} are the corresponding leakage flux for the #1, #2 and #3 windings, respectively. ϕ_M is the mutual flux between either stator winding and the rotor winding, and ϕ_B is the mutual flux between the two stator windings. The following relations are obtained.

$$\phi_1 = \phi_{01} + \phi_R + \phi_M \tag{6}$$

$$\phi_2 = \phi_{22} + \phi_B + \phi_M \tag{7}$$

$$\phi_3 = \phi_{03} + \phi_{M} \tag{8}$$

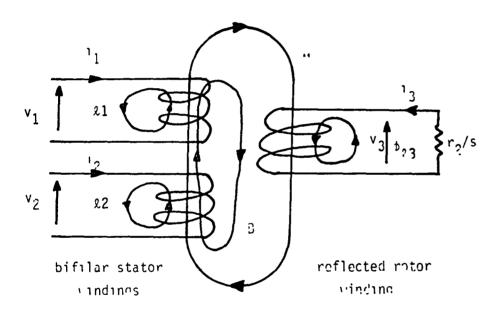


Fig. F-4 Flux linkage relations of three winding transformer

where
$$v_1 = \frac{d\phi_1}{dt}$$
, $v_2 = \frac{d\phi_2}{dt}$, and $v_3 = \frac{d\phi_3}{dt}$

Since the #1 and #2 windings are bifilar windings, they are very tightly coupled. Thus, all of the flux ϕ_M links the #3 winding as well as both the #1 and #2 windings.

Defining the mutual (or magnetizing) inductance L_M between the #1, #2 and #3 windings, the mutual flux ϕ_M is

$$\phi_{M} = L_{M} i_{3} + L_{M} (i_{1} + i_{2}) \tag{9}$$

Defining the mutual inductance $L_{\mbox{\footnotesize{MB}}}$ between the #1 and #2 windings, the mutual flux $\varphi_{\mbox{\footnotesize{R}}}$ is

$$\phi_{B} = L_{MR} i_{1} + L_{MR} i_{2} \tag{10}$$

Defining the leakage inductances L_{21} , L_{22} , and L_{23} of the #1, #2 and #3 windings respectively, then $\phi_{\ell 1}$, $\phi_{\ell 2}$, and $\phi_{\ell 3}$ are

$$\phi_{\ell,1} = L_{\ell,1} \cdot I_1 \tag{11}$$

$$\phi_{22} = L_{22} i_2$$
 (12)

$$\phi_{23} = L_{23} I_3 \tag{13}$$

Combining (6) - (13)

$$\phi_1 = L_{g1} i_1 + L_{MB}(i_1 + i_2) + L_{M}(i_1 + i_2 + i_3)$$
 (14)

$$\phi_2 = L_{22} i_2 + L_{MB}(i_1 + i_2) + L_{M}(i_1 + i_2 + i_3)$$
 (15)

$$\phi_3 = L_{03} i_3 + L_M (i_1 + i_2 + i_3) \tag{16}$$

These three equations provide the equivalent circuit shown in Fig. F-5, where the rotor load and stator resistance r_1 are added. v_1 and v_2 are controlled to be E, -E or 0. This equivalent circuit becomes the conventional equivalent circuit if one of the bifilar winding branches is removed.

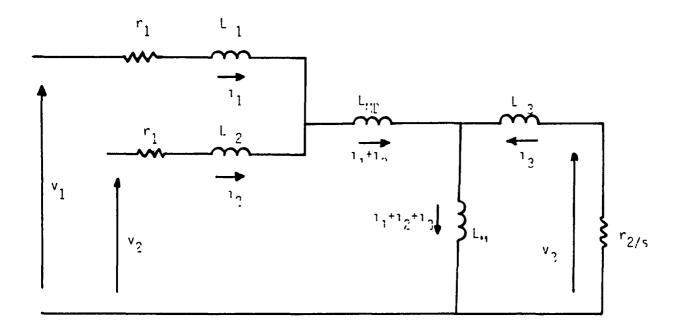


Fig. F-5 [Quivalent Stitching Circuit

SPICE is a general purpose circuit simulation program. Circuits may contain resistors, capacitors, inductors, mutual inductors, independent voltage and current sources, four types of dependent sources, transmission lines, and the most common semiconductor devices: diodes, BJTs, JFETs and MOSFETs.

Fig. F-6 shows the equivalent circuits used for simulation, including snubber circuits and base drive circuits. When one device is turned off, the base drive voltage source is changed linearly from 10 volts to zero for a 5 microsecond interval. After a 15us delay, when the other is turned on, the base voltage is controlled linearly from zero to 10 volts for a 5µs interval. When one device is switched off, the current first flows through the feedback diode of the other device. Thus, the delay time in turn-on of the next device has no effect. The interval during which the base voltage source is linearly controlled is changed from 5µs to 2µs, but the transient voltage changes no more than 0.4% in its peak value. The lumped leakage inductances LLS1 and LLS2, shown in Fig. F-6, are chosen to be $4\mu H$, while the sum of LLS1 and LMB is equal to the stator leakage inductance. LM and LLR are equal to the magnetizing and rotor leakage inductances respectively. RS1 and RS2 are the stator winding resistances, and RR2 is calculated from r_2 /s where r_2 is the rotor resistance and s is the slip at the steady state operating point. The series resistances Rll and R22 help to suppress the transient voltage. By trial and error, 3.9 ohms are selected. A peak transient yoltage of 943 yolts across the transistors is obtained for the following operating conditions and system parameters:

> 10% speed, 16 kW output Percent slip = 8.5%

Stator current = 245A

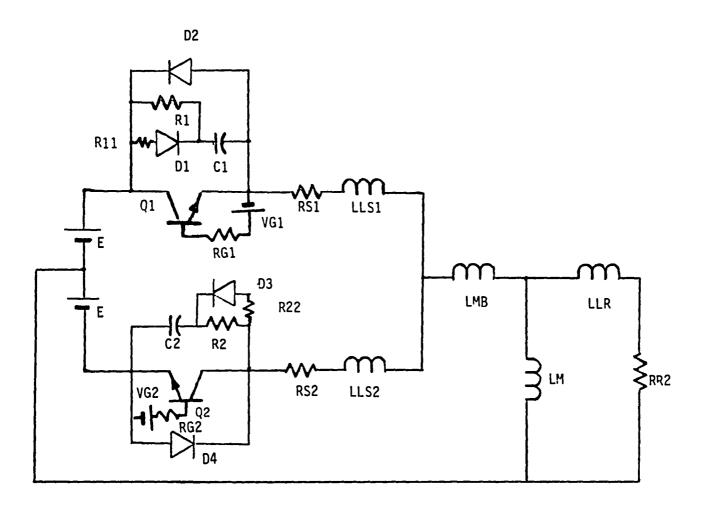


Fig. F-6 Equivalent circuit used for simulation

Note: LLS1 and LLS2 are equivalent leakage inductance.

Magnetizing current (through LM) = 93A Rotor current = 142A LM = 6.51mH; LLR = $241\mu\text{H}$ LLS1 = LLS2 = $4\mu\text{H}$; LMB = $221.6\mu\text{H}$ RS1 = RS2 = 0.0274Ω ; RR2 = $0.0213/0.085 = 0.251\Omega$ R1 = R2 = 10Ω ; R11 = R22 = 3.9Ω C1 = C2 = $0.33\mu\text{F}$

The transient waveforms of the collector-emitter voltage and bifilar winding current (i_1 in Fig. F-6) are plotted in Fig. F-7, and the corresponding simulation source program is listed in Fig. F-8. Without R11 and R22, the transient voltage is about 1160 volts.

Next, the equivalent leakage inductances LLS1 and LLS2 are changed from zero to 10µH and the peak transient voltage is plotted in Fig. F-9. The operating condition of 80% speed, 60kW output is also simulated, and the transient voltage variation is shown in Fig. F-9 using the following parameters:

Stator current = 245A

Magnetizing current = 20A

Rotor current = 225A LM = 26.8mH; $LLS1 + LMB = 294\mu H$ $RR2 = 0.0213/.02 = 1.07\Omega(2\% slip)$

Other parameters same as for 16kW, 10% speed condition Fig. F-9 indicates that the spike voltage is somewhat less than 1000V if the equivalent leakage inductance is $4\mu H$.

-2**

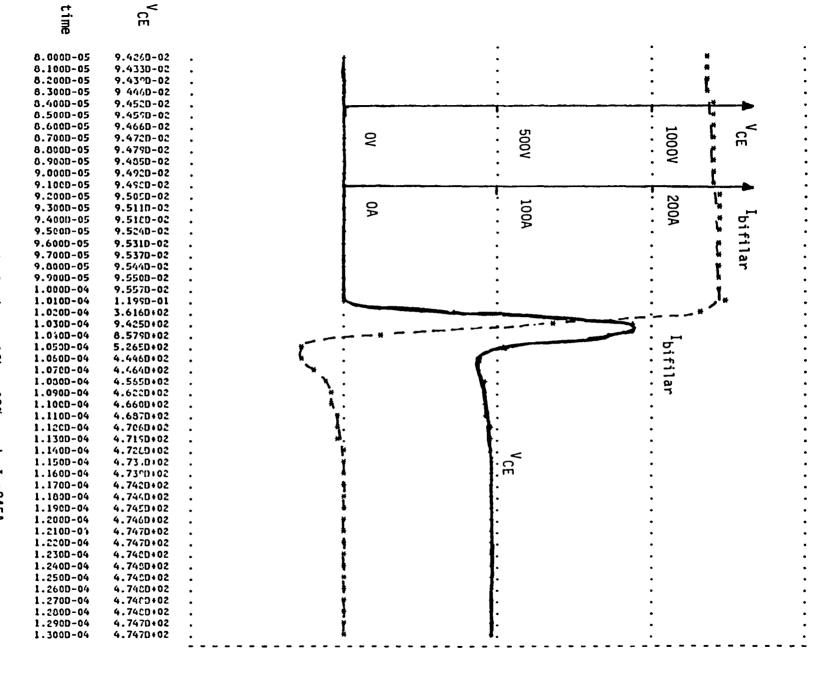


Fig. Voltage C1=C2=0.33 μF , LLS1=LLS2=4 μH , R11=R22=3.9 Ω spike simulation 16kw, 10%speed, I_p=245A, R1=R2=10Ω in Fig.F-6

```
**** 1/28/85****** SPICE 2E.2 (26SEP78) *******15445436*****
```

JPL PROJECT VOLTAGE SPIKE 12/18/84

SPI00060

INPUT LISTING TEMPERATURE = 27.000 DEG C

```
*** BIFILAR WINDING
                    3 TRANSFORMER MODEL
                                                                   SPI00070
*** MAIN CIPCUIT
                                                                   SPI00080
     CURRENT SENSE FOR COLLECTOR CURRENT VCOLLE
     VDC1 1 0 240VOLT
     Q1 9 2 3 QHPN
     VCOLLE 1 9 1UV
***** ADJUST R11 *****
     R11 I 8 3.9000HM
     D1 8 4 DHOD
     R1 1 4 10.00HM
* CHANGE C FOR SHUBBER /////
     C1 4 3 0.33UF
     D2 3 1 DMOD
     RS1 3 5 0.0274
* CHANGE LLSI******************
     LLS1 5 7 4.00UH IC=198A
  CURRENT SENSE FOR BIFILAR WINDING VBIFI
                                                                   SPI00170
     VBIFI 7 6 1UV
                                                                   SPI00190
     VDC2 0 11 240V
     Q2 13 12 11 QNPN
***** ADJUST R22 *****
     R22 13 16 3.9000HM
     D3 16 14 DMOD
     R2 13 14 10.00HM
* CHANGE C FOR SHUBBER //////
     C2 14 11 0.33UF IC=450V
     04 11 13 DMOD
     RS2 13 15 0.0274
# CHANGE LLS2*****************
     LLS2 15 6 4.00UF
* CHANGE LMB********LMB+LLS1(LLS2)=225.6UH AT 20 HZ, 294UH AT 160HZ SPI00280
* ******** AT 20 HZ
  ******* AT 160 HZ
     LMB 6 21 221.6UH IC=198A
     LM 21 0 6.51MH IC=85A
     LLR 21 22 241UH IC=113A
     RR2 22 0 0.251
*** GATE DRIVE
                                                                   SPI00330
     RG1 2 7 10HH
     RG2 12 17 10HM
     VG1 7 3 PML (0 10V 100US 10V 105US -10 420US -10 425US 10V)
     VG2 17 11 PWL(0 -10 120US -10 125US 10V 400US 10V 405US -10)
*** DEVISE MODEL
                                                                   SPI00380
     .MODEL QNPN NPN(VA=2000V,VB=2000V)
     .MODEL DHOO D(BV=2000V)
***
   OUTPUT
                                                                   SPI00410
    .PRINT TRAN V(9,3), I(VCOLLE), V(4,3), I(VBIFI), V(6)
    .PLOT TRAN V(9,3), I(VBIFI)
    .TRAN 1.OUS 130US UIC
    .OPTIONS LIMPTS=201 LIST NOOE
    . END
```

Fig. F-8 Source listing of SPICE simulation program

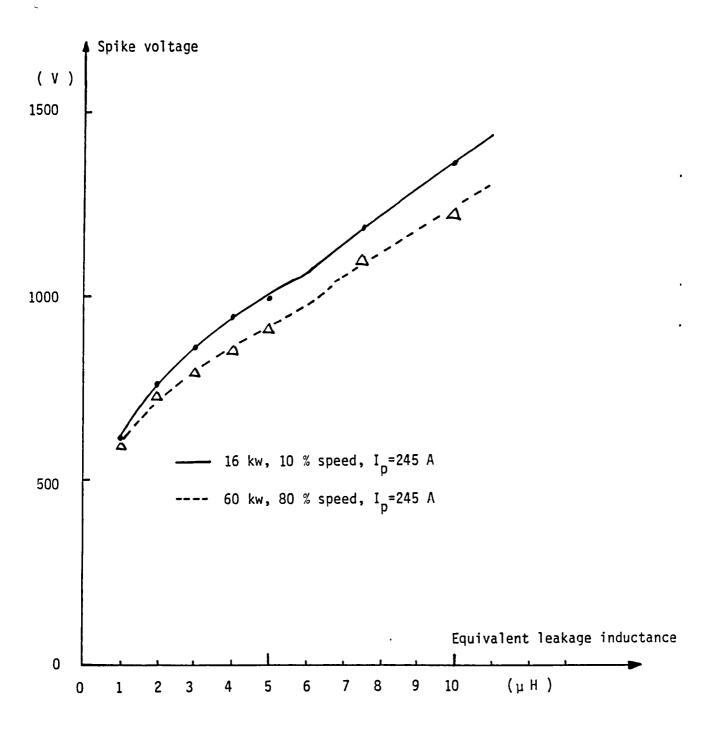


Fig. F-9 Spike voltage vs equivalent leakage inductance (simulation results)

F.4 LOSS CALCULATION*

Switching Loss

There are four possible switching operations for which different loss calculations are required. Fig. F-10 shows the switching devices and the snubber circuit components only for the A phase. I_{A1} and I_{A2} stand for the stator currents for bifilar windings A1 and A2 respectively, and V_{C1} and V_{C2} are the voltages across capacitors C_1 and C_2 respectively. The following four cases are considered to calculate the switching loss only for switch S1.

(1) Turn-On of S1 When $I_{A2} > 0$: Initially, while switching device S1 is open, diode D4 conducts and capacitor voltage V_{C1} is charged up to $2V_{DC}$. The stored energy in this capacitor is

$$W_{C} = \frac{1}{2} C (2V_{DC})^{2} = 2CV_{DC}^{2}$$
 (17)

Some of this energy will be dissipated in S1 during its turn-on and some will be dissipated in the snubber R1. Assuming an exponential drop of collector-emitter voltage v_{S1} as S1 turns on,

$$v_{S1} = 2V_{DC} e^{-t/\tau}$$

^{* &}quot;Analysis and Design of Optimized Snubber Circuits for dv/dt Protection in Power Thyristor Applications," S. J. Wu, GE 660.24, 2/71.

[&]quot;Optimum Snubbers for Power Semiconductors," William McMurray, 1971 IAS Conference Record, pp. 885-893.

[&]quot;Snubbers for Pulse-Width Modulated Bridge Converters with Power Transistors or GTOs," Tore M. Undeland, IPEC Tokyo '83 Conference Record, pp. 313-323.

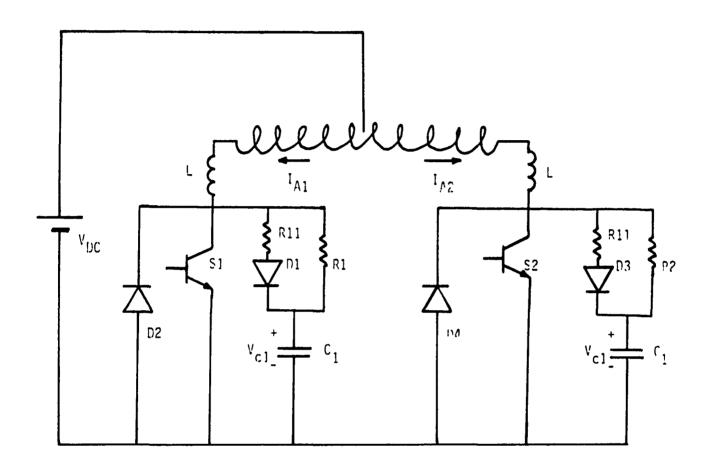


Fig. F-10 Switching devices and snubber circuits only for A phase

where $\boldsymbol{\tau}$ is the exponential time constant. Then the discharging current is is

$$i_{S} = \frac{v_{C} - v_{S1}}{R} = \frac{2V_{DC}}{R} \left(\varepsilon^{-t/\tau} S - \varepsilon^{-t/\tau} \right) \frac{\tau_{S}}{\tau_{S}^{-\tau}}$$
 (19)

where $\tau_S = RC$.

The energy dissipated in S1 is

$$W_{S1} = \int_{0}^{\infty} v_{S1} i_{S1} dt = \frac{2V_{DC}^{2}}{R} \frac{\tau \tau_{S}}{\tau_{S} + \tau}$$
 (20)

Since all of the initial stored energy in the snubber capacitor must be dissipated, the total turn-on switching energy loss is given by

(2) Turn-Off of S1 when $I_{A1} > 0$: While switch S1 is on, I_{A1} flows through S1.

The energy initially stored in the equivalent leakage L is

$$W_{L} = \frac{1}{2} L i_{L}^{2}(0)$$
 (21)

where $i_L(0)$ is the current I_{A1} at the instant S1 turns off.

The final energy stored in C after the switch is open is

$$W_{C} = \frac{1}{2} C (2V_{DC})^{2} = 2CV_{DC}^{2}$$
 (22)

An amount of energy equal to that in (22) is dissipated in the equivalent charging resistance for capacitor Cl. Some of the initial stored energy in L is returned to the dc source, but the worst case turn-off switching energy loss is

$$W_{L} - W_{C} = \frac{1}{2} L i_{1}(0) + 2CV_{DC}^{2}$$
 (23)

(3) Turn-On of S1 When $I_{A2} > 0$: While switch S2 is on, I_{A2} flows through S2 and capacitor C1 is charged up to $2V_{DC}$. Even though S2 is turned off and the base current is supplied to switch S1, S1 is still open. If $|I_{A1}|$ is less than 48A, first capacitor C1 discharges its stored energy, and after the capacitor voltage V_{C1} minus the voltage drop across R1 goes to zero, diode D2 conducts. If $|I_{A1}|$ is larger than 48A, then diode D2 conducts very quickly after switch S2 is turned off.

The worst case energy loss is estimated to be equal to the stored energy in the capacitor. Thus, the loss energy is

$$W_{C} = \frac{1}{2} C (2V_{DC})^{2} = 2CV_{DC}^{2}$$
 (24)

(4) Turn-Off of S1 when $I_{A1} < 0$: While S2 is open, diode D2 is on, and capacitor voltage V_{C1} is zero. When S2 turns on, I_{A1} extinguishes and V_{C1} is charged up to $2V_{DC}$.

The loss calculation is very similar to case (2), and the total loss energy is

$$W_{L} + W_{C} = \frac{1}{2} L i_{L}^{2}(0) + 2CV_{DC}^{2}$$
 (25)

On-State Loss

The total on-state loss is the integral of the instantaneous power dissipated in the four switch branches, which is

$$P_{ON} = \frac{1}{T} \begin{cases} \int_{0}^{t_{ON,1}} V_{S1} i_{S1} dt + \int_{t_{ON,1}}^{t_{ON,1}+t_{OFF,1}} V_{D1} i_{D1} dt \\ + \int_{t_{ON,1}+t_{OFF,1}}^{t_{ON,1}+t_{OFF,1}} V_{S1} i_{S1} dt + \dots \end{cases}$$

$$= [d(V_{S1} I_{S1}) + (1-d) V_{D1} I_{D1}] \times 4$$
 (26)

where d Δ duty cycle of switching

 $V_{S1} \triangle$ on-state voltage drop across S1 (assumed constant)

 $I_{S1} \triangleq average current through S1$

 $V_{D1} \Delta diode drop (assumed constant)$

 $I_{D1} \stackrel{\Delta}{=} average$ current through diode

and (26) assumes that the average currents over the cycle through the transistor and the diode are equal.

Summary

The total switching energy loss w_{SW} for one switching is given by adding the turn-on energy loss, (17), and the turn-off energy loss, (23) or (25).

$$w_{SW} = \frac{1}{2} L i_{L}^{2}(0) + 4CV_{DC}^{2}$$
 (27)

and the total switching loss over a period T is

$$P_{SW} = \frac{1}{T} \sum_{n=0}^{N} \left[\frac{1}{2} L i_{L}^{2}(t_{n}) + 4CV_{DC}^{2} \right] \times 4$$

$$\approx \left[\frac{1}{2} L I_{L,RMS}^{2} f_{S} + 4CV_{DC}^{2} f_{S} \right] X 4$$
 (28)

The total on-state loss is given by (26). Thus, the total inverter loss is the sum of (26) and (28)

$$P_{T} = \left[\frac{1}{2} L I_{L,RMS}^{2} f_{S} + 4CV_{DC}^{2} f_{S} + dV_{S1}^{I} I_{S1} - (1-d) V_{D1}^{I} I_{D1}\right] \times 4$$

Calculated Losses

13.1 kW output at 80% speed

$$I_{rms}$$
 = 53.2A; I_{p} = 103A; f_{S} = 1.6 kHz
d = 0.72/2 = 0.36; V_{S1} = 1.8V; V_{D1} =0.8V
 I_{ave} = 48.8/2 = 24.4A/device

On-State Loss from (26)

$$P_{on}$$
 = [0.36 x 1.2 x 24.4 + 0.64 x 0.8 x 24.4] x 4 = 113.2

Switching loss from (28)

$$P_{SW} = [0.5 \times 4 \times 10^{-6} \times 53.2^{2} + 4 \times 0.33 \times 10^{-6} \times 240^{2}] \times 1.6 \times 10^{3} \times 4 = 522.8$$

Total: 636.0 W

Efficiency: 95.4%

16.4 kW output at 10% speed

$$I_{rms}$$
 = 200A; I_{p} = 245A; f_{S} = 3.4kHz
d = 0.6/2 = 0.3; V_{S1} = 1.8V; V_{D1} = 0.8V
 I_{ave} = 197.4/2 = 98.7A/device

On-State Loss from (26)

$$P_{on} = [0.3 \times 1.8 \times 98.7 + 0.7 \times 0.8 \times 98.7] \times 4 = 434.3$$

Switching Loss from (28)

$$P_{SW} = [0.5 \times 4 + 10^{-6} \times 200^{2} + 4 \times 0.33 + 10^{-6} \times 240^{2}] \times 3.4 \times 10^{3}$$

 $\times 4 = 2,122.0$

Total: 2,556.3 W

Efficiency: 86.5%

60.5 kW Output at 80% Speed

$$I_{rms} = 175A$$
; $I_p = 245A$; $f_S = 160Hz$
 $d = 0.83/2 = 0.42$; $V_{S1} = 18.V$; $V_{D1} = 0.8V$
 $I_{ave} = 173/2 = 86.5A/device$

On-State Loss from (26)

$$P_{on} = [0.42 \times 1.8 \times 86.5 + 0.58 \times 0.8 \times 86.5] \times 4 = 422.1$$

Switching Loss from (28)

$$P_{SW} = [0.5 \times 4 \times 10^{-6} \times 175^{2} + 4 \times 0.33 \times 10^{-6} \times 240^{2}] \times 160 \times 4 = 87.9$$

Total: 510.0 W

Efficiency: 99.2%

F.5 CONTROLLER

The microprocessor based controller system must generate the required driving signals for the power transistors to implement current controlled PWM. The hardware necessary for this controller is shown in Fig. F-11 which consists of the main CPU, ROM, RAM, I/O ports and other electronic components. The controller sets the output frequency of the inverter drive, in reference to the driving command, from 0-200Hz. In addition, the controller sets the amplitude and the envelope of the controlled current at any given load and speed to provide maximum efficiency with acceptable torque pulsations. The closed loop control diagram is shown in Fig. F-12.

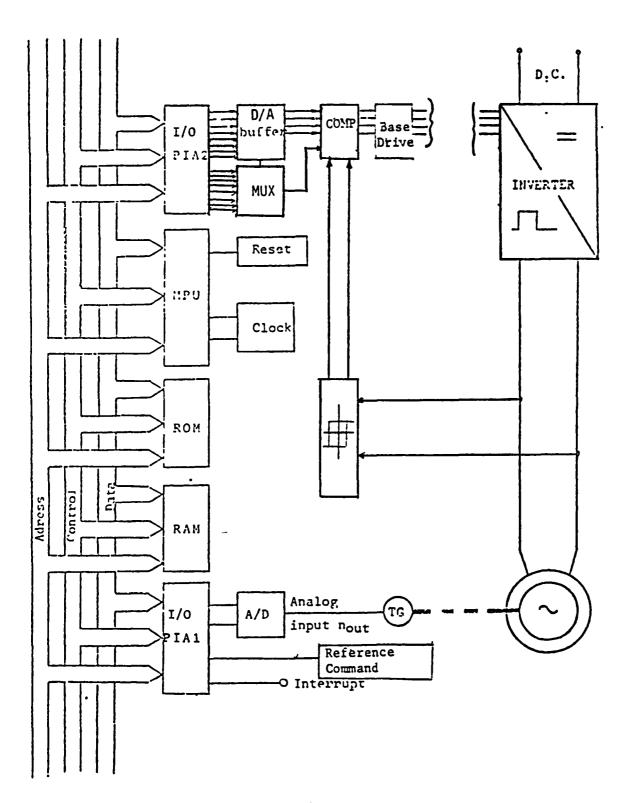


Fig. F-ll System hardware

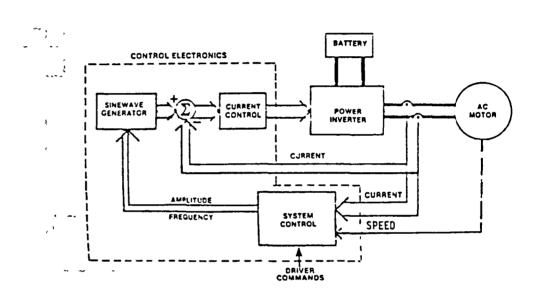


Fig. F-12 Closed loop control

APPENDIX G

SIMULATION RESULTS

G.1 DERIVATION OF EQUATIONS FOR TWO-PHASE MACHINE

The circuit diagram of the two-phase inverter/bifilar induction motor is shown in Fig. 2, section 3.0 of this report. Fig. G-1 shows the expected phase voltage and current waveforms without PWM current control. The phase relationships between the stator and rotor windings are shown in Fig. G-2.

The derivation of the simulation model for the two-phase induction motor proceeds as follows:

Let
$$L_{1SA} = L_{1SB} = L_{1S}$$
, $L_{1rA} = L_{1rB} = L_{1r}$
 $L_{S} = L_{1S} + L_{m}$, $L_{r} = L_{1r} + L_{m}$

 $\mathbf{L}_{\mathbf{m}}$ is the mutual inductance of A-phase or B-phase

 $\textbf{i}_{AS},~\textbf{i}_{BS}$ have the frequency of supply (ω)

 i_{Ar} , i_{Br} have the frequency of the slip $(\omega - \omega_r)$

$$V_{AS} = R_{S}i_{AS} + L_{1S} \frac{di_{AS}}{dt} + \frac{d}{dt} \lambda_{AS}$$

$$V_{BS} = R_{S}i_{BS} + L_{1S} \frac{di_{BS}}{dt} + \frac{d}{dt} \lambda_{BS}$$

$$V_{Ar} = R_{r}i_{Ar} + L_{1r} \frac{di_{Ar}}{dt} + \frac{d}{dt} \lambda_{Ar}$$

$$V_{Br} = R_{r}i_{Br} + L_{1r} \frac{di_{Br}}{dt} + \frac{d}{dt} \lambda_{Br}$$


$$(1)$$

$$\lambda_{AS} = L_{m}^{i}_{AS} + L_{m}^{i}_{Ar} \cos \theta - L_{m}^{i}_{Br} \sin \theta$$

$$\lambda_{BS} = L_{m}^{i}_{BS} + L_{m}^{i}_{Ar} \sin \theta + L_{m}^{i}_{Br} \cos \theta$$

$$\lambda_{Ar} = L_{m}^{i}_{Ar} + L_{m}^{i}_{AS} \cos \theta + L_{m}^{i}_{BS} \sin \theta$$

$$\lambda_{Br} = L_{m}^{i}_{Br} - L_{m}^{i}_{AS} \sin \theta + L_{m}^{i}_{BS} \cos \theta$$
(2)

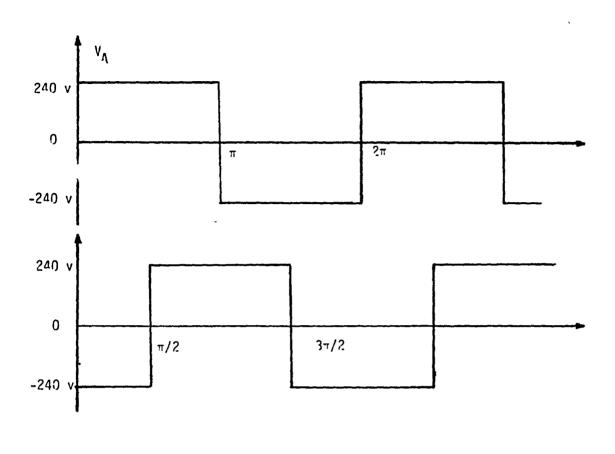

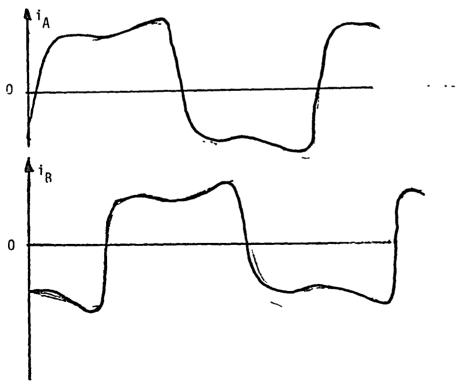


Fig. G-1 Expected Waveforms without neak current controller

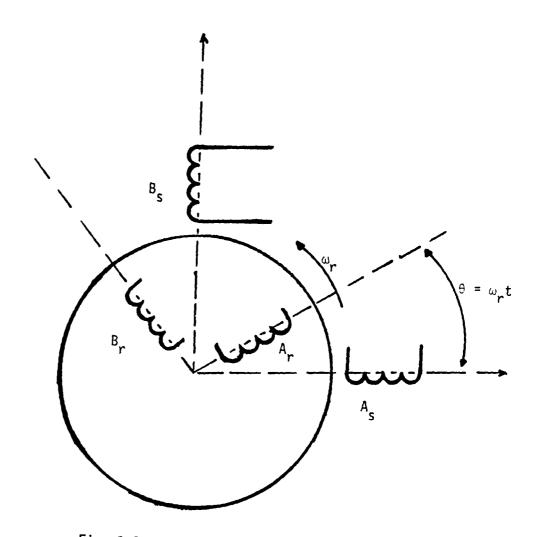


Fig. G-2 Phase relationship of stator and rotor

Equations (1) and (2) can be expressed in matrix form as follows:

$$\begin{vmatrix} \vec{v}_S \\ -\vec{v}_r \end{vmatrix} = \begin{vmatrix} \overline{R}_S & | & 0 \\ 0 & | & \overline{R}_r \end{vmatrix} \begin{vmatrix} \vec{t}_S \\ -\vec{t}_r \end{vmatrix} + \begin{vmatrix} \overline{L}_{1s} & | & 0 \\ 0 & | & \overline{L}_{1r} \end{vmatrix} \frac{d}{dt} \begin{vmatrix} \vec{t}_S \\ -\vec{t}_r \end{vmatrix} + \frac{d}{dt} \begin{vmatrix} L_1 & L_2 \\ L_3 & L_4 \end{vmatrix} \begin{vmatrix} \vec{t}_S \\ -\vec{t}_r \end{vmatrix}$$
(3)

where
$$\overline{R}_{S} \triangleq \begin{vmatrix} R_{S} & 0 \\ 0 & R_{S} \end{vmatrix}$$
 $\overline{R}_{r} \triangleq \begin{vmatrix} R_{r} & 0 \\ 0 & R_{r} \end{vmatrix}$
 $\overline{L}_{1s} \triangleq \begin{vmatrix} L_{1s} & 0 \\ 0 & L_{1s} \end{vmatrix}$
 $\overline{L}_{1r} \triangleq \begin{vmatrix} L_{1r} & 0 \\ 0 & L_{1r} \end{vmatrix}$

$$\vec{v}_S \triangleq \begin{vmatrix} v_{AS} \\ v_{BS} \end{vmatrix}$$
 $\vec{v}_r \triangleq \begin{vmatrix} v_{Ar} \\ v_{Br} \end{vmatrix}$
 $\vec{t}_S \triangleq \begin{vmatrix} i_{AS} \\ i_{BS} \end{vmatrix}$
 $\vec{t}_r \triangleq \begin{vmatrix} i_{Ar} \\ i_{Br} \end{vmatrix}$

$$\begin{array}{c|cccc} L_{3} \stackrel{\triangle}{=} & L_{m} cos\theta & L_{m} sin\theta \\ -L_{m} sin\theta & L_{m} cos\theta & & L_{4} \stackrel{\triangle}{=} & 0 \\ \end{array}$$

$$\begin{vmatrix} \vec{V}_{S} \\ - \\ \vec{V}_{r} \end{vmatrix} = \begin{vmatrix} \vec{R}_{S} & | & 0 \\ - & | & - \\ 0 & | & \vec{R}_{r} \end{vmatrix} \begin{vmatrix} \vec{1}_{S} \\ - \\ i_{r} \end{vmatrix} + \begin{vmatrix} \vec{L}_{1S} & | & 0 \\ - & | & - \\ 0 & | & \vec{L}_{1r} \end{vmatrix} \begin{vmatrix} \vec{1}_{S} \\ - \\ i_{r} \end{vmatrix} + \frac{d}{dt} \begin{vmatrix} \vec{L}_{1}\vec{1}_{S} + \vec{L}_{2}\vec{1}_{r} \\ - & - & - \\ \vec{L}_{3}\vec{1}_{S} + \vec{L}_{4}\vec{1}_{r} \end{vmatrix}$$

$$= \left| \frac{\overline{R}_{S}}{\overline{R}_{r}} - \frac{\vec{1}_{S}}{\vec{1}_{r}} \right| + \left| \frac{\overline{L}_{1S}}{\overline{L}_{1r}} - \frac{\vec{1}_{S}}{\vec{1}_{r}} \right| + \left| \frac{\vec{L}_{1}\vec{1}_{S}}{\overline{L}_{3}\vec{1}_{S}} + \frac{\vec{L}_{1}\vec{1}_{S}}{\overline{L}_{3}\vec{1}_{S}} + \frac{\vec{L}_{2}\vec{1}_{r}}{\overline{L}_{4}\vec{1}_{r}} + \frac{\vec{L}_{2}\vec{1}_{r}}{\overline{L}_{4}\vec{1}_{r}} \right|$$

$$= \begin{vmatrix} \overline{R}_{S} + \dot{L}_{1} \\ \overline{L}_{3} \end{vmatrix} + \begin{vmatrix} \dot{L}_{2} \\ \overline{R}_{r} + \dot{L}_{4} \end{vmatrix} \begin{vmatrix} \dot{\uparrow}_{S} \\ \overline{\uparrow}_{r} \end{vmatrix} + \begin{vmatrix} \overline{L}_{1S} + L_{1} \\ \overline{L}_{3} \end{vmatrix} - \begin{vmatrix} L_{2} - L_{4} \\ \overline{L}_{1r} + L_{4} \end{vmatrix} \begin{vmatrix} \dot{\uparrow}_{S} \\ \overline{\uparrow}_{r} \end{vmatrix}$$
(4)

If i_{Ar} and i_{Br} are transformed to d-q coordinates which are fixed on the stator, that is, d-q axes rotating in the reverse direction relative to the rotor, then i_{Ar} and i_{Br} with angular velocity $(\omega-\omega_r)$ become i_{Ar} and i_{Br} with angular velocity (ω) .

$$\vec{i}_r \triangleq \begin{vmatrix} i & Ar \\ i & Br \end{vmatrix} \qquad \vec{i}_r \triangleq \vec{C} \vec{i}_r \qquad (5)$$

$$\vec{i}_r \triangleq \vec{c}^{-1} \vec{i}_r \qquad \qquad \vec{i}_r = \vec{c} \vec{i}_r + \vec{c} \vec{i}_r$$

$$\overline{C} = \begin{vmatrix} \cos(-\theta) & -\sin(-\theta) \\ \sin(-\theta) & \cos(-\theta) \end{vmatrix} = \begin{vmatrix} \cos\theta & \sin\theta \\ -\sin\theta & \cos\theta \end{vmatrix}$$

$$\overline{C}^{-1} = \begin{vmatrix} \cos\theta & -\sin\theta \\ \sin\theta & \cos\theta \end{vmatrix} \qquad \frac{\cdot}{C} = \begin{vmatrix} -\omega_r \sin\theta & -\omega_r \cos\theta \\ \omega_r \cos\theta & -\omega_r \sin\theta \end{vmatrix}$$

$$\theta \triangleq \omega_{rt}$$

$$\begin{vmatrix} \frac{\vec{V}_S}{\vec{C}^{-1}\vec{V}_r} \end{vmatrix} = \begin{vmatrix} \frac{\vec{R}_S + \vec{L}_1}{\vec{C}^{-1}\vec{L}_3} & \frac{\vec{L}_2}{\vec{C}^{-1}(\vec{R}_r + \vec{L}_4)} \end{vmatrix} \begin{vmatrix} \frac{\vec{I}_S}{\vec{C}^{-1}} & + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_S \end{vmatrix} + \frac{\vec{L}_S}{\vec{C}^{-1}\vec{L}_3} \begin{vmatrix} \vec{L}_S + \vec{L}_1 & + \vec{L}_2 & + \vec{L}_1 & + \vec{L}_2 & + \vec{L}_2 & + \vec{L}_3 & + \vec{L}_$$

$$\begin{vmatrix} \overline{L}_{1\underline{s}} + \underline{L}_{1} & | & \underline{L}_{2} & | & \overline{t}_{1} \\ \overline{C}^{-1} L_{3} & | & \overline{C}^{-1} (\overline{L}_{1r} + \underline{L}_{4}) \end{vmatrix} \begin{vmatrix} \overline{L}_{1r} + \overline{L}_{4} \\ \overline{C} & \overline{t}_{r} + \overline{C} & \overline{t}_{r} \end{vmatrix}$$

$$= \begin{vmatrix} \frac{1}{\overline{C}} & \frac{1}{\overline{C}} &$$

$$\begin{vmatrix} \frac{\overline{C}_{1S} + \overline{C}_{1}}{\overline{C}_{1}} & \frac{\overline{C}_{1}}{\overline{C}_{1}} & \frac{\overline{C}_{1}}{\overline{$$

1
$$\overline{R}_S + \dot{L}_1 = \begin{vmatrix} R_S & 0 \\ 0 & R_S \end{vmatrix}$$
 Therefore, $\dot{L}_1 = \begin{vmatrix} 0 & 0 \\ 0 & 0 \end{vmatrix}$

$$+ \begin{vmatrix} L_{m}\cos\theta & -L_{m}\sin\theta \\ L_{m}\sin\theta & L_{m}\cos\theta \end{vmatrix} \begin{vmatrix} -\omega_{r}\sin\theta & -\omega_{r}\cos\theta \\ \omega_{r}\cos\theta & -\omega_{r}\sin\theta \end{vmatrix} = |0|$$

$$= \begin{vmatrix} R_{r} & 0 \\ 0 & R_{r} \end{vmatrix} + \begin{vmatrix} 0 & \omega_{r}L_{r} \\ -\omega_{r}L_{r} & 0 \end{vmatrix} = \begin{vmatrix} R_{r} & \omega_{r}L_{r} \\ -\omega_{r}L_{r} & R_{r} \end{vmatrix}$$

$$\begin{vmatrix} L_{S} & 0 & L_{m} & 0 \\ 0 & L_{S} & 0 & L_{m} & 0 \\ 0 & L_{m} & 0 & L_{r} & 0 \\ 0 & L_{m} & 0 & L_{r} & 1 \end{vmatrix}$$

$$\begin{vmatrix} \dot{\dagger}_{S} \\ \dot{\dagger}_{S} \end{vmatrix} = \begin{vmatrix} \dot{\dagger}_{AS} \\ \dot{\dagger}_{BS} \end{vmatrix}$$

$$\dot{\dagger}_{r} = \begin{vmatrix} \dot{\dagger}_{Ar} \\ \dot{\dagger}_{Rr} \end{vmatrix}$$

$$\dot{\dagger}_{AS} \triangleq \frac{d\dot{\dagger}_{AS}}{dt} = p\dot{\dagger}_{AS} \dots ,$$

If the machine has a squirrel-cage rotor, then

$$\overline{c}^{-1}\overrightarrow{v}_{r} = \begin{bmatrix} 0 \\ 0 \end{bmatrix}$$

Therefore

$$\begin{vmatrix} V_{AS} \\ V_{BS} \\ 0 \\ 0 \end{vmatrix} = \begin{vmatrix} R_{S}^{+L}_{S}^{p} & 0 & L_{m}^{p} & 0 \\ 0 & R_{S}^{+L}_{S}^{p} & 0 & L_{m}^{p} \\ L_{m}^{p} & \omega_{r}L_{m} & R_{r}^{+L}_{r}^{p} & \omega_{r}L_{r} \\ -\omega_{r}L_{m} & L_{m}^{p} & -\omega_{r}L_{r} & R_{r}^{+L}_{r}^{p} \end{vmatrix} \begin{vmatrix} i_{AS} \\ i_{BS} \\ i_{Ar} \\ 1i_{Br} \end{vmatrix}$$
(8)

The commonly used torque equation is

$$T = pL_{m} \left(i_{RS} i_{Ar} - i_{AS} i_{Rr} \right) \tag{9}$$

Equations (8) and (9) are the mathematical model for simulation of the two-phase machine. Equation (8) can be changed to the form

$$\begin{vmatrix} V_{AS} \\ V_{BS} \\ 0 \end{vmatrix} = \begin{vmatrix} R_{S} & 0 & 0 & 0 \\ 0 & R_{S} & 0 & 0 \\ 0 & 0 & R_{r} & 0 \end{vmatrix} \begin{vmatrix} i_{AS} \\ i_{BS} \\ i_{Ar} \\ 0 \end{vmatrix} + \begin{vmatrix} L_{1S}^{+}L_{m} & 0 & L_{m} & 0 \\ 0 & L_{1s}^{+}L_{m} & 0 & L_{m} \\ 0 & L_{1r}^{+}L_{m} & 0 & i_{Ar}^{+} \\ 0 & L_{m} & 0 & L_{1r}^{+}L_{m} & 0 & i_{Br}^{+} \end{vmatrix}$$

where

$$L_S \triangleq L_{1S} + L_m$$

$$L_r \triangleq L_{1r} + L_m$$

Then, (10) may be written

$$\begin{vmatrix} i_{AS} \\ i_{BS} \\ i_{Ar} \\ i_{Br} \end{vmatrix} = \frac{1}{L_{S}L_{r} - L_{m}^{2}} \begin{vmatrix} L_{r} & 0 & -L_{m} & 0 \\ 0 & L_{r} & 0 & -L_{m} \\ -L_{m} & 0 & L_{S} & 0 \\ 0 & -L_{m} & 0 & L_{S} \end{vmatrix} \begin{vmatrix} V_{AS} \\ V_{BS} \\ V_{Ar}^{*}(0) \\ V_{Br}^{*}(0) \end{vmatrix}$$

$$-\frac{1}{L_{S}L_{r} - L_{m}^{2}} \begin{vmatrix} L_{r}R_{s} & -L_{m}^{2}\omega_{r} & -L_{m}R_{r} & -L_{m}L_{r}\omega_{r} \\ -L_{m}R_{s} & L_{S}L_{m}\omega_{r} & L_{S}R_{r} & L_{S}L_{r}\omega_{r} \\ -L_{S}L_{m}\omega_{r} & -L_{m}R_{s} & -L_{S}L_{r}\omega_{r} & L_{S}R_{r} \end{vmatrix} \begin{vmatrix} i_{BS} \\ i_{Ar} \\ i_{Br} \end{vmatrix}$$

$$(11)$$

200

$$i_{AS} = \frac{1}{L_{S}L_{r} - L_{m}^{2}} (L_{r}V_{AS} - L_{r}R_{S}i_{AS} + L_{m}^{2}\omega_{r}i_{BS} + L_{m}R_{r}i_{Ar} + L_{m}L_{r}\omega_{r}i_{Br})$$

$$i_{BS} = \frac{1}{L_{S}L_{r} - L_{m}^{2}} (L_{r}V_{BS} - \omega_{r}L_{m}^{2}i_{AS} - L_{r}R_{S}i_{BS} - L_{m}L_{r}\omega_{r}i_{Ar} + L_{m}R_{r}i_{Br})$$

$$i_{Ar}^{i} = \frac{1}{L_{S}L_{r} - L_{m}^{2}} (-L_{m}V_{AS} + L_{m}R_{S}i_{AS} - L_{S}L_{m}\omega_{r}i_{BS} - L_{S}R_{r}i_{Ar} - L_{S}L_{r}\omega_{r}i_{Br})$$

$$i_{Br}^{i} = \frac{1}{L_{S}L_{r} - L_{m}^{2}} (-L_{m}V_{BS} + L_{S}L_{m}\omega_{r}i_{AS} + L_{m}R_{S}i_{BS} + L_{S}L_{r}\omega_{r}i_{Ar} - L_{S}R_{r}i_{Br})$$

Let

$$A_{22} \triangleq L_{S}/A_{50}$$

$$A_{41} = (A_{31} \ l_{BS} + A_{26} \ l_{Br}) \times \omega_{r}$$

$$A_{26} = 2\pi L_{r}$$

$$A_{42} = (A_{31} \ l_{AS} + A_{26} \ l_{Ar}) \times \omega_{r}$$

$$A_{31} = 2\pi L_{m}$$

$$A_{47} = A_{42} - R_{r} l_{Br}$$

$$A_{36} = L_{r}/A_{50}$$

$$A_{50} = L_{S}L_{r} - L_{m}^{2}$$

$$A_{50} = L_{S}L_{r} - R_{r} l_{Br}$$

$$A_{50} = L_{S}L_{r} - R_{r} l_{Br}$$

$$A_{50} = L_{S}L_{r} - R_{r} l_{Br}$$

$$A_{61} = -A_{41} - R_{r} l_{Ar}$$

$$A_{61} = -A_{41} - R_{r} l_{Ar}$$

Therefore

$$i_{AS} = A_{40} \times A_{36} - A_{61} \times A_{38} \triangleq \times (1)$$
 $i_{BS} = A_{53} \times A_{36} - A_{47} \times A_{38} \triangleq \times (4)$
 $i_{Ar} = A_{61} \times A_{22} - A_{40} \times A_{38} \triangleq \times (2)$
 $i_{Br} = A_{47} \times A_{22} - A_{53} \times A_{38} \triangleq \times (3)$

$$T = PL_{m} (i_{BS} i_{Ar} - i_{AS} i_{Br}) = A_{39} (i_{BS} i_{Ar} - i_{AS} i_{Br}) = A_{83}$$

The simulation diagram for (12) is shown in Fig. G-3.

The following sections of this appendix include simulation programs and results for different operating points, using the mathematical model of (12).

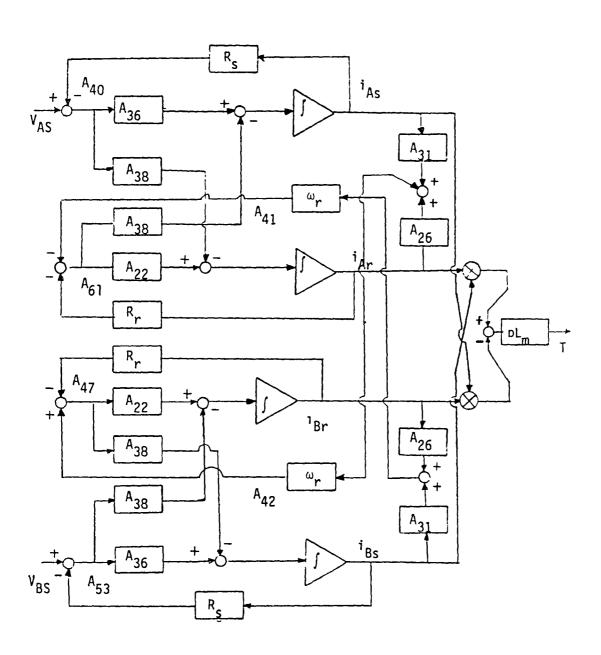


Fig. G-3 Simulation diagram of two-phase induction motor

G.2 TWO-PHASE SIMULATION RESULTS FOR 10% SPEED, 16 KW

Source Program

Plots

Stator Voltage

Stator Current

Output Power

Current Spectrum

Power Spectrum

Partial Listing of Plot Data

```
JOB (XXXXLH), 'GOODARZI',
//LS
// PASSHORD=XXXX
/*JOBPARM
             T=5.L=6
//*ROUTE PRINT UMVMA.R12
    EXEC
          WATFIV
//GO.SYSIN DD *
$J0B
             ,NOLIST,T=(5,0)
C
C
               10% SPEED, 16KH JPL PROJECT
C
DIMENSION AR1(800), AR2(800), AR3(800), Y(20), X(20), GA(20), PE(20),
             XX(4,20),H(9),ZZ1(20),ZZ2(20),ZZ3(20),IFL(7),AR4(800),
    1
              AR5(800), AR6(800), AR7(800), AR8(800)
     LOGICAL*1 LR1(800), LR2(800), LR3(800), LR4(800), LR5(800), LR6(800),
    1
             LR7(800), LR8(800)
     REAL LOS, LOR, LM, IAS, IBS, ICS, IAR, IBR, ICR, IDS, IQS, IDR, IQR, LMDQ, INS,
         POUT, IAREF, IBREF, L1, L2, M, IMAX, IMAGD, IMAGQ, IBU,
    1
         MAG1(512), MAG2(512)
     COMPLEX F1(512),F2(512)
     WRITE(6,50)
  50 FORMAT(/,3x,'TIME',8x,'VDS',8x,'IDS',8x,'VQS',8x,'IQS',8x,
            'IDR',9X,'POUT')
     IMAX=205.
     SLIP=.085
     E=240.
     DI=40
     NRUN=1
     ISTOP=0
     KEEP=1
     IFL(1)=-1
     NINT=7
     IFNT1=0
     IPNT2=0
     TENTS:0
     IPNT4=0
     IPNT5=0
     IPNT6=0
     IPNT7=0
  C
     PARAMETERS FOR TWOPHASE INDUCTION MOTOR
     LOS=.2256E-03
     LOR=.2410E-03
     LM=6.5100E-03
     RS=.0274
     RR=.0213
     PAI=3.141593
     P=1.
     FREQ=20.
     OMEGA=2*PAI*FREQ
     OMEGR=OMEGA*(1.-SLIP)
     L1=L0S+LM
     L2=L0R+LM
```

```
M=LM
      FACT=1./(L1*L2-H*H)
      FACT1=L2*FACT
      FACT2=L2*RS*FACT
      FACT22=L1*RR*FACT
      FACT3=M*M*OMEGR*FACT
      FACT4=M*L2*OMEGR*FACT
      FACT44=M*L1*ONEGR*FACT
      FACTS=M*RR*FACT
      FACT55=M*RS*FACT
      FACT6=M*FACT
      FACT7=L1*L2*OMEGR*FACT
    1 IFL(2)=-1
    2 CALL RKFOUR(NINT, Y, X, GA, PE, XX, H, ZZ1, ZZ2, ZZ3, TIME, PNTS, KEEP, IFL)
      IF(IFL(4))3,4,5
    3 INIT=1
      TIME1=-1
      NC=1
      NCC=1
      TIME=0.
      FINTIM=2.0500
      PTMAX=800.
      Y(1)=0.
      Y(2)=0.
      Y(3)=0.
      Y(4)=0.
      Y(5)=0.0
      Y(6)=0.0
      Y(7)=0.0
      AREAIN=0.0
      ARADUT=0.0
      H(1)=0.2000E-04
      H(7) = -1
      VDS=0.0
      VQS=0.0
      IN=0
      SUM=0.
      SUM1=0.
      NUMBER=0.
      SW=0.0
      SWITCH=0.0
      PSW=0.0
      TOTSW=0.0
      IAE=-1
      IBE=-1
      DO 33 I=1,512
      F1(I)=(0.0,0.0)
      F2(I)=(0.0,0.0)
  33 CONTINUE
    4 IF(TIME-TIME1)7,8,7
    7 TIME1=TIME
C
      DEG=FREQ*TIME
      IDEG=DEG
```

X(5)=LM*(Y(2)*Y(3)-Y(1)*Y(4))*OMEGR/.15

X(6)=(Y(1)*VDS+Y(2)*VQS)/.15

X(7)=Y(1)*Y(1)/.15

HATFIV A UNIVERSITY OF MISSOURI COMPUTER NETWORK

FILE: LS

```
C
      60TO 2
    5 IPR=0
      NC=NC-1
      IF(NC)9,9,10
    9 NC=HCC
      IPR=1
   10 IF(TIME.GE.FINTIM) ISTOP=1
      IF((IPR+ISTOP).EQ.0) GOTO 11
C
      IF(TIME.LT.2.0000)GOTO 11
      IDS=Y(1)
      IQS=Y(2)
      IDR=Y(3)
      IQR=Y(4)
С
      IMAGD=IDS+IDR
      IMAGQ=IQS+IQR
С
      TQ=LM*(IQS*IDR-IDS*IQR)
      POUT=TQ*OHEGR
C
      PIN=IDS*VDS+IQS*VQS
      SUM1=SUM1+PIN
      SUM=SUM+POUT
C
¢
      NUMBER=NUMBER+1.
      IF(TIME.LT.2.00) GOTO 38
      IN=IN+1
C
      F1(IN)=CMPLX(Y(1),0.0)
      F2(IN)=CHPLX(POUT.0.0)
  38 CONTINUE
      WRITE(6,250)DEG,IDS,VDS,POUT
      IF(TIME.LT.2.00035) POUT=0.0
      CALL FPLOT(800, IPNT1, AR1, LR1, ISTOP, 1, 1, TIME, IDS)
      CALL FPLOT(800, IPNT2, AR2, LR2, ISTOP, 1, 1, TIME, VDS)
      CALL FPLOT(800, IPHT4, AR4, LR4, ISTOP, 1,2, TIME, IQS)
      CALL FPLOT(800, IPNT4, AR4, LR4, ISTOP, 2, 2, TIME, VQS)
      CALL FPLOT(800, IPNT3, AR3, LR3, ISTOP, 1, 2, TIME, IMAGD)
C
      CALL FPLOT(800, IPNT3, AR3, LR3, ISTOP, 2, 2, TIME, IDR)
      CALL FPLOT(800, IPNT3, AR3, LR3, ISTOP, 1, 1, TIME, POUT)
   11 INIT=0
      IF(ISTOP)1,1,6
    6 CONTINUE
  250 FORMAT(' ',1X,F6.1,3(F9.1,2X))
      AVER=SUM/NUMBER
      AVER1=SUM1/NUMBER
C
¢
      EFF=AVER/AVER1
      PIN=Y(6)-AREAIN
      POUT=Y(5)-ARAOUT
      RHS=(Y(7)-ARMS)**0.5
      ***********************
      NOTE .7 IS THE VOLTAGE DROP ACROSS THE DIODE
      1.85 IS THE CE VOLTAGE OF THE TRANSISTOR
      SHITCH IS THE # OF INTERVAL OF THE SHITCHING (DIODE CONDUCTION)
C
      TOTSW IS TOTOAL # OF INTEGRATION INTERVALS
```


1 + no

```
PDIODE IS THE LOSS OF DIODE DURING CONDUCTION
C
C
      PTPANS IS THE ON TIME LOSS OF THE TRANSISTOR
C
      PSW IS THE SWITCHING LOSS OF EACH TRANSISTOR (E*I*TSW/T)
      TOTSL IS THE TOTAL LOSS OF THE SWITCH
C
C
       ********************************
      PDIODE=(SHITCH/TOTSH)*0.7*IMAX/PAI
      PTRANS=(1-SWITCH/TOTSW)*1.85*IMAX/PAI
      TOTSL=PDIODE+PTRANS+PSW
      TOT4SL=4*TOTSL
      DTRIO=SWITCH/TOTSW
      EFFIO=POUT/(TOT4SL+PIN)
C
      WRITE(6,702)POUT, EFFIO, SLIP, IMAX, DTRIO, RMS
      WRITE(6,703)SW, PSW, PTRANS, PDIODE, TOT4SL, IN
  702 FORMAT(///, ' POHER OUT=',F8.1,2X,'EFFIO=',F5.3,2X,'SLIP=',
     1F7.5,2X,'IMAX=',F6.1,2X,'DTRIO=',F7.1,2X,'I(RMS)=',F6.2,///)
  703 FORMAT(/, '#SW/CYC=', F5.1, 8X, 'PSW=', F6.1, 3X, 'PTRANS=', F5.1,
     1 2X, 'PDIODE=',F4.1,2X, 'TOT4SL=',F6.1,5X, 'IN=',15,/////)
      WRITE(6,705)
 705 FORMAT('1',3X,'Z',9X,'I HARMONIC ',9X,'P HARMONIC',//)
C706 FORMAT(2X,F5.1,5X,F12.8,5X,F15.8)
      ISTOP=0.0
CC
      CALL FFT(F1,9)
CC
      CALL FFT(F2,9)
CC
      DO 401 I=1,150
CC
      MAG1(I)=CABS(F1(I))/512.
CC
      MAG2(I)=CABS(F2(I))/512.
CC
      Z=FLOAT(I-1)
CC
      IF (I.EQ.1) MAG1(2)=270.
CC
      AMP1=MAG1(I)/MAG1(2)
CC
      AHP2=MAG2(I)/MAG2(I)
Ċ
      WRITE(6,706) Z,AMP1,AMP2
CC
      IF(I.EQ.150) ISTOP=1
C
      CALL FPLOT(800, IPNT5, AR5, LR5, ISTOP, 1, 1, Z, AMP1)
      CALL FPLOT(800, IPNT6, AR6, LR6, ISTOP, 1, 1, Z, AMP2)
CC401 CONTINUE
      STOP
      END
       SUBROUTINE FFT(X.M)
       COMPLEX X(512),U,W,T
       H=2××H
       NV2=N/2
       NM1=N-1
       J=1
       DO 7 I=1,NM1
       IF(I.GT.J) 60T0 5
       T=X(J)
       X(J)=X(I)
       X(I)=T
       K=NV2
       IF(K.GE.J)60 TO 7
       J=J-K
       K=K/2
       GO TO 6
```


```
7 J=J+K
         PI=3.14159265358979
         DO 20 L=1,M
LE=2**L
         LE1=LE/2
         U=(1.0,0.0)
Z=COS(PI/FLOAT(LE1))
         Y=-SIN(PI/FLOAT(LE1))
         W=CMPLX(Z,Y)
         DO 20 J=1,LE1
         DO 10 I=J,N,LE
         IP=I+LE1
         T=X(IP)*U
         X(IP)=X(I)-T
 10
         X(I)=X(I)+T
         U=U*W
 20
         RETURN
         END
$ENTRY
                CURRENT OF PHASE A STATOR VOLTAGE OF PHASE A
1
                POWER VS TIME
CURRENT FREQUENCY SPECTRUM
POWER FREQUENCY SPECTRUM
1
           P
1
           I
$STOP
/*
//
```

1


STATOR VOLTAGE (10% SPEED,16KW)

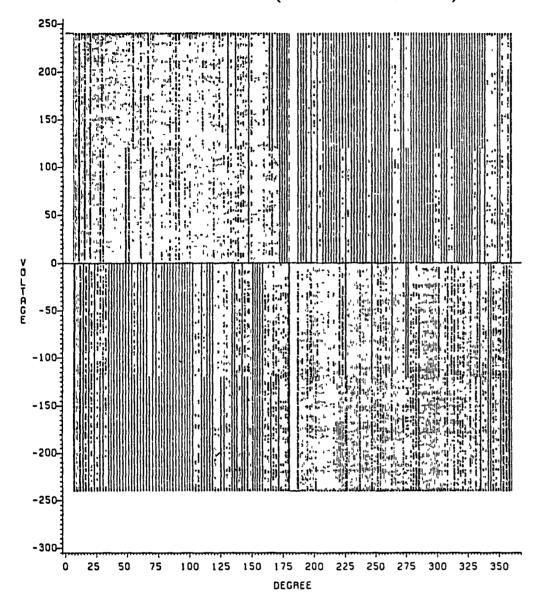


STATOR CURRENT (10% SPEED,16 KW)

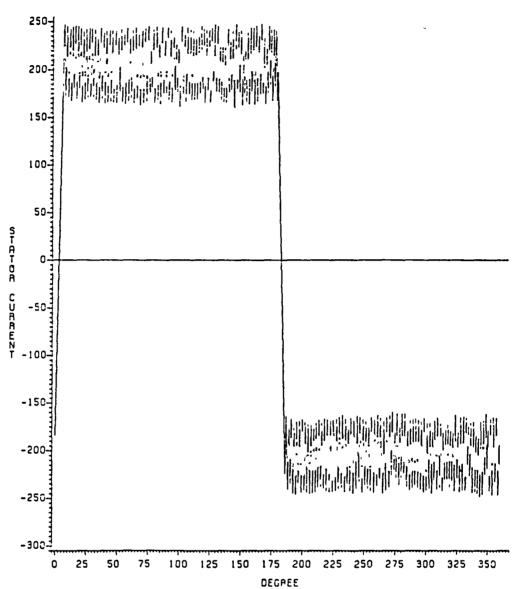


OUTPUT POWER (10% SPEED,16KW)

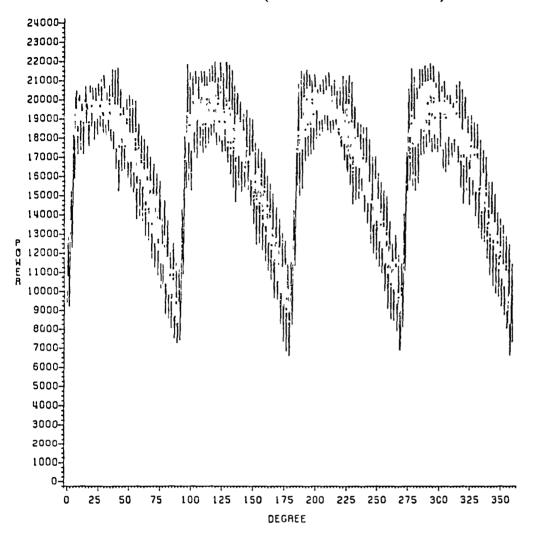

CURRENT SPECTRUM (10% SPEED.16 KW)

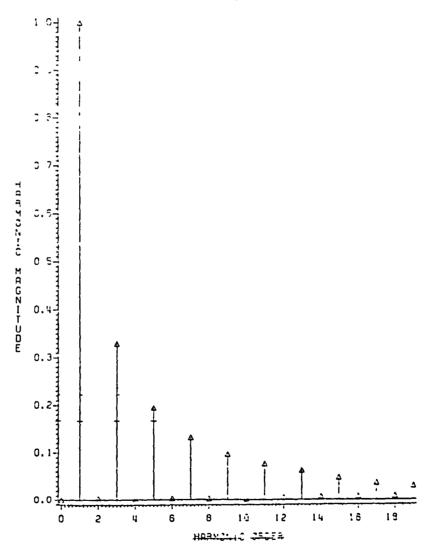

POWER SPECTRUM (10% SPEED, 16KW)

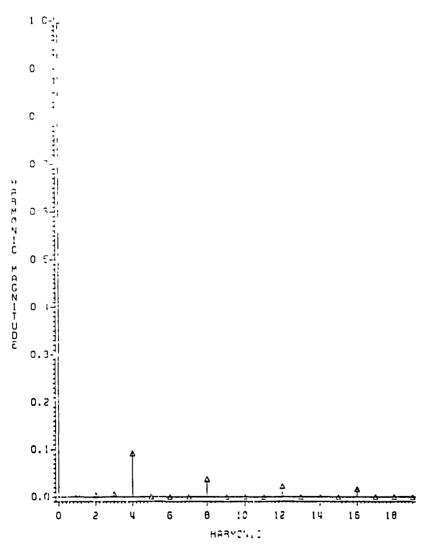

```
//PLOTES JOB (XXXXLH), 'GOODARZI',
// PASSWORD=XXXX
/*JOBPARM R=900,B=99000
// EXEC PLOTSAS
//SYSIN DD *
*******************************
             10% SPEED 16KW JPL PROJECT
             PLOT DATA
* DEGREE CURRENT
                   VOLTAGE
                             POWER
**************
         GOPTIONS DEVICE=VARIAN;
         DATA ONE:
         INPUT X Y1-Y3;
CARDS
                    240.0
                             9429.2
         -184.3
   0.1
   0.4
         -164.8
                    240.0
                             10725.8
                             12025.3
         -145.3
                    240.0
   0.6
         -126.0
                             12876.4
                    240.0
   0.9
   1.2
         -106.7
                    240.0
                             11486.5
                             10119.5
   1.5
         -87.6
                    240.0
                             9224.4
   1.8
          -68.5
                    240.0
   2.0
          -49.6
                    240.0
                             10584.4
          -30.8
                    240.0
                             11946.4
   2.3
    2.6
          -12.1
                    240.0
                             13310.3
   3.0
          14.2
                    240.0
                             15241.9
          32.7
                    240.0
                             14390.6
   3.3
   3.6
          51.0
                    240.0
                             13116.9
                    240.0
   3.9
          69.3
                             12308.7
   4.1
          87.5
                    240.0
                             13723.0
   4.4
          105.5
                    240.0
                             15138.2
   4.7
          123.5
                    240.0
                             16553.9
   5.1
          148.7
                    240.0
                             18556.9
   5.4
          166.4
                    240.0
                             17790.5
                             16608.7
   5.7
          184.0
                    240.0
   5.9
          201.6
                    240.0
                             15884.9
                             17345.3
                    240.0
   6.2
          219.0
   6.5
          236.3
                   240.0
                             18805.1
   6.8
          246.6
                   -240.0
                             20059.5
   7.1
          221.9
                   -240.0
                             20278.0
   7.4
          197.4
                   -240.0
                             20476.7
                   -240.0
   7.6
          172.9
                             20227.3
   7.9
          183.4
                   240.0
                             18895.5
   8.2
          200.7
                    240.0
                             17797.6
                    240.0
   8.5
          217.9
                             17147.4
   8.8
          235.0
                    240.0
                             18629.2
   9.0
          245.1
                   -240.0
                             19888.2
   9.3
                   -240.0
          220.3
                             20028.4
   9.6
          195.5
                   -240.0
                             20148.9
   9.9
                   -240.0
          170.9
                             20249.9
                             19392.7
  10.2
          181.1
                   240.0
   10.5
          198.2
                    240.0
                             18367.0
                   240.0
  10.7
                             17363.8
          215.3
  11.0
          232.2
                   240.0
                            18449.1
  11.3
          242.1
                   -240.0
                            19709.7
```

i

FILE: LSPPLOT WATFIV A UNIVERSITY OF HISSOURI COMPUTER NETWORK

11.6	217.1	-240.0	19770.4
11.9	192.1	-240.0	19811.7
12.1	167.3	-240.0	19833.7
12.4	177.4	240.0	19028.3
12.7	194.3	240.0	18080.2
13.0	211.2	240.0	17154.6
13.3	227.9	240.0	18265.2
13.6	244.6	240.0	19777.7
13.8	226.3	-240.0	20012 9
14.1	201.2	-240.0	19975.6
14.4	176.1	-240.0	19919 0
14.7	185.9	240.0	20750.0
15.0	202.7	240.0	19869.6
15.2	219.3	240.0	19011.5
15 5	235.8	240.0	18567.9
15.8	245.3	-240.0	19823.9
16.1	219.9	-240 0	19724.2
16.4	194.6	-240 0	19605 5
16.6	169.4	-240.0	19467.9
16.9	179.0	240.0	18766 9
17.2	195.6	240.0	17975 6
17.5	212.1	240.0	17588.6
17.8	228 5	240.0	19119.3
18.1	244.8	240.0	20645.3
18.3	226.1	-240.0	20742.3
18.6	200.6	-240.0	20536.9
18.9	175.2	-240.0	20312.8
19.2	184.7	240.0	19658.1
19.5	201.0	240.0	18939.4
19.7	217.3	240 0	18242.4
20.0	233.5	240.0	19408.4
20.3	242.6	-240.0	20641.3
20.6	216.9	-240.0	20371.6
20.9	191.2	-240.0	20083.4
21.2	165.6	-240.0	19776.9
21.4	175.0	240.0	19173.0
21.7	191.2	240.0	18531.4
22.0	207.3	240.0	17911.2
22.3	223.4	240.0	19091.0
22.6	239.4	240.0	20622.7
22.8	220.4	-240.0	20582.2
23.1	194.6	-240.0	20211.5
23.4	168.8	-240.0	19822.9
23.7	178.0	240.0	19269 9
24.0	194.0	240.0	18705.7
24.3	210.0	240.0	18162.5
24.5	225.9	240.0	19353.9
24.8	241.7	240.0	20883.5
25.1	222.5	-240.0	20772.9
25.4	196.5	-240.0	20319.0
25.7	170.6	-240.0	19847.5
25.9	179.6	240.0	19345.0
26.2	195.5	240.0	18857.4
26.5	211.3	240.0	18390.6
26.8	227.0	240.0	19590.5

FILE: LSPPLOT MATFIV A UNIVERSITY OF MISSOURI COMPUTER NETWORK

```
27.1
        242.6
                    240.0
                              21114.3
                   -240.0
                              20932.6
27.3
        223.3
27.6
        197.2
                   -240.0
                              20395.0
27.9
                              19517.4
        171.1
                   -240.0
                    240.0
                              18747.8
28.2
        179.9
28.5
        195.7
                    240.0
                              18342.1
                              18274.2
28.8
        211.3
                    240.0
                    240.0
                              19796 9
29.0
        226.9
29.3
        242.3
                    240.0
                              21311.4
29.6
        222.9
                   -240.0
                              21057.7
29.9
        196.6
                   -240.0
                              20436.0
        170.4
                   -240.0
                              19488.9
30.2
30.4
        179.0
                    240.0
                              18782.5
30.7
        194.6
                    240.0
                              18451.9
                    240.0
                              18141.3
        210.1
31.0
                    240.0
                              19354.8
31.3
        225.6
31.6
        240.9
                    240.0
                              20862.5
                              20541.9
                   -240.0
        221.3
31.8
32.1
        194.9
                   -240.0
                              19841.8
32.4
        168.5
                   -240.0
                              19125.3
        177.1
                    240.0
                              18775.6
32.7
33.0
        192.5
                    240.0
                              18519.2
        207.9
33.3
                    240.0
                              18282.4
                    240.0
                              19495.2
33.5
        223.2
                    240.0
                              20986.8
33.8
        238.4
                              20592.9
        218.7
                   -240.0
34.1
34.4
        192.1
                   -240.0
                              19808.4
                              18729.2
34.7
        165.6
                   -240.0
                    240.0
34.9
        174.1
                              18154.0
35.2
        189.4
                    240.0
                              17976.7
35.5
        204.6
                    240.0
                              17818.6
                              19033.6
35.8
        219.8
                    240.0
36.1
        234.9
                    240.0
                              20511.6
36.4
        243.0
                   -240.0
                              21592.9
36.6
        216.1
                   -240.0
                              20728.4
        189.4
                   -240.0
                              19585.0
36.9
37.2
        169.8
                    240.0
                              17517.2
37.5
        185.0
                    240.0
                              17418.1
37.8
        200.1
                    240.0
                              17595.1
38.0
        215.2
                    240.0
                              19061.1
38.3
        230.2
                    240.0
                              20516.4
38.6
        238.2
                   -240.0
                              21564.1
38.9
        211.2
                   -240.0
                              20615.2
        184.4
                   -240.0
39.2
                              18415.1
39.5
        164.7
                    240.0
                              16380.2
39.7
        179.8
                    240.0
                              16363.8
40.0
        194.9
                    240.0
                              17572.0
        209.8
                    240.0
40.3
                              19012.7
40.6
        224.7
                    240.0
                              20442.1
                    240.0
40.9
        239.6
                              21860.2
                   -240.0
41.1
                              20066.5
        219.5
41.4
        192.5
                   -240.0
                              17645.8
        165.6
                   -240.0
                              15240.1
41.7
42.0
        173.7
                    240.0
                              16036.4
42.3
        188.7
                    240.0
                              17460.4
```

53.2 53.5

53.8

54.1

54.4

54.7

54.9

55 2

55.5

55.8

56.1

56.3

56.6

56.9

57.2

57.5

57.7

166.8

174.4

188.9

203.4

217.7

232.1

239.3

211.8

184.3

163.9

178.4

192.8

207.2

221.5

235.8

242.9

-240.0

240.0

240.0

240.0

240.0

240.0

-240.0

-240.0

-240.0

240.0

240.0

240.0

240.0

240.0

240.0

-240.0

15187.1

15162.9

15602.2

16721.9

17962.5

19188.5

19946.9

17808.1

15561.1

13787.5

14420.9

15639.9

16843.9

18032.8

18663.3

18738.1

FILE: LSPPLOT WATFIV A UNIVERSITY OF MISSOURI COMPUTER NETWORK

58.0	215.3	-240.0	16643.1
58.3	187.8	-240.0	15071.4
58.6	167.3	240.0	13950.0
58.9	181.7	240 0	15114.6
59.2	196.1	240.0	16263.9
59.4	210.4	240.0	
59. 4 59.7			16933.3
	224.6	240.0	17520.7
60.0	238.8	240.0	18121.2
60.3	218.1	-240.0	16509.8
60.6	190.5	-240.0	14869.4
60.8	170.0	240.0	13684 0
61.1	184.3	240.0	14804.2
61.4	198.7	240.0	15908.6
61.7	212.9	240.0	16623.4
62.0	227.1	240.0	17273.6
62.3	241.2	240.0	17936.3
62.5	220.4	-240.0	16351.2
62.8	192.8	-240.0	14643.3
63.1	165.3	-240.0	12927.2
63.4	172.7	240.0	13536.2
63.7	187.0	240.0	14596.3
63.9	201.3	240.0	15357.6
64.2	215.5	240.0	16071.8
64.5	229.6	240.0	16797.7
64.8	243.7	240.0	17584.9
65.1	222.9	-240.0	16272.8
65.4	195.2	-240.0	14483.9
65.6		-240.0	
	167.6		12687.6
65.9	175.0	240.0	13190 5
66.2	189.3	240.0	13960.5
66 5	203.5	240.0	14741.6
66.8	217.7	240.0	15533 6
67.0	231.8	240.0	16493.3
67.3	238.9	-240.0	16998.4
67.6	211.1	-240.0	15136.6
67.9	183.5	-240.0	13243.6
68.2	162.9	240.0	11709.8
68.5	177.2	240.0	12549.6
68.7	191.5	240.0	13399.8
69.0	205.7	240.0	14336.7
69.3	219.9	240.0	15274.1
69.6	233.9	240.0	16194.4
69.9	241.0	-240.0	16616.5
70.1	213.2	-240.0	14638.9
70.4	185.5	-240.0	12682.5
70.7	165.0	240.0	11220.4
71.0	179.3	240.0	12133.1
71.3	193.5	240.0	13030.0
71.5	207.7	240.0	13909.7
71.8	221.9		
		240.0	14779.9
72.1	235.9	240.0	15687.0
72.4	243.0	-240.0	16130.0
72.7	215.2	-240.0	14223.4
73.0	187.5	-240.0	12321.3
73.2	166.9	240.0	10813.7

FILE: LSPPLOT WATFIV A UNIVERSITY OF MISSOURI COMPUTER NETWORK

73.5	181.2	240.0	11659.6
73.8	195.5	240.0	12488.1
74.1	209.7	240.0	13325.2
74.4	223.8	240.0	14290.8
74.6	237.9	240.0	15265.0
74.9	244.9	-240.0	15774.6
75.2	217.2	-240.0	13759.3
75.5	189.5	-240.0	11706 8
75.8	168.9	240.0	10123.0
76.1	183.2	240.0	10932.5
76.3	197.5	240.0	11950.6
76.6	211.7	240.0	12976.6
76.9	225.8	240.0	14010.3
77.2	205.1	-240.0	12438 5
77.5	177.5	-240.0	10341.8
77.7	184.8	240.0	10596.5
78 0	199.1	240.0	11596.1
78.3	213.3	240.0	12659.1
78.6	227.5	240.0	13729.3
78.9	241.6	240.0	14741.3
79.1	220.8	-240.0	13070 5
79.4	193.1	-240.0	10926.0
79.7	165.6	-240.0	8778.8
80.0	173.0	240.0	9049.0
80.3	187.4	240.0	10157.1
80.6	201.7	240.0	11271.8
80.8	215.9	240.0	12392.8
81.1	230.1	240.0	13104.1
81.4	244.2	240.0	13716.0
81.7	223.5	-240.0	11973.1
82.0	195.8	-240.0	10210.1
82.2	168.3	-240.0	8557.5
82.5	175.8	240.0	9258. 8
82.8	190.2	240.0	10336.2
83.1	204.5	240.0	10920.4
83.4	218.8	240.0	11486.3
83.6	233.0	240.0	12033.9
83.9	212.3	-240.0	10770.6
84.2	184.8	-240.0	9168.2
84.5	164.4	240.0	8052.6
84.8	178.8	240.0	9157.0
85.1	193.2	240.0	9689.1
85.3	207.6	240.0	10202.8
85.6	221.9	240.0	10698.1
85.9	236.2	240.0	11782.5
86.2	243.4	-240.0	12529.6
86.5	215.8	-240.0	10985.4
86.7	188.3	-240.0	9335.4
87.0	167.9	240.0	7512.7
87.3	182.4	240.0	7977.9
87.6	196.9	240.0	8424.7
87.9	211.3	240.0	8990.4
88.2	225.7	240.0	10237.1
88.4	240.0	240.0	11487.9
88.7	219.4	-240.0	10463.3

G.3 TWO-PHASE SIMULATION RESULTS FOR 80% SPEED, 60 KW

Source Program

Plots

Stator Voltage and Current

Output Power

Current Spectrum

Power Spectrum

Listing of Plot Data

```
JOB (XXXXLH), 'GOODARZI',
//OPTIM
// PASSWORD=????
            T=4.L=6
/#JOBPARM
//HROUTE PRINT UNVMA. EEPRI
     EXEC
          WATFIV
//GO.SYSIN DD #
$J0B
C
           80% SPEED 60KM JPL PROJECT
DIMENSION AR1(800), AR2(800), AR3(800), Y(20), X(20), GA(20), PE(20),
             XX(4,20),H(9),ZZ1(20),ZZ2(20),ZZ3(20),IFL(7),AR4(800),
             AR5(800),AR6(800),AR7(800),AR8(800)
    2
     LOGICAL*1 LR1(800), LR2(800), LR3(800), LR4(800), LR5(800), LR6(800),
             LR7(800), LR8(800)
    1
     COMPLEX F1(512), F2(512)
     REAL LOS, LOR, LM, IAS, IBS, ICS, IAR, IBR, ICR, IDS, IQS, IDR, IQR, LMDQ, INS,
         POUT, IAREF, IBREF, L1, L2, M, IMAX, IMAGD, IMAGQ, IBU,
             MAG1(256), MAG2(256)
     IMAX=245
     DI=15.0
     SLIP=0.02
     WRITE(6,50)
 50 FORMAT(/,3X,'TIME',8X,'VDS',8X,'IDS',8X,'VQS',8X,'IQS',8X,
4 'IDR',9X,'POUT')
     NRUN=1
     ISTOP=0
     KEEP=1
     IFL(1)=-1
     NINT=7
     IPNT1=0
     IPNT2=0
     IPNT3=0
     IPNT4=0
     IPNT5=0
     IPNT6=0
     IPNT7=0
     E=240.
  PARAMETERS FOR THOPHASE INDUCTION MOTOR
C
  ************************************
     L05=.2940E-03
     LOR=.3230E-03
     LM=26.800E-03
     RS=.0274
     RR=.0213
     PAI=3.141593
     P=1.
     FREQ=160.
     OMEGA=2.0*PAI*FREQ
     OMEGR=OMEGA*(1.-SLIP)
     L1=L0S+LM
     L2=LOR+LM
```

```
M=LM
      FACT=1./(LI*L2-M*M)
      FACT1=L2*FACT
      FACT2=L2*R5*FACT
      FACT22=L1*RR*FACT
      FACT3=M*M*OMEGR*FACT
      FACT4=M*L2*OMEGR*FACT
      FACT44=M*L1*OMEGR*FACT
      FACTS=M*RR*FACT
      FACT55=M*RS*FACT
      FACT6=M*FACT
      FACT7=L1*L2*OMEGR*FACT
    1 IFL(2)=-1
    2 CALL RKFOUR(NINT, Y, X, GA, PE, XX, H, ZZ1, ZZ2, ZZ3, TIME, PMTS, KEEP, IFL)
      IF(IFL(4))3,4,5
    3 INIT=1
      TIME1=-1
      NC=1
      NCC=1
      TIME=0.
      FINTIM=0.2500
      PTHAX=800.
      Y(1)=0.
      Y(2)=0.
      Y(3)=0.
      Y(4)=0.
      Y(5)=0.0
      Y(6)=0.0
      Y(7)=0.0
C
      AREAIN=0.0
      ARAOUT=0.0
      H(1)=.050E-04
C
      H(7) = -1
      VDS=0.0
      VQ5=0.0
      SUM=0.
      IN=0
      SUM1=0.
      NUMBER=0.
      SW=0.0
      DI1=DI
      SWITCH=0.0
      PSW=0.0
      TOTSW=0.0
      IAE=-1
      IBE=-1
      DO 61 I=1,256
      F1(I)=(0.0,0.0)
      F2(I)=(0.0,0.0)
61
     CONTINUE
C
    4 IF(TIME-TIME1)7,8,7
    7 TIME1=TIME
C
      DEG=FREQ*TIME
```

X(1)=FACT1*VDS-FACT2*Y(1)+FACT3*Y(2)+FACT4*Y(4)+FACT5*Y(3)
X(2)=FACT1*VQS-FACT2*Y(2)-FACT3*Y(1)-FACT4*Y(3)+FACT5*Y(4)

FILE: OPTIM MATFIY A UNIVERSITY OF MISSOURI COMPUTER NETWORK


```
X(3)=-FACT6*VDS+FACT55*Y(1)-FACT44*Y(2)-FACT7*Y(4)-FACT22*Y(3)
      X(4)=-FACT6*VQS+FACT55*Y(2)+FACT44*Y(1)+FACT7*Y(3)-FACT22*Y(4)
      X(5)=LM*(Y(2)*Y(3)-Y(1)*Y(4))*OMEGR/.01875
      X(6)=(Y(1)*VDS+Y(2)*VQS)/.01875
      X(7)=Y(1)*Y(1)/.01875
C
      60TO 2
    5 IPR=0
      NC=NC-1
      IF(NC)9,9,10
    9 NC=NCC
      IPR=1
   10 IF(TIME.GE.FINTIM) ISTOP=1
      IF((IPR+ISTOP).EQ.0) GOTO 11
C
      IF(TIME.LT.0.23125) GOTO 11
      IDS=Y(1)
      IQS=Y(2)
      IDR=Y(3)
      IQR=Y(4)
C
      IMAGD=IDS+IDR
      IMAGQ=IQS+IQR
C
      TQ=LM*(IQS*IDR-IDS*IQR)
      POUT=TQ*OMEGR
C
      PIN=IDS*VDS+IQS*VQS
C
      SUM1=SUM1+PIN
C
      SUM=SUM+POUT
C
      NUMBER=NUMBER+1.
      IF(TIME.LT.0.24375) GOTO 31
       IN=IN+1
       F1(IN)=CMPLX(Y(1),0.0)
CC
CC
       F2(IN)=CMPLX(POUT,0.0)
 31
       CONTINUE
      WRITE(6,250)DEG,IDS,VDS,POUT
C
      IF(TIME.LT.0.19250) POUT=0.0
      CALL FPLOT(800, IPNT1, ARI, LR1, ISTOP, 1, 1, TIME, IDS)
      CALL FPLOT(800, IPNT2, AR2, LR2, ISTOP, 1, 1, TIME, VDS)
C
      CALL FPLOT(800, IPNT4, AR4, LR4, ISTOP, 1, 2, TIME, IQS)
      CALL FPLOT(800, IPNT4, AR4, LR4, ISTOP, 2, 2, TIME, VQS)
C
      CALL FPLOT(800, IPNT3, AR3, LR3, ISTOP, 1, 2, TIME, IMAGD)
C
      CALL FPLOT(800, IPNT3, AR3, LR3, ISTOP, 2, 2, TIME, IDR)
      CALL FPLOT(800, IPNT5, AR5, LR5, ISTOP, 1, 1, TIME, POUT)
   11 INIT=0
      IF(ISTOP)1,1,6
    6 CONTINUE
  250 FORMAT(' ',F6.1,3(F9.2,2X))
      AVER=SUM/NUMBER
      AVER1=SUM1/NUMBER
C
      EFF=AVER/AVER1
      PIN=Y(6)-AREAIN
      POUT=Y(5)-ARAOUT
      RMS=(Y(7)-ARMS)**0.5
```

```
NOTE .7 IS THE VOLTAGE DROP ACROSS THE DIODE
C
C
      1.85 IS THE CE VOLTAGE OF THE TRANSISTOR
C
      SWITCH IS THE # OF INTERVAL OF THE SWITCHING (DIODE CONDUCTION)
      TOTSH IS TOTOAL # OF INTEGRATION INTERVALS
C
      PDIODE IS THE LOSS OF DIODE DURING CONDUCTION
Č
      PTRANS IS THE ON TIME LOSS OF THE TRANSISTOR
C
      PSW IS THE SWITCHING LOSS OF EACH TRANSISTOR (E*I*TSW/T)
C
      TOTSL IS THE TOTAL LOSS OF THE SWITCH
C
      *********
      PDIODE=(SWITCH/TOTSW)*0.7*IMAX/PAI
      PTRANS=(1-SWITCH/TOTSW)*1.85*IMAX/PAI
      TOTSL=PDIODE+PTRANS+PSW
      TOT4SL=4*TOTSL
     DTRIO=SWITCH/TOTSW
C
      EFFIO=POUT/(TOT4SL+PIN)
      EFFIO=POUT/PIN
      SW=SH+SH
C
     WRITE(6,702)POUT, EFFIO, SLIP, IMAX, DTRIO, RMS
     WRITE(6,703)SW,PSW,PTRANS,PDIODE,TOT4SL,IN
  702 FORMAT(///, ' POWER OUT=',F8.1,2X,'EFFIO=',F5.3,2X,'SLIP=',
     1F7.5,2X,'IMAX=',F6.1,2X,'DTRIO=',F7.1,2X,'I(RMS)=',F7.1,//)
  703 FORMAT(/, '#SW/CYC=',F5.1,8X,'PSW=',F6.1,3X,'PTRANS=',F5.1,
     1 2X, 'PDIODE=',F4.1,2X, 'TOT4SL=',F6.1,5X, 'IN=',I5,/////)
     WRITE(6,705)
 705 FORMAT(1X, 'Z', 11X, 'I HARMONIC ', 15X, 'P HARMONIC', //)
C706 FORMAT(1X,F5.1,5X,F12.8,5X,F15.8)
      ISTOP=0.0
CC
     CALL FFT(F1,8)
CC
     CALL FFT(F2,8)
CC
     DO 401 I=1,128
CC
     MAG1(I)=CABS(F1(I))/256.
CC
     MAG2(I)=CABS(F2(I))/256.
CC
     Z=FLOAT(I-1)
CC
     IF (I.EQ.1) MAG1(2)=275.
CC
     AMPI=MAGI(I)/MAG1(2)
CC
     AMP2=MAG2(I)/MAG2(1)
C
     WRITE(6,706) Z,AMP1,AMP2
CC
     IF(I.EQ.128) ISTOP=1
C
      IF(AMP2.GT.300) AMP2=0.0
C
     CALL FPLOT(800, IPNT4, AR4, LR4, ISTOP, 1, 1, Z, AMP1)
C
     CALL FPLOT(800, IPNT3, AR3, LR3, ISTOP, 1, 1, Z, AMP2)
 401
     CONTINUE
     STOP
     END
      SUBROUTINE FFT(X,M)
      COMPLEX X(256),U,H,T
      M=2**M
      HV2=H/2
      HMI=N-1
      J=1
      DO 7 I=1,NM1
      IF(I.GT.J) GOTO 5
```


FILE: OPTIM HATFIV A UNIVERSITY OF HISSOURI COMPUTER NETWORK

```
T=X(J)
       X(J)=X(I)
       X(I)=T
   5
       K=NV2
       IF(K.GE.J)60 TO 7
       J=J-K
       K=K/2
       60 TO 6
       J=J+K
   7
       PI=3.14159265358979
       DO 20 L=1,H
LE=2**L
       LE1=LE/2
       U=(1.0,0.0)
Z=COS(PI/FLOAT(LE1))
       Y=-SIN(PI/FLOAT(LE1))
       W=CMPLX(Z,Y)
       DO 20 J=1,LE1
DO 10 I=J,N,LE
       IP=I+LE1
       T=X(IP)*U
       X(IP)=X(I)-T
 10
       X(I)=X(I)+T
 20
       U=U*W
       RETURN
       END
$ENTRY
             CURRENT OF PHASE A OF STATOR
1
             VOLTAGE OF PHASE A OF STATOR
1
         P
             POWER VS TIME
             CURRENT HARMONIC MAGNITUDE VS HARMONIC ORDER
1
         I
             POWER HARMONIC MAGNITUDE VS HARMONIC ORDER
$STOP
/*
11
```


VOLTAGE & CURRENT (80% S,60KW,MOTOR OPERATION)

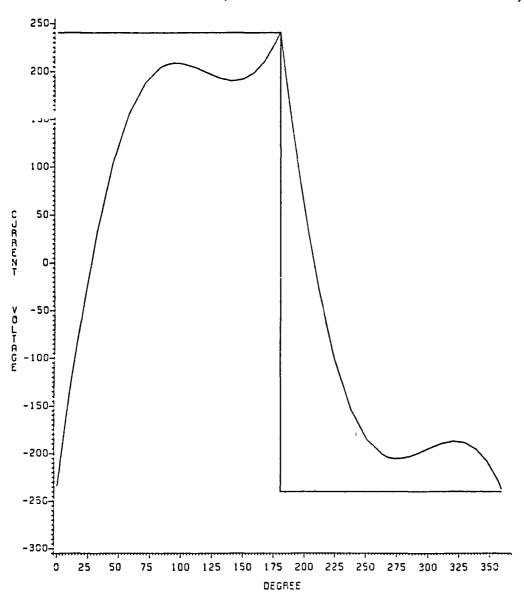


OUTPUT POWER (80% S,60KW, MOTOR OPERATION)

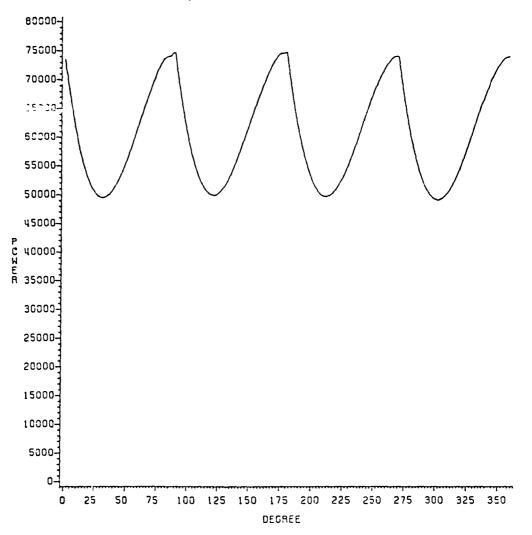

CURRENT SPECTRUM (80% SPEED,60 KW)

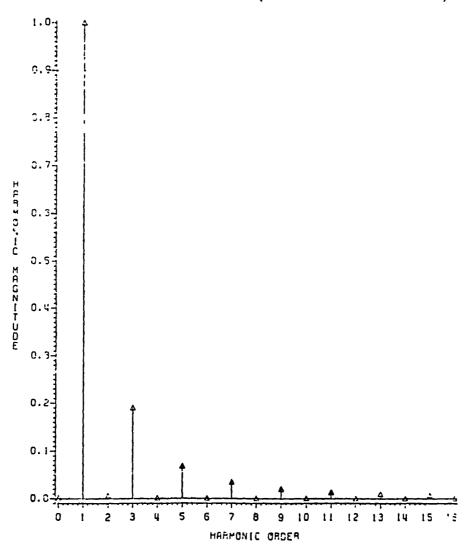

POWER SPECTRUM (80% SPEED,60KW)

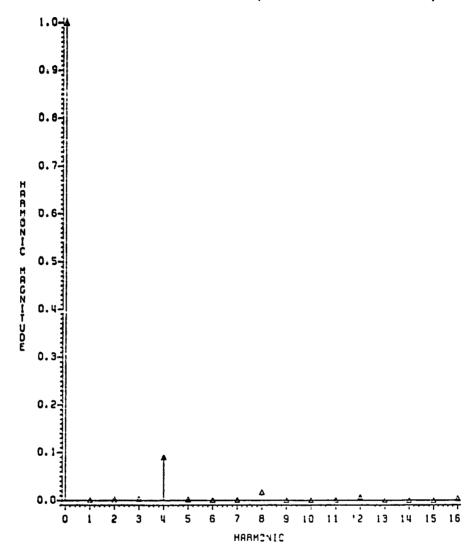

```
//MOTORP JOB (XXXXLH), 'GOODARZI',
// PASSWORD=XXXX
/*JOBPARM R=900,B=99000
// EXEC PLOTSAS
//SYSIN DD *
          GOPTIONS DEVICE=VARIAN;
          DATA ONE:
         INPUT X Y1-Y3;
               80% SPEED, 60KW JPL PROJECT
               PLOT DATA
* DEGREE | CURRENT | VOLTAGE | POWER
CARDS:
  0 4
      -233.96
                    240.00
                             73530 25
  0.9 -227.92
                   240.00
                             72584.00
  1.5 -221.93
                   240 00
                             71657.56
  2.1 -215.98
2.9 -207.63
                   240.00
                             70751.13
                   240.00
                             69503.44
  4.1 -195.96
                   240 00
                             67807 31
  5.7 -179.75
                   240.00
                             65544.56
  8.0 -157.41
                   240.00
                             62615.67
  11.2
       -126.97
                   240.00
                             59009 33
  15.8
        -86.28
                   240.00
                             54955.57
  22.4
        -33.54
                   240.00
                             51216.40
 31.6
        31.40
                   240.00
                             49532.14
                    240.00
        104.19
                             52894.97
 44.6
 57.6
        155.75
                    240.00
                             60361.47
        188.23
                   240.00
 70.6
                             68587.13
 83.7
        204.60
                    240.00
                             74058.00
 88.3
        207.21
                    240.00
                             74693.56
 89.9
        207.80
                   240.00
                             74708.81
                             74138.25
  90.3
        207.92
                    240.00
  90.7
        208.03
                    240.00
                             73465.38
                   240.00
                             72802.44
  91.1
        208.13
        208.22
                   240.00
  91.5
                             72149.25
  92.1
        208.33
                    240.00
                             71242.75
  92.9
        208.45
                   240.00
                             69995.00
  94.1
        208.57
                   240.00
                             68298.13
  95.7
        208.61
                    240.00
                             66034.44
  98.0
        208.44
                   240.00
                             63103.30
101.2
        207.81
                   240.00
                             59492.22
105.8
        206.24
                   240.00
                             55429.19
112.4
                    240.00
                             51671.75
        203.07
121.6
        197.75
                   240.00
                             49950.17
130.8
        192.98
                    240.00
                             51714.76
140.0
        190.43
                    240.00
                             55985.92
149.2
        191.68
                    240.00
                             61636.06
158.4
                    240.00
        198.18
                             67448.50
167.6
        211.24
                    240.00
                             72177.50
176.8
        231.96
                   240.00
                             74603.25
179.1
        238.45
                    240.00
                             74714.19
179.9
        240.87
                    240.00
                             74698.63
```

```
-240.00
                             73889.38
 180.5
         236.11
 181.1
         230.08
                   -240.00
                             72941.25
                   -240.00
                             72012.88
         224.10
 181.7
 182.2
         218.16
                   -240.00
                             71104.63
                   -240.00
 183.1
         209.82
                             69854.19
                   -240.00
                             68153.75
 184.2
         198.17
 185.8
         181.99
                   -240.00
                             65884.75
 188.1
                   -240.00
         159.68
                             62946.13
 191.4
         129.29
                   -240.00
                             59323.89
 196.0
          88.69
                   -240.00
                             55243.95
 202.5
                   -240.00
          36.05
                             51460.83
 211.7
         -28.73
                   -240.00
                             49697.88
 224.7 -101.31
                   -240.00
                             52920.96
 237.8 -152.69
                   -240.00
                             60219.04
 250.8 -185.00
                   -240.00
                             68248.75
 263.8 -201.25
                   -240.00
                             73508.50
 268.4 -203.82
                   -240.00
                             74067.63
 269.6 -204.24
                   -240.00
                             74071.44
 270.0 -204.37
                   -240.00
                             74058.94
 270.4 -204.49
                   -240.00
                             73484.50
 270.8 -204.60
                   -240.00
                             72807.69
 271.2 -204.70
                   -240.00
                             72140.88
 271.6
        -204.79
                   -240.00
                             71484.19
 272.2 -204.90
                   -240.00
                             70572.56
 273.0 -205.02
                   -240.00
                             69317.56
 274.1 -205.13
                   -240.00
                             67611.13
 275.8 -205.17
                   -240.00
                             65333.88
 278.1 -205.00
                   -240.00
                             62384.63
 281.3 -204.37
                   -240.00
                             58749.62
                   -240.00
                             54655.75
 285.9 -202.80
 292.4 -199.63
                   -240.00
                             50861.50
 301.6 -194.33
                   -240.00
                             49102.36
 310.9 -189.59
                             50845.82
                   -240.00
 320.1 -187.09
                   -240.00
                             55110.38
 329.3 -188.39
                   -240.00
                             60769.29
                   -240.00
 338.5 -194.96
                             66604.94
 347.7 -208.09
                   -240.00
                             71369.31
 356.9 -228.90
                   -240.00
                             73842.38
 359.2 -235.41
                   -240.00
                             73966.63
359.8 -237.12
                   -240.00
                             73962.13
          PROC GPLOT;
          PLOT Y1*X Y2*X /OVERLAY ;
          SYMBOL1 I=JOIN L=1;
          SYMBOL2 I=JOIN L=13;
          LABEL X=DEGREE
                Y1=CURRENT
                            VOLTAGE;
         TITLE VOLTAGE & CURRENT (80% S,60KW, MOTOR OPERATION);
          PROC GPLOT:
          PLOT Y3*X /VAXIS=0 TO 80000 BY 5000;
          SYMBOLI I=SPLINE;
          LABEL X=DEGREE
                Y3= POHER ;
          TITLE OUTPUT POWER (80% S,60KM, MOTOR OPERATION);
/×
```

UNIVERSITY OF MISSOURI COMPUTER NETWORK

PLOT

FILE: MOTOR

()

G.4 TWO-PHASE SIMULATION RESULTS FOR 80% SPEED, 12 KW

Source Program

Plots 9

Stator Voltage

Stator Current

Output Power

Current Spectrum

Power Spectrum

Partial Listing of Plot Data

```
//OPTIM
         JOB (XXXXLH), 'JPL PROJ',
// PASSWORD=XXXX
             T=2,L=4
/*JOBPARM
//*ROUTE PRINT UMVMA.EEPR3
    EXEC WATFIV
//GO.SYSIN DD *
$J0B
     DIMENSION AR1(800), AR2(800), AR3(800), Y(20), X(20), GA(20), PE(20),
              XX(4,20),H(9),ZZ1(20),ZZ2(20),ZZ3(20),IFL(7),AR4(800),
    2
              AR5(800), AR6(800), AR7(800), AR8(800)
     LOGICAL*1 LR1(800), LR2(800), LR3(800), LR4(800), LR5(800), LR6(800),
              LR7(800), LR8(800)
     COMPLEX
             F1(512),F2(512)
     REAL LOS, LOP, LM, IAS, IBS, ICS, IAR, IBR, ICR, IDS, IQS, IDR, IQR, LMDQ, INS,
         POUT, IAREF, IBREF, L1, L2, M, IMAX, IMAGD, IMAGQ, IBU,
    1
             MAG1(256), MAG2(256)
     IMAX=65.0
     DI=38.0
     SLIP=0.00725
C
C
           80% SPEED,12KW
                               JPL PROJECT
С
     WRITE(6,50)
C
  50 FORMAT(/,3X,'TIME',8X,'VDS',8X,'IDS',8X,'VQS',8X,'IQS',8X,
            'IDR',9X,'POUT')
C
     NRUN=1
     ISTOP=0
     KEEP=1
     IFL(1)=-1
     NINT=7
     IPHT1=0
     IPNT2=0
     IPHT3=0
     IPNT4=0
     IPNT5=0
     IPNT6=0
     IPNT7=0
     E=240.
PARAMETERS FOR TWOPHASE INDUCTION MOTOR
     LOS=.2940E-03
     LOR=.3230E-03
     LM=26.800E-03
     RS=.0274
     RR=.0213
     PAI=3.141593
     P=1.
     FREQ=160.
     OMEGA=2.0*PAI*FREQ
     OMEGR=OMEGA*(1.-SLIP)
     L1=L0S+LM
     L2=LOR+LM
```

```
M=LM
      FACT=1./(L1*L2-M*M)
      FACT1=L2*FACT
      FACT2=L2*RS*FACT
      FACT22=L1*RR*FACT
      FACT3=M*M*OMEGR*FACT
      FACT4=M*L2*OMEGR*FACT
      FACT44=M*L1*ONEGR*FACT
      FACT5=M*RR*FACT
      FACT55=M*RS*FACT
      FACT6=M*FACT
      FACT7=L1*L2*OMEGR*FACT
    1 IFL(2)=-1
    2 CALL RKFOUR(NINT,Y,X,GA,PE,XX,H,ZZ1,ZZ2,ZZ3,TIME,PNTS,KEEP,IFL)
      IF(IFL(4))3,4,5
    3 INIT=1
      TIME1=-1
      NC=1
      NCC=1
      TIME=0.
      FINTIM=0.2500
      PTMAX=800.
      Y(1)=0.
      Y(2)=0.
      Y(3)=0.
      Y(4)=0.
      Y(5)=0.0
      Y(6)=0.0
С
      Y(7)=0.0
      AREAIN=0.0
      ARAOUT=0.0
      H(1)=.050E-04
C
      H(7) = -1
      VDS=0.0
      VQS=0.0
      SUM=0.
      SUMI=0.
      IN=0
      SUM1=0.
      NUMBER=0.
      SW=0.0
      DII=DI
      SWITCH=0.0
      PSW=0.0
      TOTSW=0.0
      IAE=-1
      IBE=-1
      DO 61 I=1,256
      F1(I)=(0.0,0.0)
      F2(I)=(0.0,0.0)
 61
     CONTINUE
C
    4 IF(TIME-TIME1)7,8,7
    7 TIME1=TIME
C
```

1

```
DEG=FREQ*TIME
      IDEG=DEG
      DFG-(DFG-JDEG)*360.
C
      IAREF=IMAX*SIN(OMEGA*TIME)
      IBREF=IMAX*SIN(OMEGA*TIME-PAI/2.)
C
      IF(IAREF.GT.O.O) IAREF=IMAX
C
      IF(IAREF.LT.0.00) IAREF=-IMAX
C
      IF(IBREF.GT.0.0) IBREF=IMAX
C
      IF(IBREF.LT.0.00) IBREF=-IMAX
C
      DIA=Y(1)-IAREF
      DIB=Y(2)-IBREF
C
      VDS=E
      VQS=E
      IF(IAREF.LT.0) VDS=-E
      IF(IBREF.LT.0) VQS=-E
C
      IF(TIME.LT.0.02000) GOTO 8
C
      IF(TIME.GT.0.00000) GOTO 23
      ISW=0
      IF(DIA.LT.DI1)ISW=1
      IF(DIA.GT.DI) DI1=DIA
      IF(DIA.GT.DI.AND.IAREF.GT.O.O.AND.ISW.EQ.O)
                                                     GOTO 24
      IF(DIA.GT.DI)
                       IAE=1
      GOTO 27
      IAE=1
      IF(TIME.LT.0.24375) GOTO 27
      SW=SW+1
      PSW=ABS((240.*Y(1)*5.5E-06)/(6*6.25E-03))+PSW
     IF(DIA.LT.(-DI)) IAE=0
      IF(VDS.GT.O.O.AND.IAE.EQ 1) GOTO 18
      IF(VDS.LT.0.0.AND.IAE.EQ.0) GOTO 18
      GOTO 22
 18
     VDS=-VDS
      IF(TIME.LT.0.24375) GOTO 22
      SHITCH=SWITCH+1.
22
      IF(DIB GT.DI)
                       IBE≃I
      IF(DIB.LT.(-DI)) IBE=0
      IF(VQS.GT.0.0.AND.IBE.EQ.1) GOTO 19
      IF(VQS.LT.0.0.AND.IBE.EQ.0) GOTO 19
      GOTO 23
19
      VQS=-VQS
23
      IF(TIME.GT.0.23125.AND.TIME.LT.0.2316612)AREAIN=Y(6)
      IF(TIME.GT.0.23125.AND.TIME.LT.0.2316612)ARAOUT=Y(5)
      IF(TIME.GT.0.23125.AND.TIME.LT.0.2316612)ARMS=Y(7)
C
      IF(TIME.LT.0.24375) GOTO 8
      TOTSW=TOTSW+1.
C
 8
      CONTINUE
C
     X(1)=FACT1*VDS-FACT2*Y(1)+FACT3*Y(2)+FACT4*Y(4)+FACT5*Y(3)
```


```
X(2)=FACT1*VQS-FACT2*Y(2)-FACT3*Y(1)-FACT4*Y(3)+FACT5*Y(4)
      X(3)=-FACT6*VDS+FACT55*Y(1)-FACT44*Y(2)-FACT7*Y(4)-FACT22*Y(3)
      X(4)=-FACT6*VQS+FACT55*Y(2)+FACT44*Y(1)+FACT7*Y(3)-FACT22*Y(4)
      X(5)=LM*(Y(2)*Y(3)-Y(1)*Y(4))*OMEGR/.01875
      X(6)=(Y(1)*VDS+Y(2)*VQS)/.01875
      X(7)=Y(1)+Y(1)/.01875
C
      GOTO 2
    5 IPR=0
      NC=NC-1
      IF(NC)9,9,10
    9 NC=NCC
      IPR=1
   10 IF(TIME.GE.FINTIM) ISTOP=1
      IF((IPR+ISTOP).EQ.0) GOTO 11
C
      IF(TIME.LT.0.24375) GOTO 11
      IDS=Y(1)
      IQS=Y(2)
      IDR=Y(3)
      IQR=Y(4)
C
      IMAGD=IDS+ICR
      IMAGQ=IQS+IQR
C
      TQ=LM*(IQS*IDR-IDS*IQR)
      POUT=TQ*OHEGR
C
      PIN=IDS*VDS+IQS*VQS
C
      SUM1=SUM1+PIN
C
      SUM=SUM+POUT
      NUMBER=NUMBER+1.
      IF(TIME.LT.0.24375) GOTO 31
      IF(DEG.GT.180.) GOTO 41
       SUMI=SUMI+Y(1)
 41
       IN=IN+1
       F1(IN)=CMPLX(Y(1),0.0)
       F2(IN)=CMPLX(POUT,0.0)
 31
       CONTINUE
      WRITE(6,250)DEG,IDS,VDS,POUT
C
      IF(TIME.LT.0.24400) POUT=0.0
      CALL FPLOT(800, IPNT1, ARI, LR1, ISTOP, 1, 1, TIME, IDS)
C
      CALL FPLOT(800, IPNT2, AR2, LR2, ISTOP, 1, 1, TIME, VDS)
C
      CALL FPLOT(800, IPNT4, AR4, LR4, ISTOP, 1, 2, TIME, IQS)
C
      CALL FPLOT(800, IPNT4, AR4, LR4, ISTOP, 2, 2, TIME, VQS)
C
      CALL FPLOT(800, IPNT3, AR3, LR3, ISTOP, 1, 2, TIME, IMAGD)
C
      CALL FPLOT(800, IPNT3, AR3, LR3, ISTOP, 2, 2, TIME, IDR)
      CALL FPLOT(800, IPNT5, AR5, LR5, ISTOP, 1, 1, TIME, POUT)
C
   11 INIT=0
      IF(ISTOP)1,1,6
    6 CONTINUE
  250 FORMAT(' ',F6.1,3(F9.2,2X))
C
      AVER=SUM/NUMBER
      AVERI=2*SUMI/IN
```


¢

EFF=AVER/AVER1


```
PIN=Y(6)-AREAIN
      POUT=Y(5)-ARAOUT
      RMS=(Y(7)-ARMS)**0.5
      NOTE .7 IS THE VOLTAGE DROP ACROSS THE DIODE
      1.85 IS THE CE VOLTAGE OF THE TRANSISTOR
      SWITCH IS THE # OF INTERVAL OF THE SWITCHING (DIODE CONDUCTION)
      TOTSH IS TOTOAL # OF INTEGRATION INTERVALS
      PDIODE IS THE LOSS OF DIODE DURING CONDUCTION
C
      PTRANS IS THE ON TIME LOSS OF THE TRANSISTOR
      PSW IS THE SHITCHING LOSS OF EACH TRANSISTOR (E*I*TSW/T)
      TOTSL IS THE TOTAL LOSS OF THE SWITCH
       ************************
      PDIODE=(SWITCH/TOTSW)*0.7*IMAX/PAI
      PTRANS=(1-SWITCH/TOTSW)*1.85*IMAX/PAI
      TOTSL=PDIODE+PTRANS+PSW
      TOT4SL=4*TOTSL
      DTRIO=1-(SWITCH/TOTSW)
C
      EFFIO=POUT/(TOT4SL+PIN)
      EFFIO=POUT/PIN
      SW=SW+SW
C
     WRITE(6,702)POUT, EFFIO. SLIP, IMAX, DI, RMS, AVERI, DTRIO
     KRITE(6,703)SW, PSW, PTRANS, FDIODE, TOT4SL, IN
  702 FORMAT(///, ' POWER OUT=',F6.0,4X,'EFFIO=',F5.3,2X,'SLIP=',
     1F7.5,2X,'IMAX=',F4.0,2X,'DI=',F3.0,4X,
     2'I(RMS)=',F5.1,3X,'I(AVE)=',F5.1,3X,'DTRIO=',F5.3,////)
  703 FORMAT(/, '#SW/CYC=', F5.1,8X, 'PSW=', F6.1,3X, 'PTRANS=', F5.1,
     1 2X, 'PDIODE=',F4.1,2X,'TOT4SL=',F6.1,5X,'IN=',I5,/////)
     WRITE(6,705)
C705 FORMAT(1X,'Z',11X,'I HARMONIC ',15X,'P HARMONIC',//)
C706 FORMAT(1X,F5.1,5X,F12.8,5X,F15.8)
CC
     ISTOP=0.0
CC
      CALL FFT(F1,8)
CC
     CALL FFT(F2,8)
CC
     DO 401 I=1,128
     MAG1(I)=CABS(F1(I))/256.
CC
CC
     MAG2(I)=CABS(F2(I))/256.
CC
     Z=FLOAT(I-1)
CC
     IF (I.EQ.1) MAG1(2)=200.
CC
      AMPI=MAGI(I)/MAGI(2)
CC
      AHP2=MAG2(I)/MAG2(I)
CC
     WRITE(6,706) Z,AMP1,AMP2
CC
      IF(I.EQ.128) ISTOP=1
     IF(AMP2.GT.300) AMP2=0.0
C
CC
     CALL FPLOT(800, IPNT4, AR4, LR4, ISTOP, 1, 1, Z, AMP1)
     CALL FPLOT(800, IPNT3, AR3, LR3, ISTOP, 1, 1, Z, AMP2)
CC
C401
     CONTINUE
      STOP
      EHD
      SUBROUTINE FFT(X.M)
      COMPLEX X(256),U,W,T
      N=2**M
      NV2=N/2
```

```
NM1=N-1
       J≃I
       DO 7 I=1,NM1
       IF(I.GT.J) GOTO 5
       T=X(J)
       X(J)=X(I)
       X(I)=T
       K=NV2
       IF(K.GE.J)GO TO 7
       J=J-K
       K=K/2
       GO TO 6
       J=J+K
       PI=3.14159265358979
       DO 20 L=1,M
       LE=2**L
       LEI=LE/2
       U=(1.0,0.0)
       Z=COS(PI/FLOAT(LEI))
       Y=-SIN(PI/FLOAT(LE1))
       W=CMPLX(Z,Y)
       DO 20 J=1,LE1
       DO 10 I=J,N,LE
       IP=I+LE1
       T=X(IP)*U
       X(IP)=X(I)-T
 10
       X(I)=X(I)+T
       U=U×W
 20
       RETURN
       EHD
$ENTRY
1
             CURRENT OF PHASE A OF STATOR
         P
             POWER VS TIME
             CURRENT HARMONIC MAGNITUDE VS HARMONIC ORDER
         I
1
             POHER HARMONIC MAGNITUDE VS HARMONIC ORDER
1
             VOLTAGE OF PHASE A OF STATOR
$STOP
/*
//
```




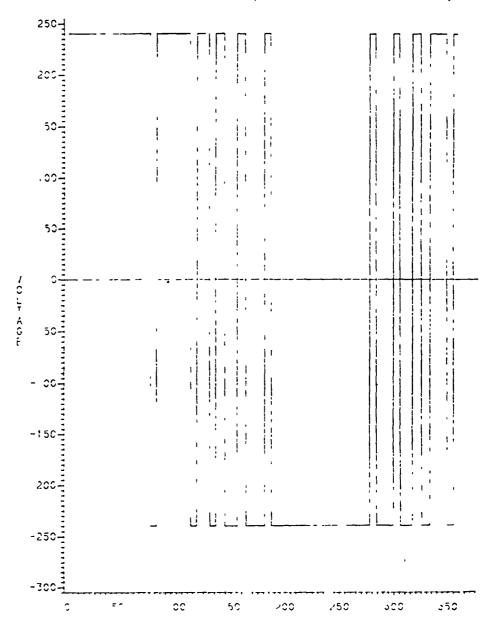


STATOR CURRENT (80% SPEED,12 KW)

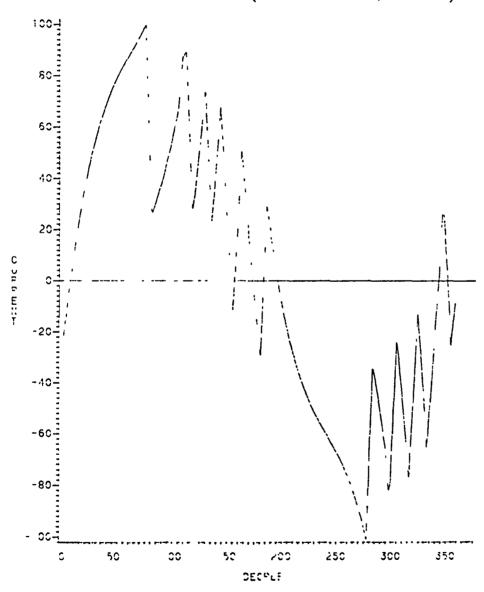


OUTPUT POWER (80% SPEED, 12KW)

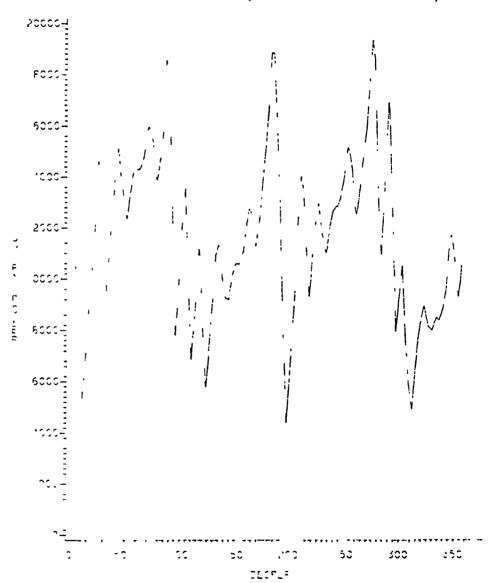

CURRENT SPECTRUM (80% SPEED,12 KW)

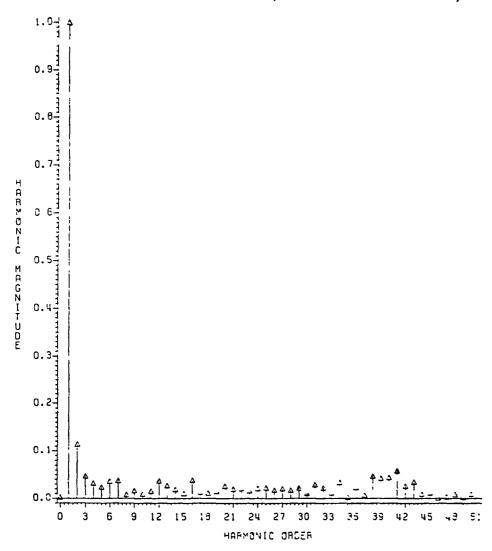

POWER SPECTRUM (80% SPEED,12KW)

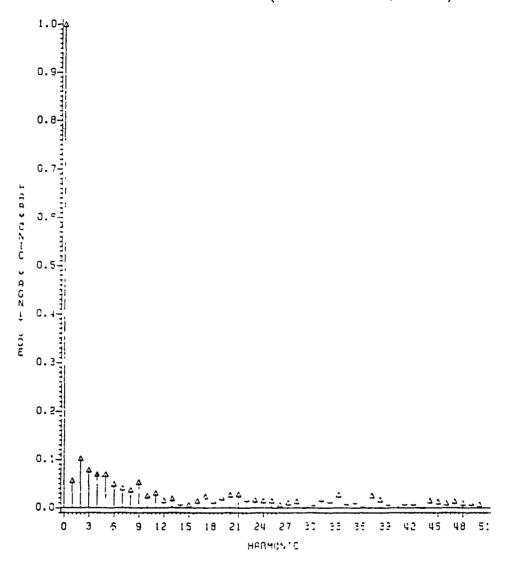

FILE: PLOTP160 WATERY A UNIVERSITY OF MISSOURI COMPUTER NETWORK

PAGE 001

CARDS:

DATA FOR 80% SPEED 60 KW OPERATION

****		******	******
DEGREE			POWER
1.1	-22.81	240.00	5920.99
	-20.59	240.00	6231.94
2.2	-18.39	240.00	6548.00
2.8	-16.23	240.00	6868.89
3.6	-13.22	240.00	7330.49
4.7	-9.07	240.00	7997.52
6.4	-3.40	240.00	8965.61
8.7	4.21	240.00	10373.63
11.9	14.19	240.00	
16.5	26.83	240.00	15306.36
23.0	41.97	240.00	19177.87
23.4	42.81	240.00	18808.73
23.8	43.65	240.00	18330.34
24.2	44.48	240.00	17862.74
24.6	45.29	240.00	17405.93
25.2	46.42	240.00	16778.39
26.0	47.99	240.00	15927.89
27.1	50.13	240.00	14799.00
28.8	53.03	240.00	13350.31
29.2	53.73	240.00	13531.00
29.6	54.42	240.00	13812.66
30.0	55.10	240.00	14090.93
30.4	55.77	240.00	14365.63
30.9	56.71	240.00	14747.93
31.8	58.00	240.00	15275.69
32.9	59.76	240.00	15995.06
34.5	62.14	240.00	16954.89
36.8	65.29	240.00	18187.43
40.1	69.33	240.00	19653.47
40.5	69.81	240.00	19466.14
40.9	70.28	240.00	19217.89
41.3	70.74	240.00	18979.47
41.7	71.20	240.00	18750.66
42.3	71.83	240.00	18443.44
43.1	72.71	240.00	18042.04
44.2	73.91	240.00	17539.42
45.8	75.54	240.00	16957.45
48.1	77.71	240.00	16387.70

FILE: PLOTP160 WATFIV A UNIVERSITY OF MISSOURI COMPUTER NETWORK

48.5	78.08	240.00	16533.59
48.9	78.45	240.00	16717.02
49.3	78.81	240.00	16893.27
49.8	79.17	240.00	17062.34
50.3	79.67	240.00	17288.99
51.1	80.36	240.00	17584.35
52.3	81.33	240.00	17950.66
53.9	82.65	240.00	18363.02
56.2	84.45	240.00	18727.66
56.6	84.76	240.00	18682.68
57.0	85.07	240.00	18627.90
57.4	85.38	240.00	18581.06
57.8	85.69	240.00	18542.06
58.4	86.12	240.00	18500.16
59.2	86.73	240.00	18467.24
60.3	87.58	240.00	18472.39
62.0	88.78	240.00	18580.52
64.3	90.48	240.00	18928.00
64.7	90.79	240.00	18958.41
65.1	91.09	240.00	18969 84
65.5	91.39	240.00	18971.66
65.9	91.70	240.00	18963.81
66.5	92.13	240.00	18936.08
67.3	92.75	240.00	18863.47
68.4	93.63	240.00	18693.46
70.0	94.91	240.00	18316.52
70.4	95.23	240.00	18347.82
70.8	95.56	240.00	18413.83
71.2	95.89	240.00	18485.64
71.7	96.22	240.00	18563.12
72.2	96.69	240.00	18682.33
73.0	97.38	240.00	18869.82
74.2	98.36	240.00	19171.70
75.8	99.80	240.00	19668.84
76.4	93.83	-240.00	18545.96
76.9	86.57	-240.00	17178.11
77.5	79.32	-240.00	15829.75
78.1	72.09	-240.00	14501.10
78.9	61.89	-240.00	12656.22
80.1	47.51	-240.00	10116.46
81.7	27.30	-240.00	6666.26
82.2	26.69	240.00	6761.41
82.8	27.39	240.00	7121.00
83.4	28.10	240.00	7488.83
84.0	28.83	240.00	7864.62
84.8	29.87	240.00	8409.14
85.2	30.41	240.00	8298.47
85.6	30.95	240.00	8100.25
86.0	31.49	240.00	7890.95
86.4	32.04	240.00	7670.58
87.0	32.84	240.00	7339.98
87.8	33.98	240.00	6834.56
88.9	35.65	240.00	6043.88
90.5	38.12	240.00	4773.80
91.0	38.76	240.00	4903.55

156.8

157.4

158.0

-3.69

0.55

4.83

240.00

240.00

240.00

19600.96

19584.65

19548.38

G.5 TWO-PHASE SIMULATION RESULTS FOR POWER REGENERATION AT 80% SPEED


Plots

Stator Voltage and Current
Output Power


Listing of Plot Data

Comment: Source Program is the same as for G.3 except the slip frequency is negative.

VOLTAGE & CURRENT (80% SPEED, REGENERATIVE)

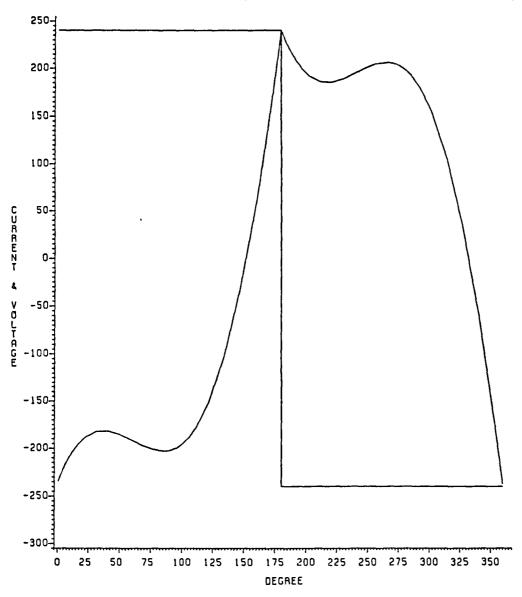

POWER (80% SPEED , REGENERATION)

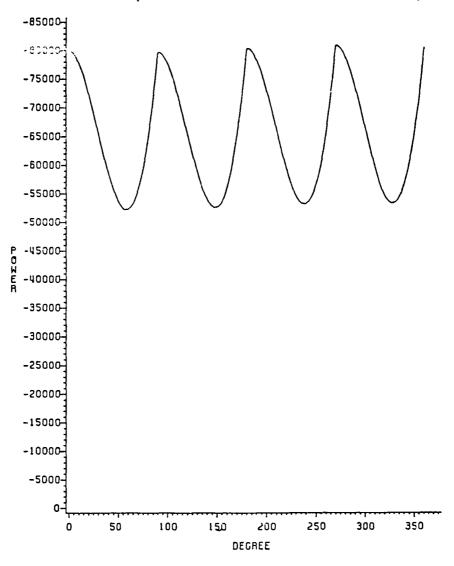

173.6

178.2

179.8

177.76

222.68

239.11

240.00 -70080.00

240.00 -77304.44 240.00 -80170.69

```
A UNIVERSITY OF MISSOURI COMPUTER NETWORK
FILE: REG
              PLOT
        238.47
                  -240.00 -80355.13
180.4
 181.0
        236.56
                  ~240.00 -80352.50
         234.69
 181.5
                  -240.00
                          -80333.38
 182.1
         232 87
                  -240.00 -80298.25
                  -240.00 -80221.63
 182.9
        230.35
                  -240.00 -80061.06
 184.1
         226.93
 185.7
         222.35
                  -240.00 -79734.38
 188.0
                  -240.00 -79086.13
        216.40
                  -240.00 -77834.75
 191.3
         208.99
 195.9
        200.42
                  -240.00 -75505.56
                  -240.00 -71410.00
 202.4
         191.81
 211.6
         185.73
                  -240.00 -64915.04
 220.8
         185.32
                  -240.00 -58869.37
        188.85
                  -240.00 -54598.85
 230.0
 239.2
         194.52
                  -240.00 -53279.17
 248.4
        200.51
                  -240.00 -55878.30
 257.6
        205.00
                  -240.00 -63112.98
 266.9
        206.26
                  -240.00 -75411.81
 269.2
        205.88
                  -240.00 -79299.13
        205.67
 270.0
                  -240.00 -80751.25
 270.4
        205.55
                  -240.00 -80879.50
 270.8
        205.42
                  -240.00 -80878.31
                  -240.00 -80868.75
 271.2
        205.27
 271.6
        205.12
                  -240.00 -80851.06
                  -240.00 -80812.31
 272.2
         204.88
 273.0
         204.51
                   -240.00 -80730.44
 274.1
         203.90
                   -240.00 -80562.56
                  -240.00 -80225.38
 275.8
         202.88
 278.1
         201.10
                   -240.00 -79561.69
         197.86
                  -240.00 -78288.13
 281.3
 285.9
         191.72
                   -240.00 -75926.63
 292.4
                  -240.00 -71782.19
         179.65
 301.6
         155.10
                  -240.00 -65216.10
 314.7
         103.83
                   -240.00 -57010.73
         31.73
 327.7
                   -240.00 -53344.49
 340.7
         -61.74
                  -240.00 -57181.73
 353.7 -175.89
                   -240.00 -70511.56
                  -240.00 -77688.31
 358.3 -220.89
 360.0 -237.35
                   -240.00 -80537.50
          PROC GPLOT;
          PLOT Y1*X Y2*X /OVERLAY;
          SYMBOL1 I=JOIN L=1;
          SYMBOL2 I=JOIN L=13;
          LABEL X=DEGREE
                Y1=CURRENT & VOLTAGE ;
         TITLE VOLTAGE & CURRENT (80% SPEED, REGENERATIVE);
          PROC GPLOT;
          PLOT Y3*X /VAXIS=0 TO -85000 BY -5000;
          SYMBOL1 I=SPLINE;
          LABEL X=DEGREE
                Y3= POWER #
          TITLE REGENERATIVE POWER (80% SPEED );
```

G.6 THREE-PHASE SIMULATION RESULTS

Source Program

Plots

Stator Voltage and Current
Output Power
Listing of Plot Data

```
JPL00010
//B6330 JOB (XXXXEE), 'ABBAS GOODARZI', CLASS=A, MSGLEVEL=(0,0),
// PASSWORD=XXXX
                                                                      JPL00020
/*JOBPARM T=2 ,L=2
                                                                      JPL00030
                                                                      JPL00040
/*ROUTE PRINT UMVMA.EEPR3
      EXEC
              WATFIV
                                                                      JPL00050
//GO.SYSIN DD *
                                                                      JPL00060
                                                                      JPL00070
$J0B
      DIMENSION AR1(800), AR2(800), AR3(800), Y(20), X(20), GA(20), PE(20),
                                                                      JPL00080
     1XX(4,20),H(9),ZZ1(20),ZZ2(20),ZZ3(20),IFL(7),AR4(800)
                                                                      JPL00090
      LOGICAL*1 LR1(800), LR2(800), LR3(800), LR4(800)
                                                                      JPL00100
      REAL L(6,6),LR(6,6),D(6,6),LI(6,6), WKAREA(54),LOS,LOR,LM,THETA,C,JPL00110
    11AS, IBS, ICS, IAR, IBR, ICR, IER, RS, RR, DD, EE, FF, TQ, AA, BB, CC, E, OMEGR,
                                                                      JPL00120
    2DL(6,6), IAREF, IBREF, ICREF, IMAX
                                                                      JPL00130
                                                                      JPL00140
C/ PASSWORD=XXXX,MSGCLASS=S
C*JOBPARM T=3 ,L=3
                                                                      JPL00150
C*ROUTE PRINT UMMVSA.RO
                                                                      JPL00160
C 50 FORMAT(/,2X,'TIME',8X,'VA',8X,'IAS',8X,'IBS',8X,'ICS',8X,
                                                                      JPL00170
                                                                      JPL00180
           'IAR',8X,'IBR',8X,'ICR',5X,'POWER',7X,'ANGLE')
                                                                      JPL00190
      IMAX=100.
                                                                      JPL00200
      SLIP=0.0125
     DI=10.
                                                                      JPL00210
      F=240
                                                                      JPL00220
                                                                      JPL00230
     NRUN=1
     ISTOP=0
                                                                      JPL00240
                                                                      JPL00250
     KEEP=1
                                                                      JPL00260
      IFL(1)=-1
                                                                      JPL00270
     NINT=9
                                                                      JPL00280
      IPNT1=0
      IPNT2=0
                                                                      JPL00290
                                                                      JPL00300
     IPNT3=0
                                                                      JPL00310
      IPNT4=0
JPL00320
                MOTOR PARAMETERS
                                                                      JPL00330
C
      FOR BRIDGE INVERTER (JPL) DATA
                                        SIMPLIFIED MODEL
                                                                      JPL00340
JPL00350
                                                                      JPL00360
      LOS=75.360E-06
     LOR=150.E-06
                                                                      JPL00370
                                                                      JPL00380
      LM=4200.E-06
                                                                      JPL00390
     RS=0.007345
                                                                      JPL00400
     RR=0.004813
     PAI=3.14159
                                                                      JPL00410
     PI2=2.*PAI/3.
                                                                      JPL00420
                                                                      JPL00430
     THETA=0.
     FREQ=330.
                                                                      JPI 00440
     OMEGA=2*PAI*FREQ
                                                                      JPL00450
     OMEGR=OMEGA*(1.-SLIP)
                                                                      JPL00460
     WRITE(6,64)
                                                                      JPL00470
                                                                      JPL00480
     WRITE(6,66)LOS,LOR
     WRITE(6,69)RS,RR
                                                                      JPL00490
                                                                      JPL00500
     WRITE(6,68)LM
     WRITE(6,71)SLIP
                                                                      JPL00510
                                                                      JPL00520
     WRITE(6,72)FREQ
                                                                      JPL00530
     WRITE(6,64)
     WRITE(6,50)
                                                                      JPL00540
     FORMAT( ' ',///,20X, '******MOTOR PARAMETERS*******,///)
                                                                      JPL00550
```

```
FORMAT(' ',20X,'LOS=',F9.7,5X,'LOR=',F9.7)
66
                                                                            JPL00560
      FORMAT( ' ',20X, 'LH=',F9.7)
68
                                                                            JPL00570
      FORMAT(' ',20X,'RS=',F8.6,5X,'RR=',F8.6)
69
                                                                            JPL00580
71
72
      FORMAT( ' ',20X, 'SLIP=',F6.4)
                                                                            JPL00590
      FORMAT( ' ',20X, 'FREQUENCY=',F6.1)
                                                                            JPL00600
      WS=LM+LOS
                                                                            JPL00610
      WR=LH+LOR
                                                                            JPL00620
      T=SQRT(3.)/2.*OMEGR*LM
                                                                            JPL00630
      Z=-0.5*LM
                                                                            JPL00640
      U=SQRT(3.)/3.*OMEGR*(3./2.*LM+LOR)
                                                                            JPL00650
      DO 100 I=1,6
                                                                            JPL00660
      DO 100 J=1,6
                                                                           JPL00670
      L(I,J)=Z
                                                                            JPL00680
      LR(I,J)=0.
                                                                            JPL00690
      D(I,J)=0.
                                                                            JPL00700
  100 CONTINUE
                                                                            JPL00710
      DO 200 I=1,3
                                                                            JPL00720
      L(I,I)=WS
                                                                            JPL00730
      LR(I,I)=RS
                                                                            JPL00740
  200 CONTINUE
                                                                            JPL00750
      DO 201 I=4,6
                                                                            JPL00760
      L(I,I)=WR
                                                                            JPL00770
      LR(I,I)=RR
                                                                            JPL00780
  201 CONTINUE
                                                                            JPL00790
      L(1,4)=LM
                                                                            JPL00800
      L(2,5)=LM
                                                                            JPL00810
      L(3,6)=LM
                                                                            JPL00820
      L(4,1)=LM
                                                                            JPL00830
      L(5,2)=LM
                                                                            JPL00840
      L(6,3)=LM
                                                                            JPL00850
      LR(4,2)=T
                                                                            JPL00860
      LR(4,3)=-T
                                                                            JPL00870
      LR(4,5)=U
                                                                            JPL00880
      LR(4,6)=-U
                                                                            JPL00890
      LR(5.1)=-T
                                                                            JPL00900
      LR(5,3)=T
                                                                            JPL00910
      LR(5,4)=-U
                                                                            JPL00920
      LR(5,6)=U
                                                                            JPL00930
      LR(6,1)=T
                                                                            JPL00940
      LR(6,2)=-T
                                                                            JPL00950
      LR(6,4)=U
                                                                            JPL00960
      LR(6,5)=-U
                                                                            JPL00970
      DO 400 I=1,6
                                                                            JPL00980
      DO 400 J=1,6
                                                                            JPL00990
  400 LI(I,J)=L(I,J)
                                                                            JPL01000
      CALL INVERS (LI,6)
                                                                            JPL01010
      CALL MATMUL (LI,LR,6,6,6,D)
                                                                            JPL01020
    1 IFL(2)=-1
                                                                            JPL01030
    2 CALL RKFOUR(NINT, Y, X, GA, PE, XX, H, ZZ1, ZZ2, ZZ3, TIME, PNTS, KEEP, IFL)
                                                                           JPL01040
      IF(IFL(4))3,4,5
                                                                            JPL01050
    3 INIT=1
                                                                            JPL01060
      TIME1=-1
                                                                            JPL01070
      NC=1
                                                                            JPL01080
      NCC=3
                                                                            JPL01090
      TIME=0.
                                                                           JPL01100
```

```
FINTIM=0.060505
                                                         JPL01110
     Y(1)=0.
                                                         JPL01120
     Y(2)=0.
                                                         JPL01130
     Y(3)=0.
                                                         JPL01140
     Y(4)=0.
                                                         JPL01150
     Y(5)=0.
                                                          JPL01160
                                                         JPL01170
     Y(6)=0.
     Y(7)=0.0
                                                         JPL01180
     Y(8)=0 0
                                                         JPL01190
     Y(9)=0.0
                                                         JPL01200
     H(1)=0.1E-4
                                                         JPL01210
     E2=E/2.
                                                         JPL01220
     IAE=-1
                                                         JPL01230
     IBE=-1
                                                         JPL01240
     ICE=-1
                                                         JPL01250
     UPIN=0.0
                                                         JPL01260
     UPOUT=0.0
                                                         JPL01270
     UPLOSS=0.0
                                                         JPL01280
     POWER=0.0
                                                         JPL01290
     SUM=0.0
                                                         JPL01300
Č
     PIN=0.0
                                                         JPL01310
C
     RMS1=0.0
                                                         JPL01320
C
     RMS2=0.0
                                                         JPL01330
     COUNTT=0.0
                                                         JPL01340
     SH=0.0
                                                         JPL01350
     PSW=0.0
                                                         JPI 01360
     PERIOD=1./FREQ
                                                         JPL01370
     TF=FINTIM-PERIOD
                                                         JPL01380
   4 IF(TIME-TIME1)7,8,7
                                                         JPL01390
   7 TIME1=TIME
C
                                                         JPL01430
C
                                                         JPL01440
C
     REFFERENCE SIGNAL FOR GENERATING INPUT VOLTAGE
                                                         JPL01450
     AND THE CURENT CONTROLER REFRENCE SIGNAL
                                                         JPL01460
C
                                                         JPL01470
DEG=FREQ*TIME
                                                         JPL01500
     IDEG=DEG
                                                         JPL01510
    DEG=(DEG-IDEG)*360.
                                                         JPL01520
C
                                                         JPL01530
     VA=160.*SIN(OMEGA*TIME)
                                                         JPL01580
     VB=160.*SIN(OMEGA*TIME-PI2)
                                                         JPL01590
    VC=160.*SIN(OMEGA*TIME+PI2)
                                                         JPL01600
     IF(TIME.LT.2.8890909) GOTO 88
                                                         JPL01650
    VAO=E2
                                                         JPL01540
    VB0=E2
                                                         JPL01550
    VC0=E2
                                                         JPL01560
C
                                                         JPL01570
    IAREF=IMAX*SIN(OMEGA*TIME)
                                                         JPL01580
    IBREF=IMAX*SIN(OMEGA*TIME-PI2)
                                                         JPL01590
    ICREF=IMAX*SIN(OMEGA*TIME+PI2)
                                                         JPL01600
C
                                                         JPL01610
```

```
IF(IAREF.LT.0.0) VA0=-E2
                                                                         JPL01620
      IF(IBREF.LT.0.0)
                        VB0=-E2
                                                                         JPL01630
      IF(ICREF.LT.0.0) VC0=-E2
                                                                         JPL01640
      IF(TIME.LT.2.8890909) GOTO 87
                                                                         JPL01650
                                                                         JPI 01660
12
      DIA=Y(1)-TARFF
                                                                         JPL01670
      DIB=Y(2)-IBREF
                                                                         JPL01680
      DIC=Y(3)-ICREF
                                                                         JPI 01690
C
                                                                         JPL01700
      IF(DIA.GT.DI)
                        IAE=1
                                                                         JPL01710
      IF(TIME.LT.TF.AND.DIA.GT.DI) GOTO 13
                                                                         JPI 01720
      SW=SW+1.
                                                                         JPL01730
      PSW=ABS((240.*Y(1)*5.5E-06)/(6*PERIOD))+PSW
                                                                         JPL01740
      IF(DIA.LT.(-DI)) IAE=0
13
                                                                         JPL01750
      IF(VAO.GT.O.O.AND.IAE.EQ.1) VAO=-VAO
                                                                         JPL01760
      IF(VAO.LT.O.O.AND.IAE.EQ.O) VAO=-VAO
                                                                         JPL01770
C
                                                                         JPL01780
      IF(DIB.GT.DI)
                       IBE=1
                                                                         JPL01790
      IF(DIB.LT.(-DI)) IBE=0
                                                                         JP101800
      IF(VB0.GT.0.0.AND.IBE.EQ.1) VB0=-VB0
                                                                         JPL01810
      IF(VBO.LT.O.O.AND IBE.EQ.O) VBO=-VBO
                                                                         JPL01820
C
                                                                         JPL01830
      IF(DIC.GT.DI)
                       ICE=1
                                                                         JPL01840
      IF(DIC.LT.(-DI)) ICE=0
                                                                         JPL01850
      IF(VCO.GT.0.0.AND.ICE.EQ.1) VCO=-VCO
                                                                         JPL01860
      IF(VCO.LT.0.0.AND.ICE.EQ.0) VCO=-VCO
                                                                         JPL01870
                                                                         JPL01880
87
      VN=(VA0+VB0+VC0)/3.
                                                                         JPL01890
      VA=VAO-VN
                                                                         JPL01900
      VB=VB0-VN
                                                                         JPL01910
      VC=VC0-VN
                                                                         JPL01920
88
       CONTINUE
                                                                         JPL01930
      IF(TIME.GT.0.03318.AND.TIME.LT.0.03323)
                                                 UPIN=Y(7)
                                                                         JPL01940
      IF(TIME.GT.0.03318.AND.TIME.LT.0 03323)
                                                 UPOUT=Y(8)
                                                                         JPL01950
      IF(TIME.GT.0.03318.AND.TIME.LT.0.03323)
                                                 UPLOSS=Y(9)
                                                                         JPL01960
C
                                                                         JPL01970
      THETA=OMEGR*TIME
                                                                         JPL01980
      DD=SIN(THETA)
                                                                         JPL01990
      EE=SIN(THETA+2.*PAI/3.)
                                                                         JP1.02000
      FF=SIN(THETA-2.*PAI/3.)
                                                                         JPL02010
C
                                                                         JPL02020
      IAR=2./3.*((COS(THETA)+0.5)*Y(4)+(COS(THETA-2.*PAI/3.)+0.5)*Y(5)
                                                                         JPL02030
    .1+(COS(THETA+2.*PAI/3.)+0.5)*Y(6))
                                                                         JPL02040
C
                                                                         JPL02050
    8 CONTINUE
                                                                         JPL02060
C
                                                                         JPL02070
     X(1)=-D(1,1)*Y(1)-D(1,2)*Y(2)-D(1,3)*Y(3)-D(1,4)*Y(4)-D(1,5)*Y(5) JPL02080
           -D(1,6)*Y(6)+LI(1,1)*VA+LI(1,2)*VB+LI(1,3)*VC
     ı
                                                                         JPL02090
     X(2)=-D(2,1)*Y(1)-D(2,2)*Y(2)-D(2,3)*Y(3)-D(2,4)*Y(4)-D(2,5)*Y(5) JPL02100
           -D(2,6)*Y(6)+LI(2,1)*VA+LI(2,2)*VB+LI(2,3)*VC
                                                                         JPL02110
     X(3)=-D(3,1)*Y(1)-D(3,2)*Y(2)-D(3,3)*Y(3)-D(3,4)*Y(4)-D(3,5)*Y(5) JPL02120
     1
           -D(3,6)*Y(6)+LI(3,1)*VA+LI(3,2)*VB+LI(3,3)*VC
                                                                         JPL02130
     X(4)=-D(4,1)*Y(1)-D(4,2)*Y(2)-D(4,3)*Y(3)-D(4,4)*Y(4)-D(4,5)*Y(5) JPL02140
           -D(4,6)*Y(6)+LI(4,1)*VA+LI(4,2)*VB+LI(4,3)*VC
                                                                         JPL02150
     X(5)=-D(5,1)*Y(1)-D(5,2)*Y(2)-D(5,3)*Y(3)-D(5,4)*Y(4)-D(5,5)*Y(5) JPL02160
```

FILE: JPL330 WATFIV A UNIVERSITY OF MISSOURI COMPUTER NETWORK


```
-D(5,6)*Y(6)+LI(5,1)*VA+LI(5,2)*VB+LI(5,3)*VC
                                                                            JPL02170
      X(6)=-D(6,1)*Y(1)-D(6,2)*Y(2)-D(6,3)*Y(3)-D(6,4)*Y(4)-D(6,5)*Y(5) JPL02180
            -D(6,6)*Y(6)+LI(6,1)*VA+LI(6,2)*VB+LI(6,3)*VC
                                                                            JPL02190
      X(7)=(VA*Y(1)+VB*Y(2)+VC*Y(3))/.02632
                                                                            JPL02200
      X(8)=POWER/.02632
                                                                            JPI 02210
      X(9)=3.*(Y(1)*Y(1)*RS+IAR*IAR*RR)/.02632
                                                                            JPL02220
C
                                                                            JPL02230
                                                                            JPI 02240
      GOTO 2
    5 IPR=0
                                                                            JPL02250
      NC=NC-1
                                                                            JPL02260
                                                                            JPI 02270
      IF(NC)9,9,10
    9 NC=NCC
                                                                            JPL02280
                                                                            JPL02290
      TPR=1
   10 IF(TIME.GE.FINTIM)ISTOP=1
                                                                            JPL02300
      IF((IPR+ISTOP).EQ.0) GOTO 11
                                                                            JPL02310
C
                                                                            JPL02320
                                                                            JPL02330
      IAR=2./3.*((COS(THETA)+0.5)*Y(4)+(COS(THETA-2.*PAI/3.)+0.5)*Y(5)
                                                                            JPL02340
                                                                            JPL02350
     1+(COS(THETA+2.*PAI/3.)+0.5)*Y(6))
      IER=2./3.*((COS(THETA+2.*PAI/3.)+0.5)*Y(4)+(COS(THETA)+0.5)*Y(5)
                                                                            JPL02360
     1+(COS(THETA-2.*FAI/3.)+0.5)*Y(6))
                                                                            JPL02370
      ICR=2./3.*((LOS(THETA-2.*PAI/3.)+0.5)*Y(4)+(COS(THETA+2.*PAI/3.)
                                                                            JPL02380
     1+0.5)*Y(5)+(COS(THETA)+0.5)*Y(6))
                                                                            JPL02390
      TQ=(DD*Y(1)*IAR+FF*Y(2)*IAR+EE*Y(3)*IAR+EE*Y(1)*IBR
                                                                            JPI 02400
         +DD*Y(2)*IBR+FF*Y(3)*IBR+FF*Y(1)*ICR+EE*Y(2)*ICR
                                                                            JPL02410
          +DD*Y(3)*ICR)*(-LM)
                                                                            JPL02420
                                                                            JPL02430
      POWER=TQ*OHEGR
      IF(TIME.LT.0.05756) GOTO 11
                                                                            JPL02440
                                                                            JPL02450
      IAS=Y(1)
      IBS=Y(2)
                                                                            JPL02460
      ICS=Y(3)
                                                                            JPL02470
                                                                            JPL02480
      IAR=Y(4)
      IBR=Y(5)
                                                                            JPL02490
      ICR=Y(6)
                                                                            JPL02500
      WRITE(6,250)TIME, VA, Y(1), Y(2), Y(3), Y(4), Y(5), Y(6), POWER, DEG
                                                                            JPL02510
                                                                            JPL02520
      PIN=(VA*IAS+VB*IBS+VC*ICS)+PIN
C
      SUM=SUM+POWER
                                                                            JPL02530
      RMS1=RMS1+(IAS*IAS)
                                                                            JPL02540
C
      RHS2=RMS2+(IAR*IAR)
                                                                            JPL02550
C
      COUNT=COUNT+1.
                                                                            JPL02560
      IF( TIME.LT.0.057597) POWER=0.0
                                                                            JPL02570
      CALL FPLOT(800, IPNT1, AR1, LR1, ISTOP, 1, 2, DEG, IAS)
                                                                            JPL02580
      CALL FPLOT(800, IPNT1, AR1, LR1, ISTOP, 2, 2, DEG, VA)
                                                                            JPL02590
C
      CALL FPLOT(800, IPNT2, AR2, LR2, ISTOP, 1, 2, DEG, IBS)
                                                                            JPL02600
C
      CALL FPLOT(800, IPNT2, AR2, LR2, ISTOP, 2, 2, DEG, VB)
                                                                            JPL02610
C
      CALL FPLOT(800, IPNT3, AR3, LR3, ISTOP, 1, 2, DEG, ICS)
                                                                            JPL02620
      CALL FPLOT(800, IPNT3, AR3, LR3, ISTOP, 2, 2, DEG, VC)
                                                                            JPL02630
                                                                            JPL02640
      CALL FPLOT(800, IPNT4, AR4, LR4, ISTOP, 1, 1, DEG, POWER)
   11 INIT=0
                                                                            JPL02650
      IF(ISTOP)1,1,6
                                                                            JPL02660
                                                                            JPL02670
    6 CONTINUE
  250 FORMAT(F8.6,8(F8.0,3X),F5.1)
                                                                            JPL02680
C 12 FORMAT(' ',A20,/,6(F12.6,3X))
                                                                            JPL02690
      POWERI=Y(7)-UPIN
                                                                            JPL02700
      POWERO=Y(8)-UPOUT
                                                                            JPL02710
```

	PLOSS=Y(9)-UPLOSS	JPL02720
	EFFIO=POHERO/POHERI	JPL02730
C	AVER=SUM/COUNT	JPL02740
С	PIN=PIN/COUNT	JPL02750
C	RMS1=(RMS1/COUNT)**.5	JPL02760
C	RMS2=(RMS2/COUNT)**.5	JPL02770
C	PLOST=(RMS1*RMS1)*RS+(RMS2*RMS2)*RR	JPL02780
C	EFF=AVER/PIN	JPL02790
	EFFL=(POWERI-PLOSS)/POWERI	JPL02800
	EFFPSW=(POWERI-PLOSS)/(POWERI+PSW*3)	JPL02810
	WRITE(6,266)POWERI, POWERO, EFFIO, SLIP, IMAX, EFFL	JPL02820
266	FORMAT(' ',//,'*POWER IN=',F8.1,4X,'POWER OUT=',F8.1,4X,	JPL02830
	1 'EFF(IO)=',F5.3,4X,'SLIP=',F7.5,4X,'IMAX='	JPL02840
	1,F5.1,3X,F5.3,'1')	JPL02850
	WRITE(6,267)SW,PSW,EFFPSW	JPL02860
267	FORMAT(' ','SW=',F6.1,'PSW/LEG=',F8.1,'EFFPSW=',F8.4,///)	JPL02870
C	, , , , , , , , , , , , , , , , , , , ,	JPL02880
•	STOP	JPL02890
	END	JPL02900
С		JPL02910
•	SUBROUTINE INVERS(ZZBUS,N)	JPL02920
	DOUBLE PRECISION ZBUS(6,6)	JPL02930
	DIMENSION ZZBUS(6,6)	JPL02940
	DO 1001 I=1,N	JPL02950
	DO 1001 J=1,N	JPL02960
	ZBUS(I,J)=ZZBUS(I,J)	JPL02970
1001		JPL02980
1001	DO 1070 I=1.N	JPL02990
	TRY=ZBUS(I,I)	JPL03000
	IF(ABS(TRY))1000,1090,1000	JPL03010
1000	00 1040 J=1,N	JPL03010
2000	IF(I-J)1010.1040.1010	JPL03030
1010	DO 1030 K=1,N	JPL03040
1010	IF(I-K) 1020,1030,1020	JPL03050
1020	ZBUS(J,K)=ZBUS(J,K)-ZBUS(J,I)*ZBUS(I,K)/ZBUS(I,I)	JPL03060
1030	CONTINUE	JPL03070
1040	CONTINUE	JPL03080
1040	DO 1060 K=1.N	JPL03090
	IF(K-I)1050,1060,1050	JPL03100
1050	ZBUS(K,I)=ZBUS(K,I)/ZBUS(I,I)	JPL03110
1030	ZBUS(I,K)=ZBUS(I,K)/ZBUS(I,I)	JPL03110
1060	CONTINUE	
1000	==:::=:==	JPL03130
1070	ZBUS(I,I)=-1.0/ZBUS(I,I) CONTINUE	JPL03140
10/0		JPL03150
	DO 1080 I=1,N	JPL03160
	DO 1080 J=1,N	JPL03170
1080	ZBUS(I,J)=-ZBUS(I,J)	JPL03180
1000	CONTINUE	JPL03190
	DO 1002 I=1,N	JPL03200
	DO 1002 J=1,N	JPL03210
1000	ZZBUS(I,J)=ZBUS(I,J)	JPL03220
1002	CONTINUE	JPL03230
	RETURN	JPL03240
1090	HRITE(6,1100)	JPL03250
1100	FORMAT('ERROR IN MATRIX INVERSE')	JPL0326 0


FILE: JPL330 MATFIV A UNIVERSITY OF MISSOURI COMPUTER NETWORK

RETURN	JPL03270
ENO	JPL03280
C	JPL03290
SUBROUTINE MATHUL (A,B,M,L,N,C)	JPL03300
DIMENSION A(M,L),B(L,N),C(H,N)	JPL03310
DO 100 I=1,M	JPL03320
DO 100 J=1,N	JPL03330
C(I,J)=0.	JPL03340
DO 100 K=1,L	JPL03350
100 C(I,J)=C(I,J)+A(I,K)*B(K,J)	JPL03360
RETURN	JPL03370
END	JPL03380
\$ENTRY	JPL03390
1 AV IAS & VA VS. TIME	JPL03400
1 P POWER OF THE MOTOR	JPL03410
\$STOP	JPL03420
/ *	JPL03430
<i>//</i>	JPL03440

VOLTAGE & CURRENT (80% SPEED, MOTOR OPERATION)

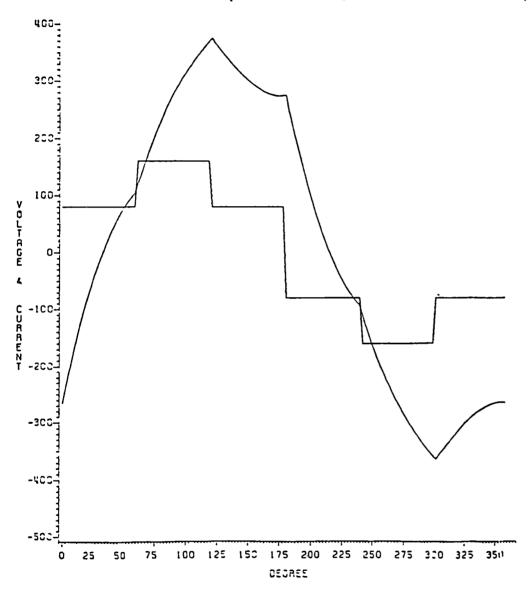

OUTPUT POWER (80% SPEED MOTOR OPERATION)

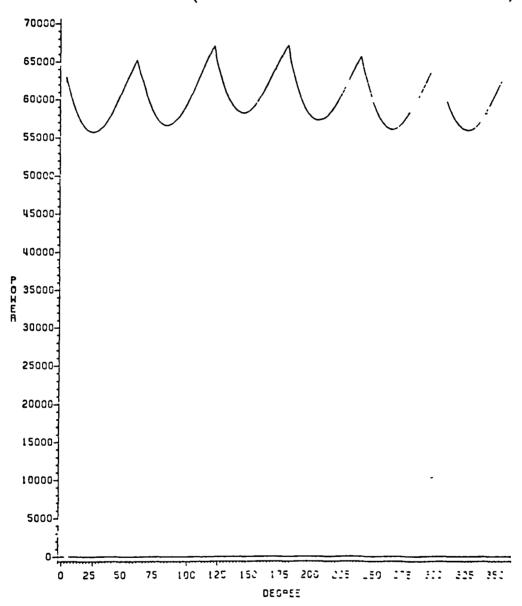

```
FILE: THREE
             PLOT
                     A UNIVERSITY OF MISSOURI COMPUTER NETWORK
//THREEP JOB (XXXXLH), 'GOODARZI',
// PASSHORD=XXXX
/*JOBPARM R=900,B=99000
// EXEC PLOTSAS
//SYSIN DD *
        GOPTIONS DEVICE=VARIAN;
        DATA ONE;
        INPUT X Y1-Y3;
*********
      THREE PHASE PLOT DATA JPL PROJECT
CARDS:
      -238.1
                   80 0
                           62992 7
 2 4
 48
      -215.4
                   80 0
                           61387 7
 7 2
      -193 3
                   80.0
                           59997 3
                           58817.8
 9.5
      -172 0
                   80 0
 11.9
      -151.4
                   80 0
                           57843 1
                   80 0
                           57066.1
      -131.4
 14.3
 16.6
       -112.2
                   80.0
                           56478.4
 19.0
       -93.8
                   80.0
                           56071 7
                   80.0
                           55836 0
       -76.1
 21.4
                           55761.7
 23.8
        -59.1
                   80 0
       -42.9
                   80.0
                           55837.9
 26.1
        -27.5
                   80.0
                           56052.8
 28.5
 30.9
        -12 8
                   80.0
                           56394.6
 33.2
         1.1
                   80 0
                           56850.5
        14.2
                           57407.2
                   80.0
 35.6
 38.0
         26.5
                   80.0
                           58051.1
40.4
        38.1
                   80.0
                           58768.1
        48.9
                   80.0
                           59543.6
42.7
45.1
        59.0
                   80.0
                           60362.7
47.5
        68.3
                   80.0
                           61210.5
49.8
        76.8
                   80.0
                           62070.9
52.2
        84.6
                   80.0
                           62929.0
54.6
        91.6
                   80.0
                           63768.9
56.9
        97.9
                   80 0
                           64574.7
59.3
        103.5
                   80 0
                           65330.1
                  160.0
61.7
        120.9
                           63515.1
64.1
        135.4
                  160.0
                           62315.5
66.4
        151.3
                  160.0
                           60915.1
                           59724.7
                  160.0
68.8
        166.6
71.2
        181.2
                  160.0
                           58741.3
 73.5
        195.1
                  160.0
                           57956.0
75.9
       208.5
                  160.0
                           57359.9
78.3
        221.2
                  160.0
                           56947.8
80.7
        233.4
                  160.0
                           56707.7
83.0
       244.9
                  160.0
                           56629 4
85.4
        256.0
                  160.0
                           56705.8
87.8
       266.5
                  160.0
                           56921.1
```

57265.6

57726.8

58291.0

160.0

160.0

160.0

90.1

92.5

94.9

276.6

286.2

295.3

FILE:	THREE	-LOT A	UNIVERSITY	OF	MISSOURI	COMPUTER	NETWORK	
97.3	304.1	160.0	58944.8					
99.6	312.4	160.0	59674.0					
102.0	320.5		60464.4					
104.4	328.1	160.0	61300.7					
106.7	335.5	160.0	62168.1					
109.1	342.7		63051.2					
111.5	349.6	160.0	63934.3					
113.8	356.2	160.0	64802.2					
116.2	362.7		65638.1					
118.6	369.1	160.0	66426.8					
121.0	375.3	80.0	67152.6					
123.3	367.0	80.0	65000.2					
125.7	360.7	80.0	63487.0					
128.1	354.4	80.0	62183.1					
130.4	348.1	80.0	61083.0					
132.8	341.9	80.0	60180.0					
135.2	335.7	80.0	59467.0					
137.5	329.7	80.0	58935.5					
139.9	323.9	80.0	58577.0					
142.3	318.2	80.0	58381.4					
144.7	312.7	80.0	58338.2					
147.0	307.5	80 0	58437.0					
149.4	302.6	80.0	58665.8					
151.8	297.9	80.0	59012.7		•			
154.1	293.6	80.0	59464.2					
156.5	289.6	80 0	60007.5					
158.9		80.0	60627.9					
161 3	282.9		61312.5					
163.6	280.2		62046.2					
166.0	277.9		62814 4					
168.4	276.1	80 0	63602.2					
170.7	274.8		64393.3					
173 1	274.0		65172.8					
175.5	273.8		65923.1					
177.9			66630.7					
180.2	275.1	-80.0	67280.4					
182.6	247.6		65003.4					
185.0	225.0		63374.9					
187.3			61957.1					
189.7			60747.6					
192.1	161.1	-80.0 -80.0	59738.1 58922.0					
194.4	141.2 122.0		58291.2					
196.8 199.2	103.6	-80.0	57837.4					
201.6	85.9		57551.2					
203.9	69.0		57422.9					
206.3	52.9		57441.2					
208.7	37.5		57594.9					
211.0	22.9		57871.9					
213.4	9.0		58259.6					
215.8	-4.1	-80.0	58744.8					
218.2	-16.4		59314.1					
220.5	-27.9		59953.4					
222.9	-38.7	-80.0	60648.3					
225.3	-48.7	-80.0	61384.1					
			- 3					

FILE:	THREE	PLOT A	UNIVERSITY	OF	MISSOURI	COMPUTER	NETWORK
227.6	-57.9	-80.0	62145.7				
230.0	-66.4	-80.0	62918.1				
232.4	-74.1	-80.0	63685.0				
234.8	-81.2	-80.0	64431.7				
237.1	-87.4	-80.0	65142.2				
239.5	-93.0	-80.0	65801.0				
241.9	-110.3	-160 0	63900.4				
244.2	-124.8	-160 0	62610.4				
246.6	-140.7	-160 0	61121.6				
249.0	-155.9	-160 0	59842 6				
251.3	-170.5	-160 0	58768.7				
253.7	-184.4	-160.0	57891.7				
256.1	-197.7	-160.0	57205 8				
258.5	-210.4	-160.0 -160.0	56703 2 56370.8				
260.8	-222.6 -234.1	-160.0	56202.0				
265.6	-245.1	-160.0	56186 1				
267.9	-255.7	-160.0	56310.3				
270.3	-265.7	-160.0	56563.8				
272.7	-275.3	-160 0	56934 4				
275.1	-284.4	-160 0	57409.3				
277.4	-293.2	-160.0	57973.1				
279.8	-301.5	-160.0	58615.2				
282.2	-309.5	-160.0	59318 3				
284.5	-317.2	-160.0	60068 8				
286.9	-324.6	-160.0	60851.5				
289.3	-331.7	-160.0	61651 4				
291.6	-338.6	-160.0	6245 2 3				
294.0	-345.3	-160.0	63240 0				
296.4	-351.8	-160 0	63997 6				
298.8	-358.2	-160.0	64710.0				
301.1	-364.4	-80.0	65360.8				
303.5	-356.1	-80.0	63149 2				
305.9 308.2	-349.8 -343.5	-80.0 -80.0	61577.4 60218 0				
310.6	-337.2	-80.0	59065.0				
313.0	-331.0	-80 0	58112 4				
315.4	-324.9	-80.0	57352.7				
317.7	-318.9	-80.0	56777.5				
320.1	-313.1	-80.0	56377.9				
322.5	-307.4	-80 0	56145.2				
324.8	-302.0	-80.0	56068.4				
327.2	-296.8	-80.0	56135.7				
329.6	-291.9	-80.0	56336.4				
331.9	-287.3	-80.0	56657.9				
334.3	-283.0	-80.0	57088.6				
336.7	-279.1	-80.0	57613 4				
339.1	-275.5	-80.0	58219.1				
341.4	-272.4	-80.0	58892.3				
343.8	-269.7	-80.0	59617.1				
346.2 348.5	-267.5 -265.7	-80.0 -80.0	60378.2 61162.9				
350.9	-264.5	-80.0	61956 4				
353.3	-263.8	-80.0	62739.2				
355.7	-263.6	-80.0	63499.7				

FILE: THREE PLOT A UNIVERSITY OF MISSOURI COMPUTER NETWORK

APPENDIX H

DERIVATION OF INDUCTION MOTOR d-q EQUATIONS

IN STATIONARY REFERENCE FRAME

DERIVATION OF INDUCTION MOTOR d-q EQUATIONS

IN STATIONARY REFERENCE FRAME

EE400 Research Problem Report

(4) Credit Hours

bу

Hadi Tehrani MSEE Candidate

February 21, 1984

for

Department of Electrical and Computer Engineering
University of Missouri-Columbia

Supervisor: Dr. R. G. Hoft, Professor of Electrical Engineering

TABLE OF CONTENTS

1.0	OBJE	CT .	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	•	:	•	•	•	•	•	•	1
2.0	INDU	CTI	NC!	MO ⁻	TOF	₹ E	QL	JΑT	ΓIC	NS	I	N	TH	RE	Έ	PH	IAS	E	٧٨	R1	AE	BLE	S		•	•		•		1
3.0	TRANS	SFOF	RMA	TIO	NC	TO) S	T.	\TI	ON	IAF	RY	d-	q	RE	FE	RE	NC	Έ	FF	۱A۶	1E	•	•		•	•			11
	3.1	Dei	fin	ti	ior	1 0	f	d-	p	St	at	ic	na	ry	F	le f	er	en	ce	: F	ra	ıme	:	•		•	•	•		11
	3.2	Dei	fin	ı tı	or	ו כ	f	D-	Q	Ro	ta	tı	ng	R	le f	er	en	ice	F	ra	me	:	•		•		•	•	•	11
	3.3	Ind	duc	tio	on	Mo	oto	r	d-	q-	0	۷a	ri	ab	1e	s	•	•	•	•	•	•	•	•	•		•	•		13
4.0	RESU	_TS	•						•	•	•	•				•	•	•		•	•	•	•	•	•	•	•	•		22
APPEN	I XIC	•	٠.	•	•		•				•	•	•				•	•	•		•	•	•		•		•	•		23
APPEN	I XIC	Ι.			•		•	•																						26

For the majority of practical ac machines, including ideal induction machines, a great simplification is obtained by expressing the equations in a new reference frame and introducing certain currents and voltages which are different from, but are related to, the actual ones. The currents can have a physical meaning in that they can be considered to flow in windings acting along two axes at right angles, called the direct and quadrature axes. In this paper a two-axis d-q theory of the induction motor in a stationary reference frame is developed.

2.0 INDUCTION MOTOR EQUATIONS IN THREE PHASE VARIABLES

It is assumed that the induction motor is ideal and symmetrical, which means:

- 1. Uniform air gap
- 2. Linear magnetic circuit
- Identical stator windings which produce a sinusoidal MMF wave in space
- 4. No changes in resistances due to temperature and frequency changes

The stator circuits are oriented along the a_s , b_s and c_s axes which are 120° apart. The rotor circuits are along the a_r , b_r and c_r axes which are also 120° apart. They rotate relative to the stationary stator axes with an angular velocity $\omega_r = \frac{d\theta}{dt}$, which is the motor shaft velocity, and the angle θ is the angle between the stator and rotor.

The basic KVL equations for the three phase induction motor are - for the stator

$$|V_{as}| = |R_{as}|_{as} + |L_{1as}|_{dt} + \frac{di_{as}}{dt} + \frac{d\lambda_{as}}{dt}$$

$$|V_{bs}| = |R_{bs}|_{bs} + |L_{1bs}|_{dt} + \frac{di_{bs}}{dt} + \frac{d\lambda_{bs}}{dt}$$

$$|V_{cs}| = |R_{cs}|_{cs} + |L_{1cs}|_{dt} + \frac{d\lambda_{cs}}{dt}$$

and for the rotor

$$V_{ar'} = R_{ar} \cdot r_{ar} + L_{1ar} \cdot \frac{di_{ar}}{dt} + \frac{d\lambda_{ar}}{dt}$$
 (2.4)

$$V_{br} = R_{br} I_{br} + L_{lbr} \frac{di_{br}}{dt} \frac{dk_{br}}{dt}$$
 (2.5)

$$V_{ar} = R_{ar} \tau_{ar} + L_{1ar} \frac{di_{ar}}{dt} + \frac{d\lambda_{ar}}{dt}$$

$$V_{br} = R_{br} \tau_{br} + L_{1br} \frac{di_{br}}{dt} \frac{d\lambda_{br}}{dt}$$

$$V_{cr} = R_{cr} \tau_{cr} + L_{1cr} \frac{di_{cr}}{dt} + \frac{d\lambda_{cr}}{dt}$$
(2.4)
$$(2.5)$$

where

$$V_{as} \stackrel{\triangle}{=} instantaneous$$
 line to neutral voltage of stator Phase a $V_{bs} \stackrel{\triangle}{=} "$ " " " " " " Phase b $V_{cs} \stackrel{\triangle}{=} "$ " " " " " " Phase c $V_{cs} \stackrel{\triangle}{=} "$ " " " " " " Phase c $V_{br} \stackrel{\triangle}{=} "$ " " " " " " Phase b $V_{cr} \stackrel{\triangle}{=} "$ " " " " " Phase c $V_{cr} \stackrel{\triangle}{=} "$ " " " " " Phase c

$$R_{as} \stackrel{\triangle}{=} line$$
 to neutral resistance of stator Phase \underline{a} $R_{bs} \stackrel{\triangle}{=} "$ " " " Phase \underline{b} $R_{cs} \stackrel{\triangle}{=} "$ " " " Phase \underline{c}

```
R_{ar} \triangleq line to neutral resistance of rotor Phase \underline{a}
                                                                             Phase <u>b</u>
R<sub>cr</sub> <u>∆</u> " "
                                                                          Phase <u>c</u>
i_{as} \triangleq instantaneous phase or line current in stator Phase \underline{a}
i_{bs} \triangleq
                                                                    11
¹cs ≡
                                                                                               Phase c
i<sub>ar</sub> ≜
                                                                             " rotor Phase <u>a</u>
\mathbf{i}_{\mathrm{br}} \triangleq
                                                                                               Phase <u>b</u>
i<sub>cr</sub> ≜
                                                                                               Phase <u>c</u>
\lambda_{as} \triangleq instaneous flux linkage of stator Phase \underline{a} with air gap magnetic field
                                                                         Phase <u>b</u> "
\lambda_{bs} \stackrel{\underline{7}}{=}
                                                                         Phase <u>c</u> "
<sup>λ</sup>cs ≜
                                                     " rotor Phase <u>a</u> "
λ<sub>ar</sub> ≜
                                                                         Phase <u>b</u> "
\lambda_{br} \triangleq
                                                                         Phase <u>c</u> "
<sup>λ</sup>cr ≜
L_{las} \triangleq leakage inductance of stator Phase <math>\underline{a}
L_{1bs} \triangleq
                                                                  Phase <u>b</u>
                                                                  Phase <u>c</u>
L<sub>lcs</sub> ≜
L<sub>lar</sub> ≜
                                                                  Phase <u>a</u>
                                                                  Phase <u>b</u>
L<sub>1br</sub> ≜
                                                                  Phase <u>c</u>
L<sub>1cr</sub> ≜
```

Fig. 2.1 shows the three phase axes of the stator and rotor.

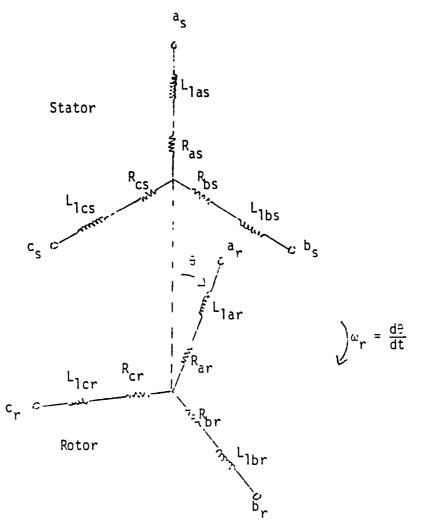


Fig. 2.1

Because of the symmetrical and balanced windings:

$$\begin{split} R_{as} &= R_{bs} = R_{cs} = R_{s} & \text{(stator resistance/phase)} \\ R_{ar} &= R_{br} = R_{cr} = R_{r} & \text{(rotor resistance/phase)} \\ L_{las} &= L_{lbs} = L_{lcs} = L_{ls} & \text{(stator leakage inductance/phase)} \\ L_{lar} &= L_{lbr} = L_{lcr} = L_{lr} & \text{(rotor leakage inductance/phase)} \end{split}$$

The basic equations can be shown in matrix form as

λ_{as}	γps	λcs	λar	br	λ _{cr}					
$\begin{vmatrix} 1 & as & & \lambda & as \\ i & bs & & \lambda & bs \\ 1 & cs & & \lambda & cs \\ 1 & ar & + & dt & \lambda & ar \\ i & br & & \lambda & cr \\ i & cr & & \lambda & cr \end{vmatrix}$										
	+									
1 as	bs	- CS	lar.	ibr	i Cr					
d										
0	0	0	0	0	١٦					
0	0	0	0	1,1	0					
0	0	0	L_{1r}	0	0					
0	0	L _{1s}	0	0	0					
0	ل ا	0	0	0	0					
^{[L} 1s	0	0	0	0	0					
	+									
	ibs	ics	Jar	ibr	i					
	ibs	i	ar	i br	ic					
0 1, as	0 i _{bs}	0 ics	0 lar	0 br	Rr icr					
0 0 1 as	0 0 i _{bs}	0 0 1 _{cs}	0 0 1 _{ar}	Rr 0 1br	0 Rr icr					
0 0 0 1 a s	0 0 0 i _{bs}	0 0 0 i _{cs}	Rr 0 0 1ar	0 Rr 0 ibr	0 0 Rr icr					
0 0 0 0 i as	0 0 0 0 i _{bs}	R _s 0 0 0 i _{cs}	0 Rr 0 0 1 ar	0 0 R 0 ibr	0 0 0 Rr icr					
0 0 0 0 0 0 i as	R _s 0 0 0 0 i _{bs}	0 R _s 0 0 0 i _{cs}	0 0 R, 0 0 1 ar	0 0 0 R _r 0 i _{br}	0 0 0 0 Rr icr					
R _S 0 0 0 0 0 1 as	0 R _S 0 0 0 0 1 _{bs}	0 0 R _s 0 0 0 i _{cs}	0 0 0 R 0 0 1 ar	0 0 0 0 R, 0 1 br	0 0 0 0 0 Rr 1 cr					
R _S 0 0 0 0 0 1 as	V _{bs} 0 R _s 0 0 0 0 i _{bs} 0 L _{1s} 0 0 0 0 0	0 0 R _S 0 0 0 i _{cs}	= 0 0 0 R, 0 0 1 _{ar}	0 0 0 0 R, 0 1 _{br}	0 0 0 0 0 Rr 1 cr					

(2.7)

where the variables written in vector form are

$$|v_s| = \begin{vmatrix} v_{as} \\ v_{bs} \end{vmatrix}$$
 (2.9a) $|v_r| = \begin{vmatrix} v_{ar} \\ v_{br} \end{vmatrix}$ (2.8a)

$$\begin{vmatrix} i_{as} \\ i_{bs} \end{vmatrix} = \begin{vmatrix} i_{br} \\ i_{cs} \end{vmatrix} = \begin{vmatrix} i_{br} \\ i_{cr} \end{vmatrix}$$
 (2.8b)

$$|\lambda_{s}|^{\lambda} = \lambda_{bs}$$
 (2.9c) $|\lambda_{r}|^{\lambda} = |\lambda_{br}|^{\lambda}$ (2.8c)

Next, the equation for the total flux linkage for each stator and rotor phase and the air gap magnetic field is written as follows

$$\vec{\lambda} = \vec{L}_1$$
 (2.10)

where

$$\lambda_{as} = L_{ms} i_{as} + L_{ms} i_{bs} \cos (2\pi/3) + L_{ms} i_{cs} \cos (-2\pi/3)$$

$$+ L_{mr} i_{ar} \cos \theta + L_{mr} i_{br} \cos (\theta + 2\pi/3) + L_{mr} i_{cr} \cos (\theta - 2\pi/3)$$

$$(2.11)$$

$$\lambda_{bs} = L_{ms} i_{as} \cos (-2\pi/3) + L_{ms} i_{bs} + L_{ms} i_{cs} \cos (2\pi/3)$$

$$+ L_{mr} i_{ar} \cos (\theta - 2\pi/3) + L_{mr} i_{br} \cos \theta + L_{mr} i_{cr} \cos (\theta + 2\pi/3)$$

$$(2.12)$$

$$\lambda_{cs} = L_{ms} i_{as} \cos (2\pi/3) + L_{ms} i_{bs} \cos (-2\pi/3) + L_{ms} i_{cs}$$

$$L_{mr} i_{ar} \cos (\theta + 2\pi/3) + L_{mr} i_{br} \cos (\theta - 2\pi/3) + L_{mr} i_{cr} \cos \theta$$

$$(2.13)$$

$$\lambda_{ar} = L_{ms} i_{as} \cos \theta + L_{ms} i_{bs} \cos (\theta - 2\pi/3) + L_{ms} i_{cs} \cos (\theta + 2\pi/3)$$

$$L_{mr} i_{ar} + L_{mr} i_{br} \cos (-2\pi/3) + L_{mr} i_{cr} \cos (-2\pi/3)$$

$$(2.14)$$

$$\Delta_{br} = L_{ms} i_{as} (\theta + 2\pi/3) + L_{ms} i_{bs} \cos \theta + L_{ms} i_{cs} \cos (\theta - 2\pi/3)$$

$$L_{mr} i_{ar} \cos (2\pi/3) + L_{mr} i_{br} + L_{mr} i_{cr} \cos (-2\pi/3)$$

$$(2.15)$$

$$\lambda_{cr} = L_{ms} l_{as} \cos (\theta - 2\pi/3) + L_{ms} l_{bs} \cos (\theta + 2\pi/3) + L_{ms} i_{cs} \cos \theta$$

$$L_{mr} i_{ar} \cos (-2\pi/3) + L_{mr} i_{br} \cos (2\pi/3) + L_{mr} i_{ar}$$
(2.16)

and

 $L_{ms} \stackrel{.}{\leq}$ magnetizing inductance/stator phase of air gap magnetic field $L_{mr} \stackrel{.}{\simeq}$ magnetizing inductance/rotor phase of air gap magnetic field

Equations (2.11)-(2.16) can be written in the matrix equation form of (2.17). For simplicity, (2.17) can be divided into four 3X3 as follows

$$|L_1| = \begin{vmatrix} L_{ms} & -1/2L_{ms} & -1/2L_{ms} \\ -1/2L_{ms} & L_{ms} & -1/2L_{ms} \\ -1/2L_{ms} & -1/2L_{ms} & L_{ms} \end{vmatrix}$$
(2.18a)

$$|L_{2}| = \begin{vmatrix} L_{mr}\cos\theta & L_{mr}\cos(\theta + 2\pi/3) & L_{ms}\cos(\theta + 2\pi/3) \\ L_{mr}\cos(\theta - 2\pi/3) & L_{mr}\cos\theta & L_{mr}\cos(\theta + 2\pi/3) \\ L_{mr}\cos(\theta + 2\pi/3) & L_{mr}\cos(\theta - 2\pi/3) & L_{mr}\cos\theta \end{vmatrix}$$
(2.18b)

$$L_{3} = \begin{vmatrix} L_{ms}\cos\theta & L_{ms}\cos(\theta - 2\pi/3) & L_{ms}\cos(\theta + 2\pi/3) \\ L_{ms}\cos(\theta + 2\pi/3) & L_{ms}\cos\theta & L_{ms}\cos(\theta - 2\pi/3) \\ L_{ms}\cos(\theta - 2\pi/3) & L_{ms}\cos(\theta + 2\pi/3) & L_{ms}\cos\theta \end{vmatrix}$$
(2.18c)

$\left \lambda_{as}\right $	1	L _{ms}	-1/2L _{ms}	-1/2L _{ms}	L _{mr} cos 0	L _{mr} cos (θ+2π/3)	$L_{mr}\cos(\theta-2\pi/3)$	li	as
λbs	İ	-1/2L _{ms}	L _{ms}	-1/2L _{ms}	L _{inr} cos (0-2π/3)	L _{mr} cos0	$L_{mr}\cos(\theta+2\pi/3)$	li	bs
λcs		-1/2L _{ms}	-1/2L _{ms}	L _{ms}	L _{mr} cos (0+2π/3)	$L_{mr}\cos(\theta-2\pi/3)$	L _{mr} cosθ	i	cs
^λ ar	1	L _{ms} cosθ	$L_{ms} \cos (\theta - 2\pi/3)$	L _{ms} cos (0+2π/3)	L _{mr}	-1/2L _{mr}	-1/2L _{mr}	li	ar
\\ \lambda_br \end{array}		L _{ms} cos (θ+2π/3)	L _{ms} cosθ	$L_{ms}\cos(\theta-2\pi/3)$	-1/2L _{mr}	L _{mr}	-1/2L _{mr}	li	br
^{\lambda} cr		 L _{ms} cos (θ-2π/3)	$L_{ms}\cos(\theta+2\pi/3)$	L _{ms} cos0	-1/2L _{mr}	-1/2L _{mr}	L _{mr}	li	cr

(2.17)

$$|L_4| = \begin{vmatrix} L_{mr} & -1/2L_{mr} & -1/2L_{mr} \\ -1/2L_{mr} & L_{mr} & -1/2L_{mr} \\ -1/2L_{mr} & -1/2L_{mr} & L_{mr} \end{vmatrix}$$
 (2.18d)

Then (2.17) can be written

$$\begin{vmatrix} \vec{\lambda}_{s} \\ \vec{\lambda}_{r} \end{vmatrix} = \begin{vmatrix} L_{1} & L_{2} \\ L_{3} & L_{4} \end{vmatrix} = \begin{vmatrix} \vec{\tau}_{s} \\ \vec{\tau}_{r} \end{vmatrix}$$
 (2.19)

Since this induction motor has no neutral connection

$$i_{as} + i_{bs} + i_{cs} = 0$$
 (2.20a)

$$i_{ar} + i_{br} + i_{cr} = 0$$
 (2.20b)

Therefore

$$i_{as} = -i_{bs} - i_{cs} \tag{2.21a}$$

$$i_{ar} = -i_{br} - i_{cr}$$
 (2.21b)

If these equations are substituted into (2.17), matrixes L_1 and L_4 become

$$\begin{vmatrix} L_1' & = \begin{vmatrix} 3/2L_{ms} & 0 & 0 \\ 0 & 3/2L_{ms} & 0 \\ 0 & 0 & 3/2L_{ms} \end{vmatrix}$$
 (2.22)

$$\begin{vmatrix} L_4 \end{vmatrix} = \begin{vmatrix} 3/2L_{mr} & 0 & 0 \\ 0 & 3/2L_{mr} & 0 \\ 0 & 0 & 3/2L_{mr} \end{vmatrix}$$
 (2.23)

It is more convenient to write the resistance matrix and the leakage inductance matrix of (2.7) as follows

$$|R| = \begin{vmatrix} R_s & 0 \\ 0 & R_r \end{vmatrix}$$
 (2.24) $|L_1| = \begin{vmatrix} L_{1s} & 0 \\ 0 & L_{1r} \end{vmatrix}$ (2.25).

where

$$R_{s} = 0 \quad 0 \quad L_{1s} = 0 \quad 0$$

$$R_{s} = 0 \quad R_{s} \quad 0 \quad (2.24a) \quad L_{1s} = 0 \quad L_{1s} \quad 0 \quad (2.25a)$$

$$0 \quad 0 \quad R_{s} \quad 0 \quad 0 \quad L_{1s} \quad 0$$

$$\begin{vmatrix} R_{r} & 0 & 0 & & L_{1r} & 0 & 0 \\ R_{r} & 0 & R_{r} & 0 & (2.24b) & |L_{1r}| & 0 & L_{1r} & 0 \\ 0 & 0 & R_{r} & |0 & 0 & L_{1r}| & 0 & 0 & L_{1r} \end{vmatrix}$$
 (2.25b)

By substituting (2.19), (2.24) and (2.25) into equation (2.7), the induction motor equations can be written

$$[\vec{V}_{S}] = [R_{S}] [\vec{i}_{S}] + [L_{1}] d/dt [\vec{i}_{S}] + d/dt [L_{2}] [\vec{i}_{r}] + [L_{1S}] d/dt [\vec{i}_{S}]$$

$$(2.26)$$

$$[\vec{V}_{r}] = [R_{r}] [\vec{i}_{r}] + d/dt [L_{3}] [\vec{i}_{S}] + [L_{4}] d/dt [\vec{i}_{r}] + [L_{1r}] d/dt [\vec{i}_{r}]$$

$$(2.27)$$

Equations (2.26) and (2.27) can be written in matrix form

$$\begin{vmatrix} \vec{V}_{S} \\ \vec{V}_{r} \end{vmatrix} = \begin{vmatrix} [R_{S}] & \vec{i}_{S} \\ [R_{r}] & \vec{i}_{r} \end{vmatrix} + \begin{vmatrix} [L_{1S}] \\ [L_{1r}] \end{vmatrix} + P \begin{vmatrix} \vec{i}_{S} \\ \vec{i}_{r} \end{vmatrix} + P \begin{vmatrix} [L_{1}] & [L_{2}] \\ [L_{3}] & [L_{4}] \end{vmatrix} \begin{vmatrix} \vec{i}_{r} \\ \vec{i}_{r} \end{vmatrix}$$
 (2.28)

where

$$P = d/dt$$

3.0 TRANSFORMATION TO STATIONARY d-q REFERENCE FRAME

In this report, the following symbols are used:

D-Q => rotating reference frame (rotating at rotor speed fixed with respect to the rotor)

3.1 Definition of d-g Stationary Reference Frame

For the d-q stationary reference frame, the d-axis is in line with the a-axis of the stator as shown in Fig. 3.1. Then,

$$v_d = v_{as} + v_{bs} \cos (120^\circ) + v_c \cos (-120^\circ)$$

 $v_a = v_b \sin (120^\circ) + v_c \sin (-120^\circ)$

or

$$\begin{vmatrix} v_{d} \\ v_{q} \end{vmatrix} = \begin{vmatrix} 1 & -1/2 & -1/2 \\ 0 & \sqrt{3}/2 & -\sqrt{3}/2 \end{vmatrix} \begin{vmatrix} v_{as} \\ v_{bs} \\ v_{cs} \end{vmatrix}$$
 (3.1)

3.2 Definition of D-Q Rotating Reference Frame

The D-Q reference frame rotates relative to the d-q stationary reference frame, where θ is the angle between the d-axis and the D-axis and

$$\theta = \int \omega_r dt; \qquad \omega_r = \frac{d\theta}{dt}$$

where ω_{r} is the rotor speed in radians/second. This is shown in Fig. 3.2.

$$\begin{vmatrix} v_{d} \\ v_{q} \end{vmatrix} = \begin{vmatrix} \cos \theta & -\sin \theta \\ \sin \theta & \cos \theta \end{vmatrix} \begin{vmatrix} v_{D} \\ v_{Q} \end{vmatrix}$$
 (3.2a)

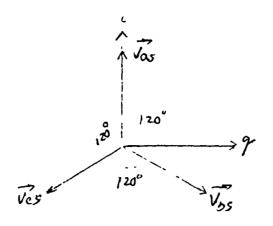


Fig. 3.1

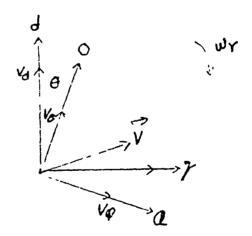


Fig. 3.2

$$\begin{vmatrix} v_{D} \\ v_{Q} \end{vmatrix} = \begin{vmatrix} \cos \theta & \sin \theta \\ -\sin \theta & \cos \theta \end{vmatrix} \begin{vmatrix} v_{d} \\ v_{q} \end{vmatrix}$$
 (3.2b)

The \vec{v} is rotating clockwise at angular velocity ω_r .

3.3 Induction Motor d-q-0 Variables

For simplicity in the definitions of the d-q and D-Q reference frames, only two axes were considered. In general, it is desirable to consider three coordinate axes for two reasons. Matrix transformation methods can be used to transform variables from one reference frame to another, but only if the transformation matrices are square and nonsingular matrices. Thus, for three phase situations with three phase variables, it is necessary to consider transformations to coordinate axes where three variables exist. For balanced and symmetrical cases, it is often sufficient to consider only d-q variables. However, the three d-q-O variables are necessary in the most general situations.

In the remainder of this report we are concerned with the d-q-O reference frame. Again, this is a reference frame fixed with respect to the stator. The O-variables will not only make it possible to use matrix transformation techniques, but they also will have important physical significance in many cases.

For this report, the d-q-O transformation from stator three phase voltages or currents is defined as follows

$$\begin{vmatrix} v_{ds} \\ v_{qs} \end{vmatrix} \triangleq \frac{2}{3} \begin{vmatrix} 1 & \cos 2\pi/3 & \cos (-2\pi/3) \\ 0 & \sin 2\pi/3 & \sin (-2\pi/3) \end{vmatrix} \begin{vmatrix} v_{as} \\ v_{bs} \\ v_{cs} \end{vmatrix}$$
(3.3a)

$$\begin{vmatrix} i_{ds} \\ i_{qs} \end{vmatrix} \triangleq \frac{2}{3} \begin{vmatrix} 1 & \cos 2\pi/3 & \cos(-2\pi/3) \\ 0 & \sin 2\pi/3 & \sin(-2\pi/3) \end{vmatrix} \begin{vmatrix} 1_{as} \\ 1_{bs} \end{vmatrix}$$

$$\begin{vmatrix} i_{0s} \\ 1/2 & 1/2 \end{vmatrix} \begin{vmatrix} 1/2 & 1/2 \\ 1/2 & 1/2 \end{vmatrix} \begin{vmatrix} i_{cs} \\ i_{cs} \end{vmatrix}$$
(3.3b)

Equations (3.3a) and (3.3b) transform the three phase stator line-to-neutral voltages or line currents to d-q-O coordinate voltages or currents. It should be noted that

$$i_{0s} = 1/3 (i_{as} + i_{bs} + i_{cs})$$
 (3.4a)

and thus i_{0s} is zero for all three wire machines where no neutral is present. This is a consequence of Kirchoff's current law. However,

$$v_{0s} = 1/3 (v_{as} + v_{bs} + v_{cs})$$
 (3.4b)

is zero when balanced and symmetrical three phase line-to-neutral voltages are involved, but it is not zero in general.

Equations (3.3a) or (3.3b) apply to the transformation of stator three phase to d-q-O quantities for all circuit variables including flux linkages as well as the voltages and currents.

The d-q-O transformation for rotor quantities is defined as follows

$$\begin{vmatrix} v_{dr} \\ v_{qr} \end{vmatrix} \triangleq \frac{2}{3} \begin{vmatrix} \cos \theta & \cos(\theta + 2\pi/3) & \cos(\theta - 2\pi/3) \\ \sin(\theta + 2\pi/3) & \sin(\theta - 2\pi/3) \end{vmatrix} \begin{vmatrix} v_{ar} \\ v_{br} \end{vmatrix}$$

$$\begin{vmatrix} v_{dr} \\ v_{cr} \end{vmatrix} = \frac{2}{3} \begin{vmatrix} \sin \theta & \sin(\theta + 2\pi/3) & \sin(\theta - 2\pi/3) \\ 1/2 & 1/2 \end{vmatrix} \begin{vmatrix} v_{cr} \\ v_{cr} \end{vmatrix}$$

$$\begin{vmatrix} v_{dr} \\ v_{dr} \end{vmatrix} = \frac{2}{3} \begin{vmatrix} \sin \theta & \sin(\theta + 2\pi/3) & \sin(\theta - 2\pi/3) \\ 1/2 \end{vmatrix} \begin{vmatrix} v_{dr} \\ v_{cr} \end{vmatrix}$$

Equation (3.5) transforms the rotor quantities, which are given in a three phase coordinate frame rotating with angular velocity $\omega_{\mathbf{r}}$, to the d-q-0 reference frame fixed with respect to the stator. The same transformation as in (3.5) is used to transform currents and flux linkages. Fig. 3.3 illus-

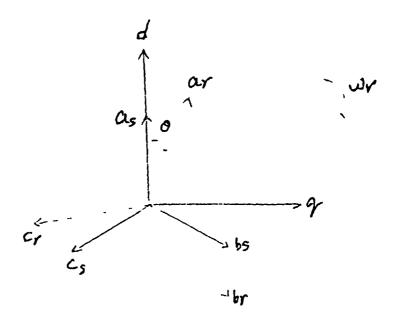


Fig. 3.3

trates this relationship. The O-axis is orthogonal to the d and q-axes, and it may be considered directed into the paper.

A number of additional transformation relations are given as follows

for stator variables

$$|\vec{v}_{s}| = |A_{s}|^{-1} |v_{dq0}^{s}|$$
 (3.6a)

$$|\vec{i}_{s}| = |A_{s}|^{-1} |\vec{i}_{dq0}^{s}|$$
 (3.6b)

$$|\vec{\lambda}_{s}| = |A_{s}|^{-1} |\lambda_{dq0}^{s}|$$
 (3.6c)

and for stator variables

$$|\vec{v}_r| = |A_r|^{-1} |v_{dq0}^r|$$
 (3.7a)

$$|\vec{\tau}_r| = |A_r|^{-1} |\vec{\tau}_{dq0}|$$
 (3.7b)

$$|\vec{\lambda}_r| = |A_r|^{-1} |\lambda_{dq0}^r|$$
 (3.7c)

where

$$|A_{s}| = \frac{2}{3} \begin{vmatrix} 1 & -1/2 & -1/2 \\ 0 & \sqrt{3}/2 & -\sqrt{3}/2 \\ 1/2 & 1/2 & 1/2 \end{vmatrix}$$
 (3.8)

$$|A_{S}|^{-1} = \begin{vmatrix} 1 & 0 & 1 \\ -1/2 & \sqrt{3}/2 & 1 \\ -1/2 & -\sqrt{3}/2 & 1 \end{vmatrix}$$
 (3.9)

$$|A_r| = \frac{2}{3} \begin{vmatrix} \cos \theta & \cos(\theta + 2\pi/3) & \cos(\theta - 2\pi/3) \\ \sin \theta & \sin(\theta + 2\pi/3) & \sin(\theta - 2\pi/3) \end{vmatrix}$$
 (3.10)

$$|A_r|^{-1} = \begin{vmatrix} \cos \theta & \sin \theta & 1 \\ \cos(\theta + 2\tau/3) & \sin(\theta + 2\tau/3) & 1 \\ \cos(\theta + 2\tau/3) & \sin(\theta - 2\pi/3) & 1 \end{vmatrix}$$
(3.11)

From (2.7), the motor voltage equations are

$$|\vec{v}_{s}| = R_{s} |\vec{1}_{s}| + P L_{1s} |\vec{1}_{s}| + P_{s} |\vec{\lambda}_{s}|$$
 (3.12)

$$|\vec{v}_r| = R_r |\vec{i}_r| + P L_{1r} |\vec{i}_r| + P |\vec{\lambda}_r|$$
 (3.13)

Substituting (3.6) and (3.7) into (3.12) and (3.13) respectively gives

$$|A_{s}|^{-1} |v_{dq0}^{s}| = R_{s} |A_{s}|^{-1} |i_{dq0}^{s}| + L_{1s} P |A_{s}|^{-1} |i_{dq0}^{s}| + P |A_{s}|^{-1} |\lambda_{dq0}^{s}|$$
(3.14)

$$|A_{r}|^{-1} |v_{dq0}^{r}| = R_{r} |A_{r}|^{-1} |i_{dq0}^{r}| + L_{1r} P |A_{r}|^{-1} |i_{dq0}^{r}| + P |A_{r}|^{-1} |\lambda_{dq0}^{r}|$$
(3.15)

Equation (3.15) can be expanded as

$$|A_{r}|^{-1} |v_{dq0}^{r}| = R_{r} |A_{r}|^{-1} |i_{dq0}^{r}| + L_{1r} |PA_{r}|^{-1} |\lambda_{dq0}^{r}| + L_{1r} |A_{r}|^{-1} |\lambda_{dq0}^{r}| + L_{1r} |A_{r}|^{-1} |A$$

Equation (3.14) need not be expanded because the matrix $|A_S|^{-1}$ is constant.

It can be shown that [1]

$$P|A_r|^{-1} = -|A_r|^{-1} \{P|A_r|\} |A_r|^{-1}$$
(3.17)

Substituting (3.17) into (3.16) gives

$$|A_{r}|^{-1} |v_{dqn}^{r}| = R_{r} |A_{r}|^{-1} |i_{dq0}^{r}| + L_{1r} [-|A_{r}|^{-1} |P|A_{r}|] |A_{r}|^{-1} |i_{dq0}^{r}|$$

$$+ L_{1r} |A_{r}|^{-1} |P| |i_{dq0}^{r}| + [-|A_{r}|^{-1} |P| |A_{r}|^{-1} |A_{r}|^{-$$

Multiplying both sides of (3.14) and (3.18) by $|A_{\rm S}|$ and $|A_{\rm r}|$ respectively gives

$$|v_{dq0}^{s}| = R_{s} |v_{dq0}^{s}| + L_{1s} P |v_{dq0}^{s}| + P |\lambda_{dq0}^{s}|$$
 (3.19)

$$|v_{dq0}^{r}| = R_{r} |i_{dq0}^{r}| + L_{1r} P |i_{dq0}^{r}| - L_{1r} \{P |A_{r}|\} |A_{r}|^{-1} |i_{dq0}^{r}|$$

$$+ P |v_{dq0}^{r}| - \{P |A_{r}|\} |A_{r}|^{-1} |\lambda_{dr0}^{r}| \qquad (3.20)$$

The expressions $(P |A_r|) |A_r|^{-1}$ in (3.20) can be evaluated using matrix algebra, which is shown in Appendix I. The result is

$$\{P \mid A_{r}'\} \mid A_{r}|^{-1} = \begin{vmatrix} 0 & -1 & 0 \\ 1 & 0 & 0 \\ 0 & 0 & 0 \end{vmatrix} \frac{d\theta}{dt}$$
(3.21)

where

$$\frac{d\theta}{dt} \stackrel{\triangle}{=} \omega_r$$

Substituting (3.21) into (3.20) gives

$$|v_{dq0}^{r}| = R_{r} |i_{dq0}^{r}| + L_{1r} P |i_{dq0}^{r}| + L_{1r} \omega_{r} |H| |i_{dq0}^{r}|$$

$$+ P |\lambda_{dq0}^{r}| + \omega_{r} |H| |\lambda_{dq0}^{r}| \qquad (3.23)$$

Equations (3.19) and (3.23) are the motor voltage equations in the d-q-0 frame.

Now, the flux linkage equations are expressed in terms of d-q-0 current as follows. Matrix (2.19) can be written

$$\begin{vmatrix} \dot{\lambda}_{s} \\ \dot{\lambda}_{s} \end{vmatrix} = \begin{vmatrix} L_{1} \\ \dot{i}_{s} \end{vmatrix} + \begin{vmatrix} L_{2} \\ \dot{i}_{r} \end{vmatrix}$$
 (3.24)

$$|\lambda_r| = |L_3| |i_s| + |L_4| |i_r|$$
 (3.25)

Substituting (3.6c) and (3.6b) into (3.24) and (3.7c) and (3.7b) into (3.25) gives

$$|A_{s}^{-1}| |\lambda_{dq0}^{s}| = |L_{1}| |A_{s}|^{-1} |i_{dq0}^{s}| + |L_{2}| |A_{r}|^{-1} |i_{dq0}^{r}|$$
(3.26)

$$\begin{vmatrix} -1 \\ |A_r| & |\lambda_{dq0}^r| = |L_3| & |A_s|^{-1} & |i_{dq0}^s| + |L_4| & |A_r|^{-1} & |i_{dq0}| \end{vmatrix}$$
 (3.27)

Multiplying both sides of (3.26) by A_s and (3.27) by A_r gives

$$|\lambda_{dq0}^{s}| = |A_{s}| |L_{1}| |A_{s}|^{-1} |i_{dq0}^{s}| + |A_{s}| |L_{2}| |A_{r}|^{-1} |i_{dq0}^{r}|$$
 (3.28)

$$|\lambda_{dq0}^{r}| = |A_{r}| |L_{3}| |A_{s}|^{-1} |i_{dq0}^{s}| + |A_{r}| |L_{4}| |A_{r}|^{-1} |i_{dq0}^{r}|$$
 (3.29)

where

$$|A_s| |L_2| |A_r|^{-1} = 3/2 L_{mr} \begin{vmatrix} 1 & 0 & 0 \\ 0 & 1 & 0 \\ 0 & 0 & 0 \end{vmatrix}$$
 (3.30a)

$$[A_s] [L_1] [A_s]^{-1} = 3/2 L_{ms} \begin{vmatrix} 1 & 0 & 0 \\ 0 & 1 & 0 \\ 0 & 0 & 0 \end{vmatrix}$$
 (3.31a)

$$|A_{r}'| L_{4} |A_{r}|^{-1} = 3/2 L_{mr} \begin{vmatrix} 1 & 0 & 0 \\ 0 & 1 & 0 \\ 0 & 0 & 0 \end{vmatrix}$$
(3.31b)

as shown in Appendix II. Substituting (3.30) and (3.31) into (3.28) and (3.29), respectively, gives

$$|\lambda_{d00}^{S}| = 3/2 L_{ms} |E| |i_{d00}^{S}| + 3/2 L_{mr} |E| |i_{d00}^{r}|$$
 (3.32)

$$|\lambda_{dq0}^{r}| = 3/2 L_{ms} |E| |i_{dq0}^{s}| + 3/2 L_{mr} |E| |i_{dq0}^{r}|$$
 (3.33)

where

$$|E| = \begin{vmatrix} 1 & 0 & 0 \\ 0 & 1 & 0 \\ 0 & 0 & 0 \end{vmatrix}$$
 (3.34)

Equations (3.32) and (3.33) can be written in matrix form using (3.34)

Equations (3.32) and (3.33) can be substituted into (3.19) and (3.23) yielding

$$|v_{dq0}^{S}| = R_{S} \cdot 1_{dq0}^{S} + L_{1S} P \cdot 1_{dq0}^{S} + 3/2 P L_{mS} \cdot |E| \cdot 1_{dq0}^{S}.$$

$$+ 3/2 P L_{mr} \cdot |E| \cdot 1_{dq0}^{r}.$$

$$|v_{dq0}^{R}| = R_{r} \cdot 1_{dq0}^{R} + L_{1r} P \cdot 1_{dq0}^{R} + L_{1r} \omega_{r} \cdot |H| \cdot |I_{dq0}^{R}|$$

$$+ 3/2 P L_{mS} \cdot |E| \cdot 1_{dq0}^{S} + 3/2 P L_{mr} \cdot |E| \cdot |I_{dq0}^{R}|$$

$$+ 3/2 \omega_{r} \cdot |H| \cdot L_{mS} \cdot |E| \cdot |I_{dq0}^{S}| + 3/2 \omega_{r} \cdot |H| \cdot L_{mr}$$

$$|E| \cdot |I_{dq0}^{R}|$$

$$(3.37)$$

where the motor equations are written in terms of d-q-0 currents. The final matrix in d-q-0 coordinates is found by writing (3.36) and (3.37) in matrix form

where

$$L_s = L_{1s} + 3/2 L_{ms}$$

$$L_r = L_{1r} + 3/2 L_{mr}$$

For the symmetrical three phase induction machine with wye-connected windings having no neutral connections, the 0-components disappear so that d-q-0 coordinates become d-q coordinates, reducing (3.32) to

$$\begin{vmatrix} v_{ds} & R_{s} + PL_{s} & 0 & \frac{3}{2}PL_{mr} & 0 & |i_{ds}| \\ v_{qs} & 0 & R_{s} + PL_{s} & 0 & \frac{3}{2}PL_{mr} & |i_{qs}| \\ v_{dr} & \frac{3}{2}PL_{ms} & \frac{3}{2}rL_{ms} & R_{r} + PL_{s} & \omega_{r}L_{r} & |i_{dr}| \\ v_{qr} & -\frac{3}{2}rL_{ms} & \frac{3}{2}PL_{ms} & -rL_{r} & R_{r} + PL_{s} & |i_{qr}| \end{vmatrix}$$
(3.39)

4.0 RESULTS

Matrix methods have been used to derive the d-q equations for the induction machine. The resulting matrix equation (3.39) is much simpler than the conventional three phase representation. Only four voltage and current variables are involved instead of six. Also, the representation of (3.39) is very useful in control analysis using state variable methods and optimization techniques.

APPENDIX I

†

Equation (3.21) is derived as follows.

From (3.10),

P
$$|A_r| = 2/3$$
 $\begin{vmatrix} -\sin \theta & -\sin(\theta + 2\pi/3) & -\sin(\theta - 2\pi/3) \\ \cos \theta & \cos(\theta + 2\pi/3) & \cos(\theta - 2\pi/3) \\ 0 & 0 & 0 \end{vmatrix}$ $\frac{d\theta}{dt}$

Therefore, $[P_{i}A_{n}]$; $[A_{n}^{i-1}]$ can be expressed

$$| -\sin\theta - \sin(\theta + 2\pi/3) - \sin(\theta - 2\pi/3) | \cos\theta - 2\pi/3 | \cos\theta$$

Multiplying the first row of P $|A_r|$ by the first column of $|A_r|^{-1}$ yields

$$-\sin \theta \cdot \cos \theta - \sin (\theta + 2\pi/3) \cos(\theta + 2\pi/3) - \sin(\theta - 2\pi/3) \cos(\theta - 2\pi/3)$$

$$= - \frac{1}{2} \sin 2\theta + \frac{1}{2} \sin 2 (\theta - 2\pi/3) + \frac{1}{2} \sin 2 (\theta + 2\pi/3)^{\frac{1}{2}}$$

$$= -\frac{1}{2} \frac{1}{3} \sin 2\theta + \sin (2\theta + 2\pi/3) + \sin (2\theta - 2\pi/3)^{\frac{1}{2}}$$

$$= -\frac{1}{2} \frac{1}{3} \sin 2\theta + 2 \sin 2\theta (\cos 2\pi/3)^{\frac{1}{2}}$$

$$= -\frac{1}{2} \frac{1}{3} \sin 2\theta - \sin 2\theta = 0$$

Next, multiplying the first row of P $|A_r|$ by the second column of $|A_r|^{-1}$ gives

$$-\sin\theta^{2} - \sin^{2}(\theta + 2\pi/3) - \sin^{2}(\theta - 2\pi/3)$$

$$= - |1/2 - 1/2 \cos 2\theta + 1/2 - 1/2 \cos 2 (\theta + 2\pi/3) + 1/2 - 1/2 \cos 2(\theta - 2\pi/3)$$

$$= - 3/2 + 1/2 |\cos 2\theta + \cos (2\theta + 2\pi/3) + \cos (2\theta - 2\pi/3)$$

$$= - 3/2 + 1/2 |\cos 2\theta + 2 (\cos 2\theta) (\cos 2\pi/3)|$$

$$= - 3/2 + 1/2 |\cos 2\theta - \cos 2\theta| = - 3/2$$

Finally, the first row of P $|{\bf A_r}|$ is multiplied by the third column of $|{\bf A_r}|^{-1}$ which yields

-
$$\sin \theta$$
 - $\sin(\theta + 2\pi/3)$ - $\sin(\theta - 2\pi/3) = 0$

Thus, the first row of (3.21) has been derived. The second and third rows of (3.21) are derived in a similar manner.

APPENDIX II

Equation (3.30) is derived as follows, using $|A_s|$ from (3.8), $|L_2|$ from (2.18b) and A_r from (3.10).

First, $|A_s|$ $|L_2|$ is determined. Multiplying the first row of $|A_s|$ by the first, second and third columns of $|L_2|$

$$\cos\theta - \frac{1}{2}\cos^2\theta - \frac{2\pi}{3} - \frac{1}{2}\cos^2\theta + \frac{2\pi}{3}$$

$$\cos\theta - \frac{1}{4}\cos\theta - \frac{\sqrt{3}}{4}\sin\theta + \frac{1}{4}\cos\theta + \frac{\sqrt{3}}{4}\sin\theta$$

$$(1 + \frac{1}{4} + \frac{1}{4})\cos\theta = \frac{3}{2}\cos\theta$$
(1)

$$-1/2 \cos \theta - 3/2 \sin \theta - 1/2 \cos \theta + 1/4 \cos \theta - \sqrt{3}/4 \sin \theta$$

 $(-1/2 - 1/2 + 1/4)\cos \theta - 3 (\sqrt{3}/4) \sin \theta = -3/4\cos \theta - 3(\sqrt{3}/4)\sin \theta$ (2)

$$\cos(-2/3) - 1/2 \cos(+2/3) - 1/2\cos\cos(\theta - 2\pi/3) - 1/2\cos(\theta + 2\pi/3) - 1/2\cos\theta$$

 $\cos(\theta+2\pi/3) - 1/2 \cos\theta - 1/2 \cos(\theta-2\pi/3)$

$$-1/2\cos\theta + \sqrt{3}/2\sin\theta + 1/4\cos\theta + \sqrt{3}/4\sin\theta - 1/2\cos\theta$$

$$(-1/2 - 1/2 + 1/4) \cos\theta + 3(\sqrt{3}/4) \sin\theta = -3/4 \cos\theta + 3(\sqrt{3}/4) \sin\theta$$
 (3)

Multiplying the second row of $|A_S|$ by the first, second and third columns of $|L_2|$ gives

$$3/2 \cos(\theta-2\pi/3) - \sqrt{3}/2 \cos\theta(\pi+2\pi/3)$$
.
 $-\sqrt{3}/4 \cos\theta + 3/4\sin\theta + \sqrt{3}/4 \cos\theta + 3/4\sin\theta$
= $3/2 \sin\theta$ (4)

$$\sqrt{3}/2\cos\theta - \sqrt{3}/2\theta(-1/2\cos\theta + \sqrt{3}/2\sin\theta)$$
 $\sqrt{3}/2\cos\theta + \sqrt{3}/4\cos\theta - 3/4\sin\theta$
= $3(\sqrt{3}/4)\cos\theta - 3/4\sin\theta$ (5)
 $\sqrt{3}/2\cos(\theta+2\pi/3) - \sqrt{3}/2\cos\theta$
- $3/4\cos\theta - 3/4\sin\theta - \sqrt{3}/2\cos\theta$
= $-3(\sqrt{3}/4)\cos\theta - 3/4\sin\theta$ (6)

Multiplying the third row of $|A_s|$ by the first, second and third column of $|L_2|$ gives

1/2
$$\cos\theta + \cos(\theta - 2\pi/3) + \cos(\theta + 2\pi/3)$$

1/2 $\cos\theta - 1/2\cos\theta + \sqrt{3}/2\sin\theta - 1/2\cos\theta - \sqrt{3}/2\sin\theta$
1 - 1/2 - 1/2 = 0 (7)
1/2 | | = 0 (8)
1/2 | | = 0 (9)

The resulting A_s L_2 is now multiplied by A_r :

The first row of $|{\rm A_s}|~|{\rm L_2}|$ is now multiplied by the first, second and third columns of $|{\rm A_r}|^{-1}$

$$3/2\cos^{2}\theta + (-3/4\cos\theta - 3(\sqrt{3}/4)\sin\theta) (-1/2\cos\theta - \sqrt{3}/2\sin\theta)$$
+ $(-3/4\cos\theta + 3(\sqrt{3}/4)\sin\theta) (-1/2\cos\theta + \sqrt{3}/2\sin\theta)$

$$3/2\cos^{2}\theta + \sqrt{3}/8\cos^{2}\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 9/8\sin^{2}\theta$$
+ $\sqrt{3}/8\cos^{2}\theta - 3(\sqrt{3}/8)\sin\theta\cos\theta - 3(\sqrt{3}/8)\sin\theta\cos\theta - 9/8\sin^{2}\theta$

$$3/2\cos^{2}\theta + 3/8\cos^{2}\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 9/8\sin^{2}\theta$$

$$3/2\cos^{2}\theta + 3/8\cos^{2}\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 9/8\sin^{2}\theta$$
+ $3/8\cos^{2}\theta - 3(\sqrt{3}/8)\sin\theta\cos\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 9/8\sin^{2}\theta$

$$3/2 + 3/8 + 3/8 = 9/4\cos^{2}\theta + 9/4\sin^{2}\theta = 9/4$$
(11)
$$3/2\sin\theta\cos\theta + (-3/4\cos\theta - 3(\sqrt{3}/4)\sin\theta)(-1/2\sin\theta + \sqrt{3}/2\cos\theta)$$
+ $(-3/4\cos\theta + 3(\sqrt{3}/4)\sin\theta)(-1/2\sin\theta - \sqrt{3}/2\cos\theta)$

$$3/2\sin\theta\cos\theta + 3/8\cos\theta\sin\theta - 3(\sqrt{3}/8)\cos^{2}\theta + 3(\sqrt{3}/8)\sin^{2}\theta$$

$$-9/8\sin\theta\cos\theta + 3/8\cos\theta\sin\theta + 3(\sqrt{3}/8)\cos^{2}\theta - 3(\sqrt{3}/8)\sin^{2}\theta$$

$$-9/8\sin\theta\cos\theta = 0$$
(12)
$$= 0$$

The second row of $|A_{\rm S}|$ $|L_{\rm Z}|$ is now multiplied by the first, second and third columns of $|A_{\rm N}|^{-1}$

$$3/2\sin\theta\cos\theta + ((3\sqrt{3}/4)\cos\theta - 3/4\sin\theta)(-1/2\cos\theta - 3/2\sin\theta)$$

$$+ (-3(\sqrt{3}/4)\cos\theta - 3/4\sin\theta)(-1/2\cos\theta + \sqrt{3}/2\sin\theta)$$

$$3/2\sin\theta\cos\theta + -3(\sqrt{3}/8)\cos^2\theta - 9/8\sin\theta\cos\theta + 3/8\sin\theta\cos\theta$$

$$+ 3(\sqrt{3}/8)\sin^2\theta + 3(\sqrt{3}/8)\cos^2\theta - 9/8\sin\theta\cos\theta + 3/8\sin\theta\cos\theta - 3(\sqrt{3}/8)\sin^2\theta$$

$$3/2\sin\theta\cos\theta - 3(\sqrt{3}/8)\cos^2\theta - 9/8\sin\theta\cos\theta + 3/8\sin\theta\cos\theta$$

$$+ 3(\sqrt{3}/8)\sin^2\theta + 3(\sqrt{3}/8)\cos^2\theta - 9/8\sin\theta\cos\theta + 3/8\sin\theta\cos\theta$$

$$+ 3(\sqrt{3}/8)\sin^2\theta + 3(\sqrt{3}/8)\cos^2\theta - 9/8\sin\theta\cos\theta + 3/8\sin\theta\cos\theta - 3(\sqrt{3}/8)\sin^2\theta$$

$$= 0 \qquad (14)$$

$$3/2\sin^2\theta + (3(\sqrt{3}/4)\cos\theta - 3/4\sin\theta)(-1/2\sin\theta + \sqrt{3}/2\cos\theta)$$

 $3/2\sin^2\theta + (3(\sqrt{3}/8)\sin\theta\cos\theta + 9/8\cos^2\theta + 3/8\sin^2\theta - 3(\sqrt{3}/8)\sin\theta\cos\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 9/8\cos^2\theta + 3/8\sin^2\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta - 9/8\cos^2\theta + 3/8\sin^2\theta - 3(\sqrt{3}/8)\sin\theta\cos\theta - 9/8\cos^2\theta + 3/8\sin^2\theta - 3(\sqrt{3}/8)\sin\theta\cos\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 9/8\cos^2\theta + 3/8\sin^2\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 9/8\cos^2\theta + 9/8\cos^2\theta + 3/8\sin^2\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 9/8\cos^2\theta + 9/8\cos^2\theta + 9/8\cos^2\theta + 3/8\sin^2\theta + 3/8\sin^2\theta + 3(\sqrt{3}/8)\sin\theta\cos\theta + 9/8\cos^2\theta

The third row of $|A_s|$ $|L_2|$, multiplied by the first, second and third columns of $|A_r|^{-1}$, gives zero in each case.

Therefore,

$$|A_{s}| |L_{2}| |A_{r}| = \begin{vmatrix} 3/2L_{mr} & 0 & 0 \\ 0 & 3/2L_{mr} & 0 \\ 0 & 0 & 0 \end{vmatrix}$$

Equation (3.31) can be derived in the same manner.

★US GOVERNMENT PRINTING OFFICE 1985 -544 - 069 11055 REGION NO 4

